

Technical Service Bulletin (TSB)

Lifgate Tail Lamp Assembly Condensation/Water Intrusion

REFERENCE:	TSB: 23-029-26 GROUP: 23 - Body	Date:	July 18, 2026	REVISION:	—
VEHICLES AFFECTED:	2025 - 2026 (GC) Alfa Romeo Tonale This bulletin applies to vehicles built on or after June 20, 2025 (MDH 0620XX) and on or before February 06, 2026 (MDH 0206XX).			MARKET APPLICABILITY: ☒ NA ☐ EE ☐ SA ☐ CH ☐ IAP ☐ MEA NOTE: This bulletin applies to the North America markets.	
CUSTOMER SYMPTOM:	Customers may comment on the following: Condensation/water intrusion can be seen inside the liftgate tail lamp assembly.				
CAUSE:	Material defect				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-133, date of issue July 18, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting and possibly replacing the liftgate tail lamp assembly and nameplate.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-50-89-9A	Lamp, Liftgate - Inspect for Condensation (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
08-50-89-9B	Lamp, Liftgate - Inspect and Replace (0 - Introduction)	6 - Electrical and Body Systems	0.4 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68713584AA	Lamp, Liftgate	
1 (AR)	68330616AA	Nameplate, Alfa Romeo	(do not reuse the old nameplate)

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Inspect the liftgate tail lamp assembly for condensation or water intrusion [Fig. 1](#).



Fig. 1

Liftgate Tail Lamp Assembly Water Intrusion

2. Was any condensation or water intrusion observed?
 - YES >>> Proceed to [Step 3](#).
 - NO >>> This bulletin has been completed. Use Inspect LOP (08-50-89-9A) to close the active RSU.
3. Replace the liftgate tail lamp assembly. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 08 - Electrical / 8L - Lamps and Lighting / Lamps/Lighting - Exterior / Lamp, Tail / Removal and Installation.

NOTE: Do not remove and reuse the old nameplate.

NOTE: Do not touch the new rear nameplate adhesive surface during installation. Bond at an ambient temperature of no less than 18-20 °C (64-68 °F).

4. Install the **NEW** rear nameplate by removing the protective film from the adhesive back and positioning the nameplate on the inner tail lamp assembly engaging the locators [Fig. 2](#). Ensure proper adhesion by pressing evenly on the nameplate.

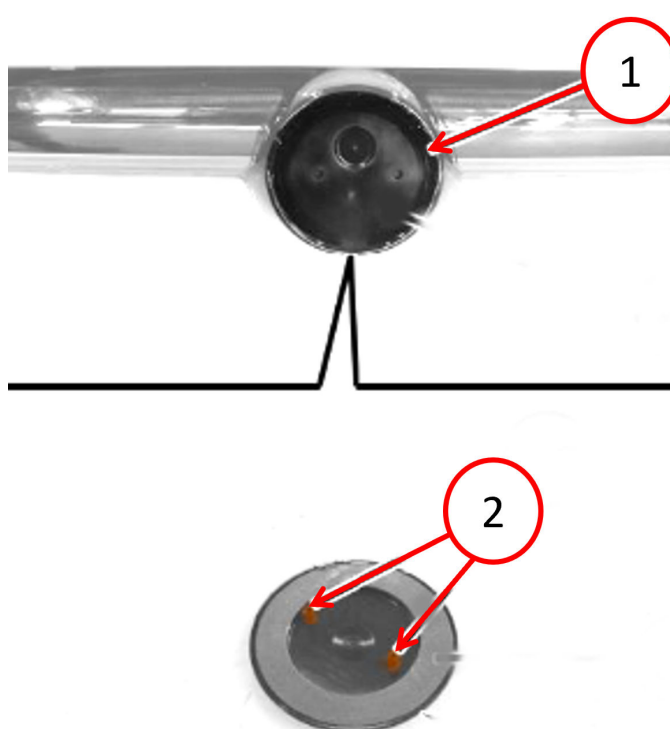


Fig. 2

New Nameplate Installation

1 - Liftgate Tail Lamp Nameplate Mounting Surface
2 - New Nameplate Locators

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.