

July 7, 2026

Version 1

Vibration or Rattle Noise from Front Passenger-Side Dashboard**APPLIES TO**

Year	Model	Trim Level	VIN Range
2024–26	Civic	4-Door	ALL

SYMPTOM

A vibration or rattle noise coming from the front passenger-side dashboard area while driving.

POSSIBLE CAUSE

The noise may be coming from the washer reservoir filler neck area. The noise usually occurs when the washer fluid level is half full or lower and is more noticeable in cold weather.

CORRECTIVE ACTION

Install garnish foam to the underside of the washer mouth bracket.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7420A2	Install garnish foam to the underside of the washer mouth bracket. (includes inspection)	0.3hr	06201	04505	A26069A	76821-T20-A01

PARTS INFORMATION

Part Name	Part Number	Quantity
Clip, Side Garnish (Foam)	91501-T20-A01	1
Clip, Cover (Lower)	91505-TY2-003	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

INSPECTION PROCEDURE

1. Click below to view the noise inspection video:

▶ **PLAY VIDEO**

2. Apply the parking brake and start the engine.
3. With the vehicle in **P** (Park), slowly increase the engine speed and hold it at ~1,700–2,000 rpm. With the help of an assistant, apply pressure on and off to the washer reservoir cap.
4. Is the noise isolated to the washer reservoir cap and/or filler neck area?

YES - Proceed to the **REPAIR PROCEDURE**.

NO - No repair is needed. Continue troubleshooting.

REPAIR PROCEDURE

1. Click below to view the installation video:

▶ **PLAY VIDEO**

2. Remove the washer reservoir cap/washer mouth from the washer reservoir.

NOTE: If the original cover clip is installed (**P/N 91505-S9A-003**), replace it with the updated cover clip (**P/N 91505-TY2-003**) during assembly.

NO GOOD ❌



91505-S9A-003

GOOD ✅




91505-TY2-003

3. Remove the garnish foam from the side garnish clip (**P/N 91501-T20-A01**). Use the foam piece for the repair and discard the garnish clip.



SIDE GARNISH CLIP

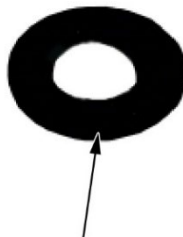

GARNISH FOAM

4. Apply the garnish foam to the underside of the washer mouth bracket.

NOTE: Ensure that the garnish foam does not block the washer mouth bracket hole.

5. Install the washer reservoir cap/mouth onto the washer reservoir, then secure it with the cover clip.

