



SSM 55044 2025-2026 Bronco/Ranger - Illuminated Powertrain Malfunction (Wrench) Indicator With DTCs P2122, P2123, P2127, P2128, And/Or P2138 Stored In The PCM

Some 2025-2026 Bronco/Ranger vehicles may exhibit an illuminated powertrain malfunction (wrench) indicator with diagnostic trouble codes (DTC) P2122, P2123, P2127, P2128, and/or P2138 stored in the powertrain control module (PCM). The vehicle may or may not exhibit a perceived lack of power intermittently. This may be due to an issue with the following connectors associated with the accelerator pedal position (APP) sensor circuits:

- C115B
- C175B
- C2040

Replacement of the accelerator pedal may not resolve this concern. Perform a wiggle test of the connectors while the engine is at normal operating temperature. Perform a visual inspection of the connectors as well as a terminal fit test using the appropriately sized flex probe. Repair as necessary. Refer to Wiring Diagram Cell 005. If no concerns are found, refer to Workshop Manual (WSM), Section 310-02 for normal diagnostics.