

ATTENTION:

GENERAL MANAGER ☐

PARTS MANAGER ☐

CLAIMS PERSONNEL ☐

SERVICE MANAGER ☐

IMPORTANT - All
Service Personnel
Should Read and
Initial in the boxes
provided, right.

© 2026 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2022-25MY WRX

SUBJECT: Trunk Latch / Repair Procedure

NUMBER: 12-282-26

DATE: 07/06/26

INTRODUCTION:

This Service Bulletin outlines a new repair procedure to follow when replacing the trunk lock assembly. Due to its mounting location, the holes behind the trunk lock assembly can allow dust to accumulate inside, which may cause the trunk lid to become difficult to close. If this symptom is reported perform the procedure outlined in this bulletin.

PRODUCTION CHANGE INFORMATION:

The production changes were incorporated into vehicle production as per the table below.

Model	Starting VIN
WRX	JF1VBAU65S8806625

REQUIRED MATERIALS:

- 3M 425 Aluminum Foil Tape or equivalent



CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

PART INFORMATION:


REMINDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

Part Description	Part Number
Lock Assembly-Trunk lid	57530AL000


SERVICE PROCEDURE / INFORMATION:

REMINDER: Customer satisfaction and retention starts with performing quality repairs.

Step 1: Remove old trunk lock assembly.

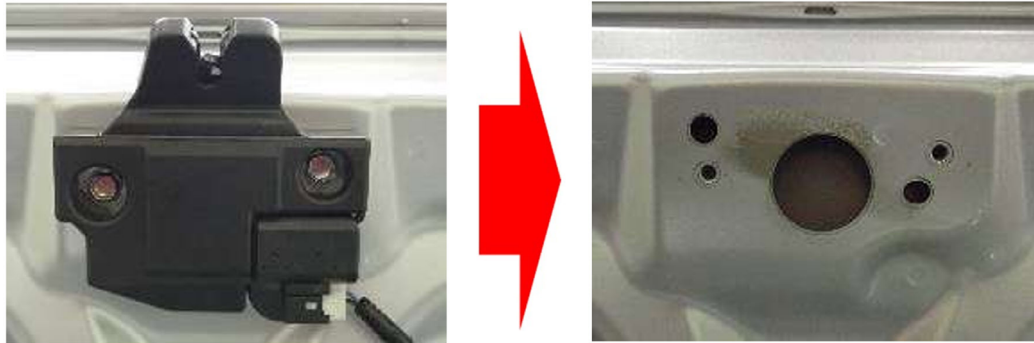

Step 2: Cut tape according to the dimensions provided in the template on page 4.

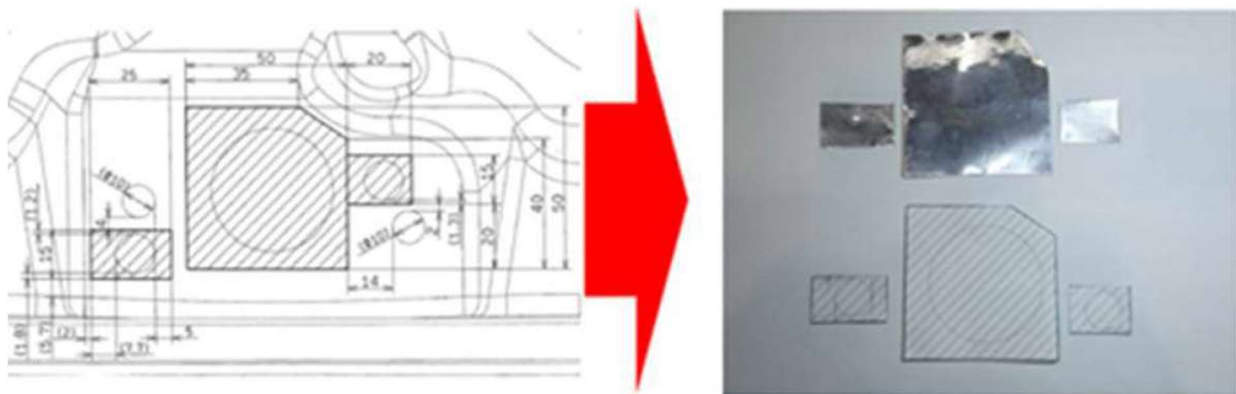

Step 3: Clean the body surface to ensure proper tape adhesion.



Continued...

Step 4: Apply the tape pieces, making sure the holes indicated below are completely covered.



Step 5: Install a **NEW** trunk lock assembly following the applicable service manual.



WARRANTY / CLAIM INFORMATION:

Ensure that the Trunk Lid Lock Assembly is set as the failed part. For vehicles within Basic New Car Limited Warranty, or an active Subaru Added Security Gold plan, this repair may be submitted using the following claim information:

Warranty Type	Labor Description	Labor Operation #	Labor Time	Fail Code	Skill Level
WC	Lock Assembly-Trunk lid R&R	915386	0.3h	SCL43	SL1 SG ALL

The Skill Group and Skill Level listed in this bulletin define the qualifications recommended for this work. Repairs should be dispatched to a technician who is trained at the specified level. For more information on Labor Operation Skill Group/Level assignments, [click here to access the Gear Reduction](#). To request a Skill Group/Skill Level change, [fill out this form](#).

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Continued...

TEMPLATE

