

L634-
A.14.26

To: After Sales Official Network
Subject: Carbon Rim Circlips Corrosion
Date: 13/07/2026
Pages: 3



Campaign code:
L634-A.14.26

Campaign name:
Carbon Rim Circlips Corrosion

Model:
Temerario

Model Year:
2026

Markets:
Georgia, United Kingdom, United States

VIN Involved:
ZHWUC1ZC4TLA00284,ZHWEC1ZC2TLA00630,
ZHWEC1ZC7TLA00638

Important information: before proceeding with the repair, connect to the Warranty Portal and, using the “VIN Info” function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

VIN
17 DIGITS VIN
MODEL NAME
Start Warranty DD/MM/YYYY End Warranty DD/MM/YYYY
Outstanding Campaigns
Code Type Description Bulletin Proc.
LXX-A.XX.XX CAMPAIGN NAME B
Next service planned at date



NOTE:

Operation A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:

During ongoing product monitoring, Automobili Lamborghini S.p.A. requires the replacement of circlips to prevent potential aesthetic corrosion of the component

Solution for the field:

Replace Carbon Rim Circlips for all wheels

Spare Parts:

OPERATION B

Part number	Description	Q.ty
4LA601163A	Circlips	20

Management of replaced parts:

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.

Labor time:

Operation B: 1 h

Previous bulletins superseded.

None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the “LIASS” system on the Lamborghini portal and, following the instructions in the system’s “Manuals” section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the

Rev.00

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.

Doc. no.: L/V6_M06 Rev.[07]

1/3



vehicle.

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPERATION B:**
 - Steps to be executed: from 1 to 5
 - Labour time: 1 h

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section “Service and Recall Campaigns”:

Tools/Materials required:

Code	Description.	Q.ty
n/a	n/a	n/a



NOTE:

All O.D.I.S. Service technical documentation can be viewed on the app “O.D.I.S. Self Service Guide” available on Lamborghini HUB portal.



Repair method:

OPERATION B (Rework for all wheels)

Follow the instructions given in the Workshop Manual at the following path:

Carbon rim, disassembly - Replacement Procedure

Suspension and Wheels > Wheels > Tires and Rims > Carbon rim disassembly - Replacement Procedure

Place the wheel assembly on a flat, non-abrasive surface, with the exterior surface facing down and the support plate facing up.



To replace the five circlips highlighted in red in the image above, following these steps:

-Using circlip pliers, insert the tips into the holes of the circlip and expand it sufficiently to remove it from the nut seat.

After removing the old circlip, install the new one.

-While supporting the nut seat, insert the tips of the circlip pliers into the holes of the new circlip and expand it sufficiently to fit it over the nut seat. Position the circlip in the groove provided on the nut seat.

-Check that the circlip is correctly seated and can rotate freely around the nut seat.

-Repeat this procedure for all wheels.



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service