



Connection offline

Technical Service Bulletin

Transaction No.:

2082488/2

96-26-02 - Front LED interior/reading light inop/warning for airbag system illuminated
/DTC U112100 and U116500 stored

Condition

Applicable Vehicles					
VW Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport, Tiguan	2026	All	All	All	All

Revision Table			
Instance Number	Publish Date	Version Number	Reason for Update
2082488/1	7/2/2026	96-26-01	Original Publication
2082488/2	7/6/2026	96-26-02	Incorrect 6 digit bulletin number.

Customer Statement:

- The front LED interior/reading light cannot be switched ON.

and/or

- The tilting/sliding sunroof cannot be opened.

and

- The airbag light in ON.

Workshop Findings:

- The customer statement can be reproduced.

and

In the airbag control unit (diagnostic address 0015) the following event entry is (actively/statically) logged:

- U112100 data bus, missing message

Symptom: 1078272

and

In the onboard supply control unit (address0009) the following event entry is (actively/statically) logged:

- U116500 roof control unit, no communication

Symptom: 953092

Technical Background



NOTICE

DTC and illumination of the airbag warning lamp do not affect airbag performance.

Production Solution

N/A.

Service


Reset control console with front LED interior/reading light (by disconnecting/connecting the connector)



NOTICE

Note that a replacement of the control console with front LED interior/reading light is not necessary. After the reset the complaints under “Customer statement / workshop findings” no longer occur.

- Unclip/remove control console with front LED interior/reading light (picture 1, number 1 in yellow) from the headliner according to the Repair Manual.

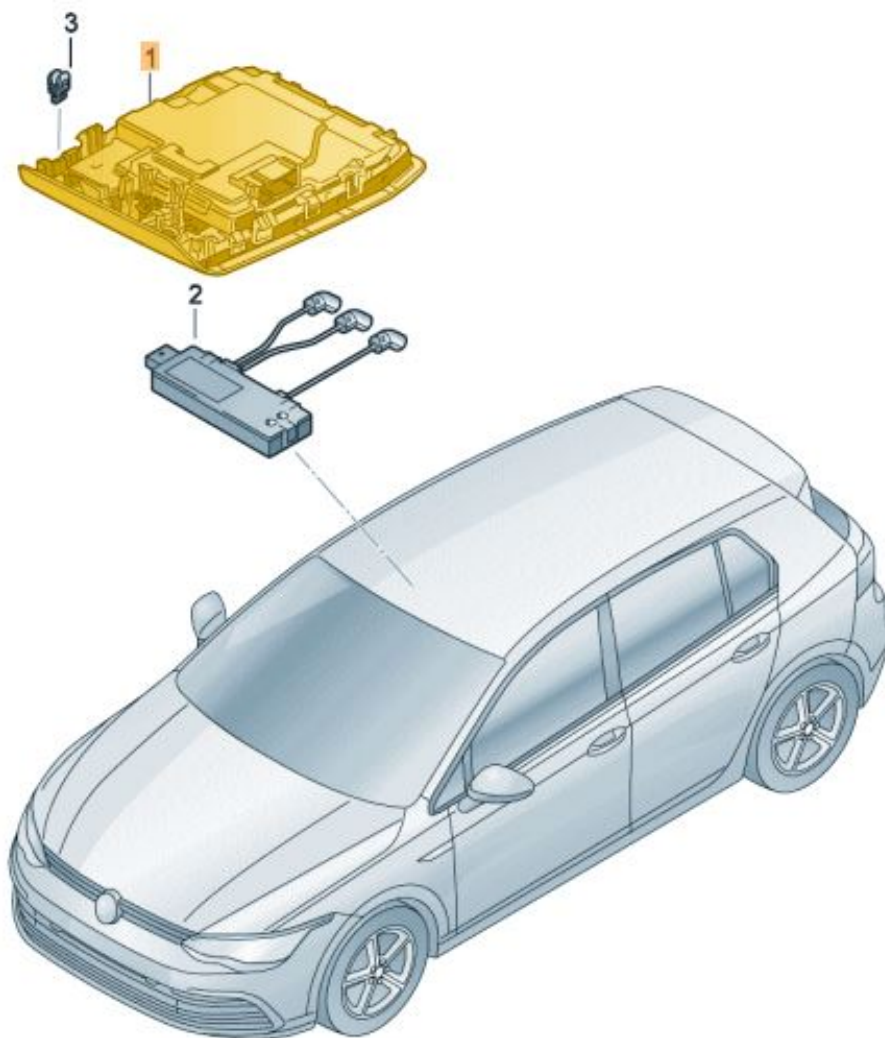

Picture 1) operating unit with front LED Interior/reading light (number 1/in yellow)

- Disconnect connector for the control console with front LED interior/reading light according to the Repair Manual for at least 10 seconds.
- Clip/Fit control console with LED interior/reading light according to the Repair Manual.
- Finally delete the event entry with the VAS Diagnostic Tool.

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual.

VW Models	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport, Tiguan	2026	All	All	All	All

SAGA Coding			
Claim Type:		Use applicable Claim Type ¹⁾	
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)
9618	0203	--	--
Parts Manufacture	Atlas, Atlas Cross Sport, Tiguan		VOA ²⁾
Atlas, Atlas Cross Sport			
Labor Operation ³⁾ : Interior Light Replace		96205550 = 10 TUs	
Labor Operation ³⁾ : Interior Light R&R		96201900 = 20 TUs	
Labor Operation ³⁾ :		27068950 = See ELSA for latest TUs	
Tiguan			
Labor Operation ³⁾ : Interior Light Replace		96205550 = 10 TUs	
Labor Operation ³⁾ : Interior Light R&R		96201910 = 20 TUs	
Labor Operation ³⁾ :		27068950 = See ELSA for latest TUs	
Diagnostic Time ⁴⁾			
GFF Time expenditure	01500060 = Actual GFF print out. 70 TU max.	YES	
Road Test	01210002 = 00 TU 01210004 = 00 TU	NO	
Technical Diagnosis	01320000 = 00 TU max.	NO	
Claim Comment: Input “As per Technical Bulletin 2082488” in comment section of Warranty Claim.			
Vehicle may be outside warranty in which this Technical Bulletin is informational only. Code per warranty vendor code policy. Labor Time Units (TUs) are subject to change with ELSA updates. Documentation required per Warranty Policies and Procedures Manual.			

Required Parts and Tools

No Special Parts required.

Tool Description	Tool No.
Midtronics Battery Tester/Charger	GRX3000VAS
Diagnostic Tool	VAS 6150/X & VAS 6160/X and ODIS Service with: current online updates.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2026 Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc. All rights reserved.

Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.