



Connection offline

## Technical Service Bulletin

Transaction No.: **2082553/2**

90 Panoramic display: noises in area of panoramic display, noises between panoramic display and background light module

Release date: Jul 16, 2026

## Condition

| Model(s) | Year(s) | VIN Range       | Vehicle Specific Equipment               |
|----------|---------|-----------------|------------------------------------------|
| Q3       | 2026    | 000000 – 104037 | With PR Code L0L and without PR Code QQ0 |
|          |         |                 | <b>0017 Instrument cluster</b>           |
|          |         |                 | <b>Hardware part number</b>              |
|          |         |                 | *83H*.920.034*                           |

| REVISION HISTORY |            |                                           |
|------------------|------------|-------------------------------------------|
| Revision         | Date       | Purpose                                   |
| 2                | -          | Revised header (Adjusted customer coding) |
| 1                | 06/29/2026 | Initial publication                       |

### Customer states:

Noises in area of panoramic display.

### Workshop findings:

Noises can be traced to the area between the panoramic display and the background lighting module under the panoramic display.

## Technical Background


Noises between panoramic display and background lighting module on vehicles fitted with the optional **background lighting package**.

## Production Solution

Implementation of an optimized background lighting module (part number 83H 947 197, designation in ETKA: light conductor) in model year 2026 with effect from vehicle identification number \*\*\*\*\*FJ\*T1104037 (ZP8 08.06.2026).

## Service

Please attach a piece of **felt (part number 443 857 991 Q)** in the area indicated by a green arrow in the image.

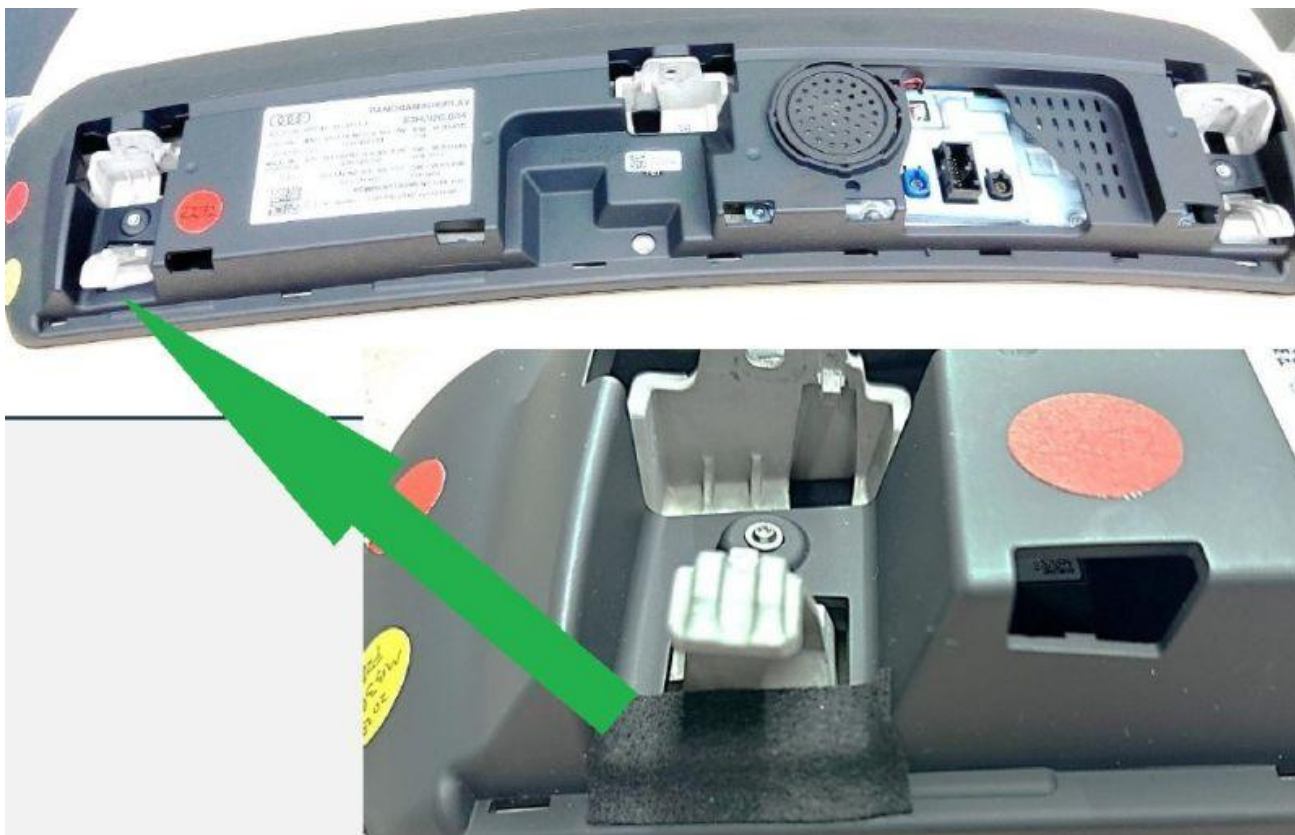

**Figure 1.** Attaching a piece of felt (example image).

## Warranty

|                          |                                                                                                                                                     |           |                                    |
|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-----------|------------------------------------|
| <b>Claim Type:</b>       | <ul style="list-style-type: none"> <li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul> |           |                                    |
| <b>Service Number:</b>   | 9025                                                                                                                                                |           |                                    |
| <b>Damage Code:</b>      | 0020                                                                                                                                                |           |                                    |
| <b>Labor Operations:</b> | Remove and install instrument cluster                                                                                                               | 9025 1900 | See SRT with associated operations |
|                          | Modify instrument cluster                                                                                                                           | 9025 4999 | 10 TU                              |
| <b>Claim Comment:</b>    | As per TSB 2082553/2                                                                                                                                |           |                                    |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

## Required Parts and Tools

| Part number | Designation                                       | Quantity |
|-------------|---------------------------------------------------|----------|
| 443857991Q  | Felt<br>(designation in ETKA: intermediate layer) | 1        |

## Additional Information

All part and service references provided in this TSB (**2082553**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2026 Audi of America, LLC / Audi Canada Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.