

**Malfunction Indicator Light, Fault On Power Electronics for Exhaust Gas Turbocharger (eATL)
"P2F1B00" in the DME Control Unit (25/26)**

Change
Overview:

Revision	Date	Change
0	05/26/2026	▪ First Publication
1	07/08/2026	▪ Update to Work Procedure
2	07/16/2026	▪ Update to Work Procedure

Model Year: **2025**

Vehicle Type: **911 GTS (992)/911 4 GTS (992)**

Concerns: **Electric turbocharger (eATL)**

Information: **The customer complains about the yellow malfunction indicator light (MIL) lighting up on the instrument cluster.**

One of the following fault memory entries is stored in the fault memory of the DME control unit:

- **P2F1B00** - Power electronics for exhaust gas turbocharger, electrical fault (**00B13D**)
- **P2F1B00** - Power electronics for exhaust gas turbocharger, electrical fault (**00B152**)

Action: In the event of a customer complaint, re-program the power electronics exhaust gas turbocharger via the DME control unit using the Porsche Tester.



Information

The minimum programming requirement is the Porsche Tester software release: **44.200.020** (or higher):



Information

Replacing the electric exhaust gas turbocharger (eATL) or the power electronics for the exhaust gas turbocharger is not effective for this fault symptom:

Required tools

Tools:

- **P90999 - Porsche Tester 4**
- Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e. g. **VAS 5908 - battery charger 90A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. → *Workshop Manual '270689 Battery, charge vehicle electrical system'*

Re-program the power electronics for exhaust gas turbocharger via the DME control unit

Work Procedure: 1 Re-program the power electronics for exhaust gas turbocharger via the DME control unit

The basic work procedure for control unit programming is described in the Workshop Manual.

⇒ *Workshop Manual '9X00IN Basic instructions and work procedure for control unit programming using the PIWIS Tester'*

Specific information on control unit programming during this action:

Required Porsche Tester software release:	44.200.020 (or higher)
Type of control unit programming:	Control unit programming using the ' Automatic programming ' function of the control unit: "DME" control unit – menu "Coding/programming" – function " Automatic programming ".
Programming sequence:	Read and follow the information and instructions on the Porsche Tester during the guided programming sequence. During the programming sequence, the DME control unit is re-programmed first, and then the transmission control unit is re-programmed . Thereafter, both control units are automatically re-coded . Do not interrupt programming and coding. Backup documentation for the re-programmed software releases starts after programming.
Programming duration:	Programming takes up to 12 minutes , depending on equipment.
Software programmed during this action:	▪ Power electronics for exhaust gas turbocharger Software release: 0021 (or higher) Note: Please see Work Procedure step 3 for instructions to read out the software version of the Power electronics for exhaust turbocharger.
Procedure in the event of error messages appearing during the programming sequence:	⇒ <i>Workshop Manual '9X00IN Basic instructions and work procedure for control unit programming using the PIWIS Tester'</i>
Procedure in the event of a termination in the control unit programming:	Repeat control unit programming by restarting programming.

2 Read out and delete all control unit fault memories.

- 3 Press **[F3]** to start the integration test in the control unit selection.
If there is an integration deviation for individual control units, these must be programmed before vehicle handover to the customer.



Information

If, despite the programming performed, a deviation is still displayed during the integration test, the test must be carried out again.

There must be no breaches of integration!

Control units with optional software – with the exception of the DME control unit and the transmission control unit – can be ignored.

Note: Following the successful completion of the integration test, the software version of the Electric Turbocharger can be read out via the detailed view. From the integration test control unit list, select the Electrical Charger then press **[F12]**. The detailed view for the Electrical Charger will be displayed and the software version will be visible.

- 4 End the diagnostic application, switch off the ignition and disconnect the **P90999 - Porsche Tester 4** from the vehicle.
- 5 Switch off and disconnect the battery charger.
⇒ *Workshop Manual '270689 Charge the vehicle electrical system battery'*

Labor position and PCSS encryption

Labor position:

APOS	Labor operation	I No.
24702540	Program DME control unit (power electronics for exhaust gas turbocharger)	

PCSS encryption:

Location (FES5)	21290	Power electronics for exhaust gas turbocharger
Damage type (SA4)	1613	occasionally without function

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.