

Noises in B-Pillar Area - Correct Felting of B-pillar Trim Panel (SY 61/26)

Model Line: **Taycan (Y1A/Y1B/Y1C)**

Model Year: **from 2025**

Concerns: **Reworking the B-pillar trim panel in the event of noises**

Information: **The customer complains about rattling/creaking noises from the B-pillar area.**

As a result, the inner area of the upper B-pillar trim panel is covered with felt during rework for noise insulation.




Information

If the B-pillar trim panel on the airbag ramp is reworked/taped with felt, the **airbag triggering behavior can be impaired**.

Remedial Action: In the event of a noise complaint from the area of the B-pillar in which the upper B-pillar trim panel in the inside is to be reworked with felt, **only -1-** mask the **guide pins**.

The airbag ramp -2- must not be covered with felt.

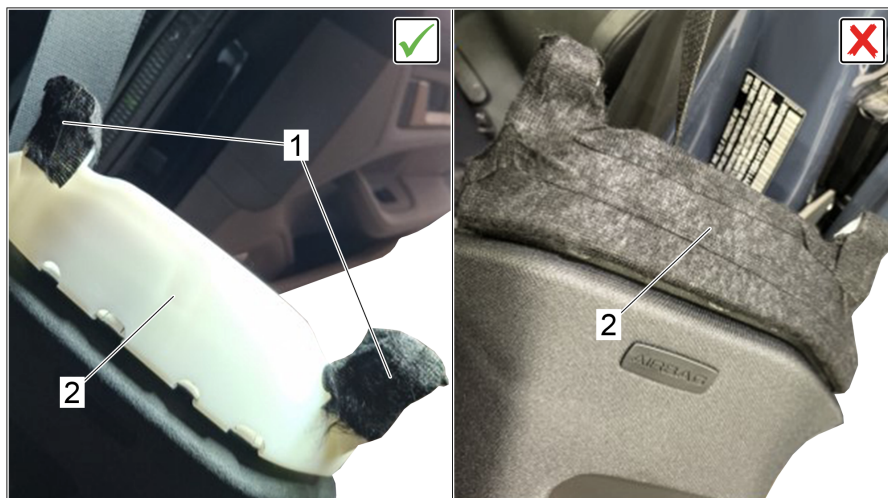

B-pillar trim panel

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.