

Technical Journal

TITLE:

Grinding Noise When Using the Indicator Lever

REF NO: TJ 37868.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7515 Polestar		ISSUE DATE: 2026-07-02	STATUS DATE: 2026-07-21
FUNC GROUP: 3644	FUNC DESC: Housing for direction indicator switch	Page 1 of 7	

Attachment

File Name	File Size
TJI-537279-2_1_3.pdf	1.4531 MB

DESCRIPTION:

If a customer complains on a grinding noise from SWM area when using the indicator lever, follow advice under Service.

CSC Customer Symptom Codes

Code	Description
F5	Gear selector/Unusual noise
H3	Steering wheel/Squeak/rattle/Steering column/wheel
H4	Steering/Unusual noise/Unsure when/at all times

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
814							2026-2026	16	-	202346-202615
814							2026-2026	96	-	202346-202606

Technical Journal 37868.1.0

SERVICE:

If the noise is the same as the attached sound file TJ_37868_1.mov, follow the instruction according to the attachment VCC-537279_2_1_3.

Abbreviations:

SWM - Steering wheel module

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ. Please note that fault tracing is not eligible for separate reimbursement under this TJ. Any fault tracing VST OP numbers will be rejected.
Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
98802-2	General Reimbursement acc to. TJ

LABOR TIME:

Labor time subject to change without notice.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report Polestar" and sub concern area "Support not needed Polestar", use function group 3644.

To view TJ attachment continue to next page. This TJ has one attachment.



Volvo Car Customer Service

TJ Instruction VCC-537279-2

Title	Steering wheel module (SWM)	Page	1 (5)
Action	Adjustment	Operation number:	98802-2

Issue	Date	Reason
1	2026-05	First issue

Affected vehicles


Model year	Model
2024, 2025, 2026	Polestar 4

Materials


Materials	Qty.	Part No.	Notes
Silicone grease	0.2	1161687	

Removal


Note! Removal steps in this procedure may contain installation details.

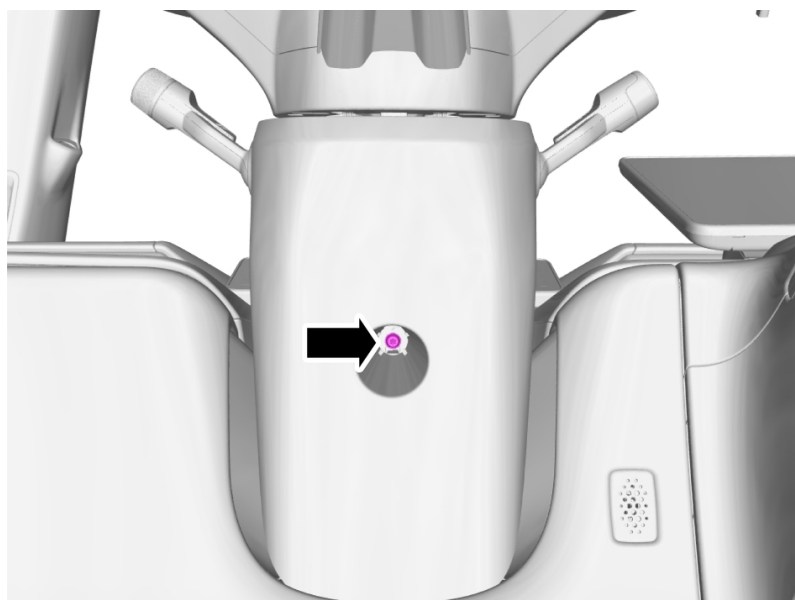


Remove the screw.

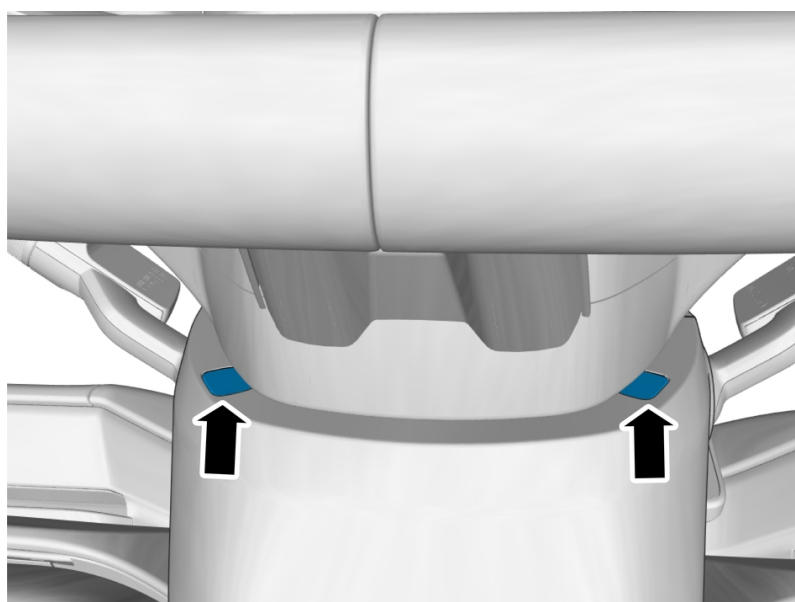


Remove the marked part.

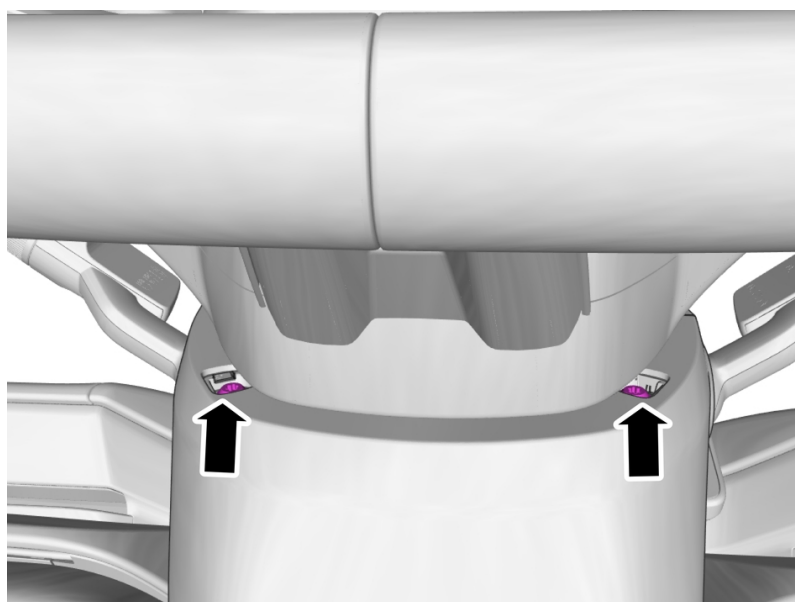


Remove the screws.

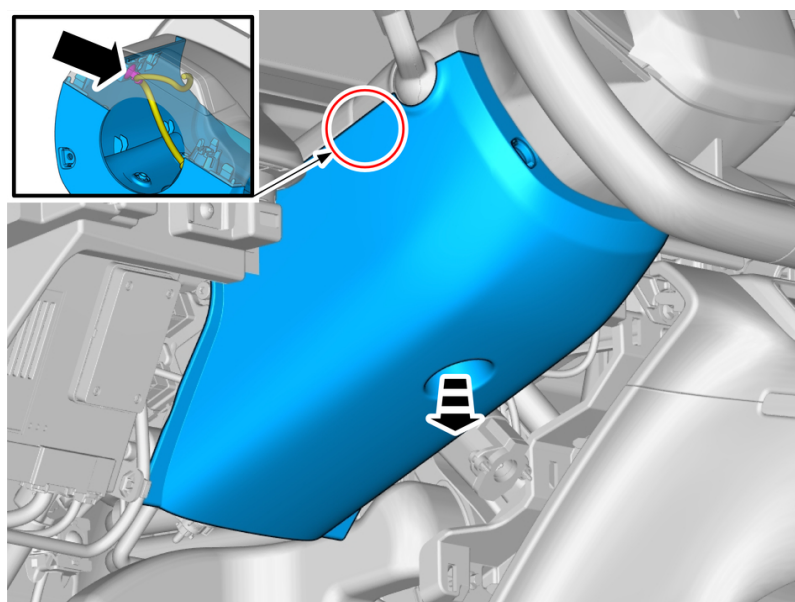


Loosen the clips.
Loosen the marked detail.

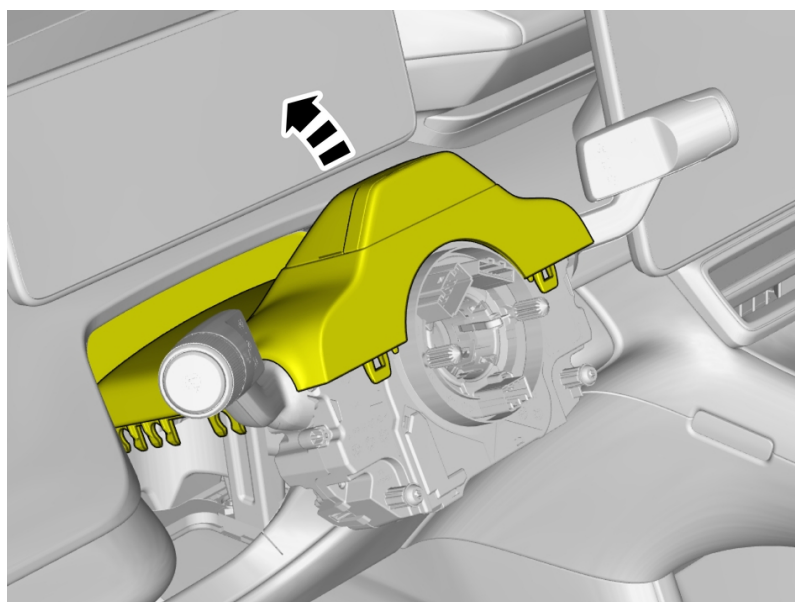

Loosen the component indicated. Do not remove it.

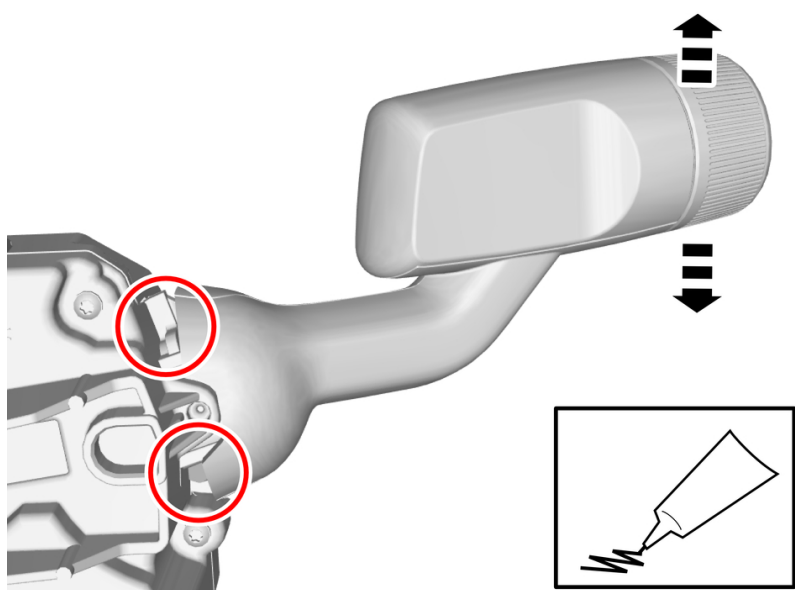


Note! Orientation view

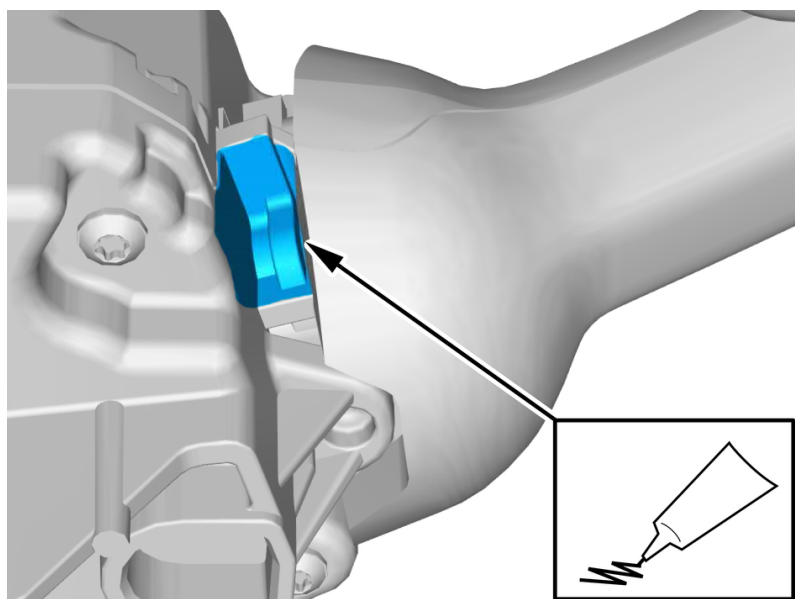

Apply grease on the area indicated.

Use: Silicone grease , 1161687

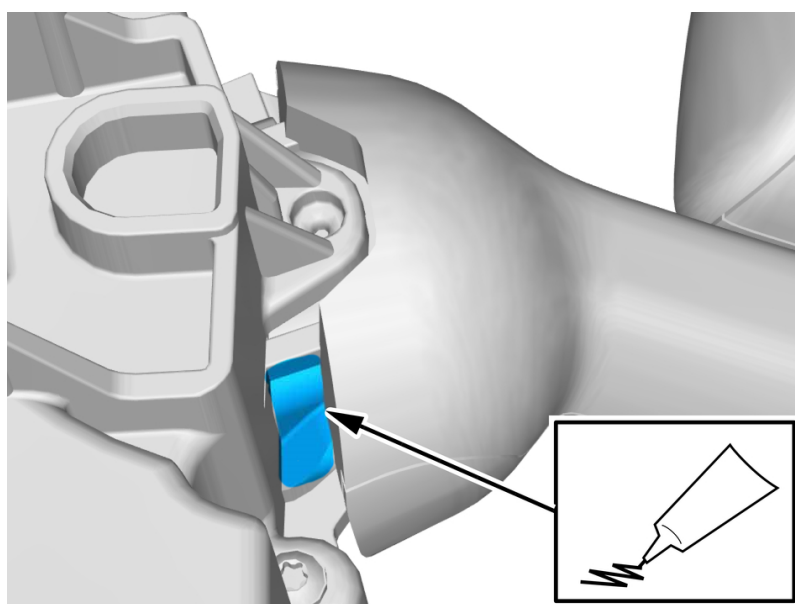

Apply grease on the area indicated.

Use: Silicone grease , 1161687

Installation

To install, reverse the removal procedure.