

Technical Service Bulletin (TSB)
Flash: Integrated Trailer Control Module (ITCM) Update

REFERENCE:	TSB: 08-315-26 GROUP: 08 - Electrical	Date:	August 20, 2026	REVISION:	–
VEHICLES AFFECTED:	2026 (DJ) RAM 2500 Pickup 2026 (D2) RAM 3500 Pickup 2026 (DD) RAM 3500 Cab Chassis 2026 (DP) RAM 4500/5500 Cab Chassis This bulletin applies to vehicles built on or before November 01, 2025 (MDH 1101XX) equipped with Trailer Brake Control (Sales Code XHC).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to North America markets.	
CUSTOMER SYMPTOM:	Customers may experience the following: 'Check Trailer Turn Lamp' message in the Instrument Panel Cluster (IPC) with no trailer connected.				
CAUSE:	ITCM software				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-158, date of issue August 20, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting and possibly reprogramming the ITCM with the latest software.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
18-19-09-96	Module, Integrated Trailer Control (ITCM) - Inspect Software Level (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
18-19-09-97	Module, Integrated Trailer Control (ITCM) - Inspect and Reprogram (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	RF	Required Flash - RSU	
	CC	Customer Concern	

The dealer must choose which failure code to use depending on if this is a Rapid Service Update (RSU) or Technical Service Bulletin.

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RSU.
- The failure code “RF” (Required Flash) can no longer be used on Technical Service Bulletin flashes. The “RF” failure code must be used on an RSU.
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Technical Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	-	-

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles that are on the RSU VIN list.**

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Is the vehicle on the RSU VIN list?
 - YES >>> Proceed to [Step 2](#).
 - NO >>> This bulletin does not apply. Perform further diagnostics.
2. Is the ITCM updated to the latest software level?
 - YES >>> This bulletin is complete. Use Inspect LOP (18-19-09-96) to close this active RSU.
 - NO >>> Proceed to [Step 3](#).
3. Reprogram the ITCM with the latest software. If issues arise when flashing a module using the wiTECH Diagnostic Application, please submit a ticket to the Helpdesk. The helpdesk can be found within the Help menu.
4. Using wiTECH, perform the ITCM "Reset ECU" routine. Navigate to **Guided Diagnostics > Reset ECU**, select **ITCM**, and follow the on-screen instructions to complete the procedure.
5. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.