



C43 SL43 / C63s E Performance with 725.1 and M139 - Harsh 1to2 2to3 3to4, jolting when accelerating from stop

Topic number	LI27.60-P-076554
Version	7
Function group	27.60 - Gearshift, control
Date	8/25/26
Validity	MODEL 206/232 with ENGINE M139 and TRANSMISSION 725.103 or 725.164
Reason for change	Clarified SW releases

Complaint

- Harsh 1-2, 2-3, and/or 3-4 shift
- Jerky shifting
- Jolting when accelerating from stop

Cause

Insufficient software application causing elevated K81/K27/B05 fill time adaptations and elevated torque adaptations for concerning shift.

Note: Shift quality in E Performance models can be affected if the HV Battery state of charge (SOC) reaches 25% or below.

Remedy



Check VGS software level, and follow relevant remedy instructions. (see attachment)

AMG 43 models with VGS software levels up to 22A:

As of 4/18/2025, an aftersales software improvement has been released. This software has been implemented in production as of model year 2024, however this LI should still be followed if the concern is present.

232 - A0009025699

206 - A0009025599

Please ensure your Xentry machine is up to date with the latest Add Ons and continue with the following steps:

Note: ALL steps must be performed to rectify concern



1. Perform software update all control units included in VGS software update.
2. Check transmission oil level and correct, if necessary (transmission oil temperature > 60 °C)
3. Perform Xentry Valve Flushing procedure at least 3x
4. Perform resetting of deceleration values (VGS > Special Procedures > Special procedure > Resetting learned values Deceleration mode)
5. Perform a standstill adaptation, then read out new EEPROM data
6. Perform driving adaptation(s) while adhering to the below parameters for at least 20-30 miles.

Note: There is no menu in Xentry for this procedure. We recommend displaying the torque in the instrument cluster. If all below parameters are met at the time the shift, a driving adaptation will automatically occur.

Harsh 1-2

Perform a driving adaptation of 4-5 (adapts K81 for the 1-2 shift)



Harsh 2-3

Perform a driving adaptation of 6-7 (adapts B05 for the 2-3 shift)

Harsh 3-4

Perform a driving adaptation of 3-4 (adapts K27 directly)

- See attached PDF for min/max torque, and RPM parameters
- Transmission oil temperature > 30°C (>86°F)
- Level track (no incline/decline)
- Slippery drive program
- Display the torque in the instrument cluster
- Constant engine torque
- Do not shift via paddle



AMG 63 models with VGS software levels up to 22A:

No aftersales software resolution is planned. Perform above steps and release the vehicle.

If the vehicle returns and already had ALL steps in this LI performed on a previous visit, or has software level 23A and newer:

Please submit a TIPS case to the Powertrain inbox and ensure the following is included:

- Initial Quick Test w/ Freeze Frame Data
- VGS Control Unit Log
- Initial EEPROM (before any adaptations or Xentry procedures were performed)
- Detailed vehicle history of the complaint

Attachments

File	Description
7251_M139_M177_Adaptation_Conditions_v4.pdf	Driving Adaptation Parameters 725.1 (M139/M177)
VGS Software Level (Initial QT).png	VGS Software Level (Initial Quick Test)

Disclaimer



NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms

Power transmission > Automatic transmission > Function > Poor shift quality
