

Preview Solution CBR-159-8

Mack Trucks Equipped With A Cummins Engine - Engine Preheat Icon Does Not Illuminate In The Instrument Cluster (IC) During Engine Pre-heat (Intake Air Heater) Operation - Vehicles With 2018 Instrument Cluster Update, Model Year 2018 And Newer

Published 10 August 2026

Valid For

Mack Chassis - GR,PI,AN,CHU,CXU,GU,

Model Year - 2018 to current

If the Preheat Icon does not illuminate while Engine Preheat is active as shown below:



A. Update Instrument Cluster Software (SW) to enable the parameter.

1. In Premium Tech Tool (PTT), run Operation [1700-22-03-06 Accessory Kit](#). The operation can be found under the Program tab.
2. When prompted, enter Accessory Kit Number [85153771](#).
3. Press the Program button in the lower right-hand corner of the screen.
4. Allow the programming operation to complete.

B. Set Vehicle (System) Date And Time.

Live UI

1. Run PTT Operation [1700-22-03-02 System Date and Time](#). The operation can be found under the Program tab.
2. More information can be found in CBR Solution **CBR-529**.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article