



# HYUNDAI

## Technical Service Bulletin

GROUP

**CAMPAIGN**

NUMBER

**26-01-040H-1**

DATE

**AUGUST 2026**

MODEL(S)

**TUCSON (NX4A)**

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

This TSB supersedes 26-01-040H to update the description and expand the production range on the applicable vehicles section on page 1, update the parts information table on page 2 and the service procedure on pages 6-13, revise the op codes on page 3, and add the flowchart on page 5.

### ★ IMPORTANT

Dealers must perform this field action on all affected vehicles within 5 / 60,000 New Vehicle Limited Warranty (NVLW) prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair. See Warranty Information section for more details.

Access the "Vehicle Information" screen via WebDCS to verify "Warranty Start Date" and ensure the vehicle is within NVLW, observing mileage prior to any repair work.

**Description:** Certain Tucson (NX4A) vehicles equipped with bulb type "inside rear combination lamp assembly" may have a crack on the left-hand side. This bulletin provides instructions to inspect the "inside rear combination lamp assembly" and replace it if a crack is found, or to install washers to prevent a crack from developing.



### Applicable Vehicles (Certain):

| Model Year | Model         | Production Dates        |
|------------|---------------|-------------------------|
| 2026       | Tucson (NX4A) | 01/06/2026 – 02/26/2026 |

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

**Parts Information:**

| Model         | Part Name                                    | Part Number    | Figure                                                                               | Remarks                                                                                                           |
|---------------|----------------------------------------------|----------------|--------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------|
| Tucson (NX4A) | Lamp Assy –Rear Combination, Ctr             | 92403-CW541QQH |    | Only use if lamp is cracked<br><br>Bulb type only<br><br>QQH replacement part will have washers installed already |
|               | Lamp Assy – Rear Combination, Ctr Repair Kit | WASHERLA24     |    | Only use if lamp is <b>NOT</b> cracked<br><br>Qty: 2 each                                                         |
|               | Fastener-Dr Trim                             | 82315-2P000    |   | Replace if damaged                                                                                                |
|               | Fastener-Dr Trim                             | 82315-33020    |  |                                                                                                                   |
|               | Clip-Back Panel Mldg Mtg                     | 87378-A4000    |  |                                                                                                                   |

**NOTE:** Dealer will be reimbursed via sublet as noted for any clips, regardless of replacement.

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

**Warranty Information:**

| Model         | Op. Code | Operation                                                             | Op. Time | Causal Part | Nature Code | Cause Code |
|---------------|----------|-----------------------------------------------------------------------|----------|-------------|-------------|------------|
| Tucson (NX4A) | 60DA06R1 | Inspection of LH Side of Rear Combination Lamp & Assembly Replacement | 0.4 M/H  | 92403-CW540 | A32         | ZZ1        |
|               | 60DA06R2 | Inspection of LH Side of Rear Combination Lamp & Washer Installation  | 0.4 M/H  |             |             |            |

**NOTE 1:** Submit a campaign claim on the "Claim Entry/Edit/Submit" screen on WebDCS and attach all required Digital Documentation per TSB to the claim.

**NOTE 2:** 5 / 60,000 New Vehicle Limited Warranty (NVLW) applies to the part(s) and repair procedure(s) outlined in this TSB. Prior to beginning any repair work, ensure the part(s) associated with the repair procedure are within NVLW, observing mileage and Warranty Start Date or date of first use. If the subject part(s) are out of warranty coverage, the retailer has the option to submit a Prior Approval (PA) Request for goodwill consideration on a case-by-case basis.

**NOTE 3:** If any part(s) not subject to this TSB are found in need of replacement while performing the repair procedure, and the affected part(s) are still under warranty, the dealer may submit a separate claim using the same repair order. If the part(s) not subject to this TSB are out of warranty coverage, the dealer has the option to submit a PA Request for goodwill consideration on a case-by-case basis.

**NOTE 4:** This TSB includes repair validation photos. Op times include VIN, mileage, and repair validation photo(s) as outlined in the Digital Documentation Policy.

**NOTE 5:** The incident parts are subject to callback through the normal Warranty Technical Center (WTC) parts return process. **Claim is subject to debit if the part is not returned.**

**NOTE 6:** Op codes will reimburse \$4.00 in sublet for any damaged clips during the repair procedure.

Service Procedure:

DIGITAL DOCUMENTATION



This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

NOTICE


Use plastic trim tools throughout the procedure to prevent damage to the vehicle trim and finish.

Table of Contents

- Flowchart.....5
- Inside Rear Combination Lamp Assembly Inspection & Removal .....6
- Inside Rear Combination Lamp Assembly Replacement.....12
- Washer Installation .....13

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)


**Flowchart**

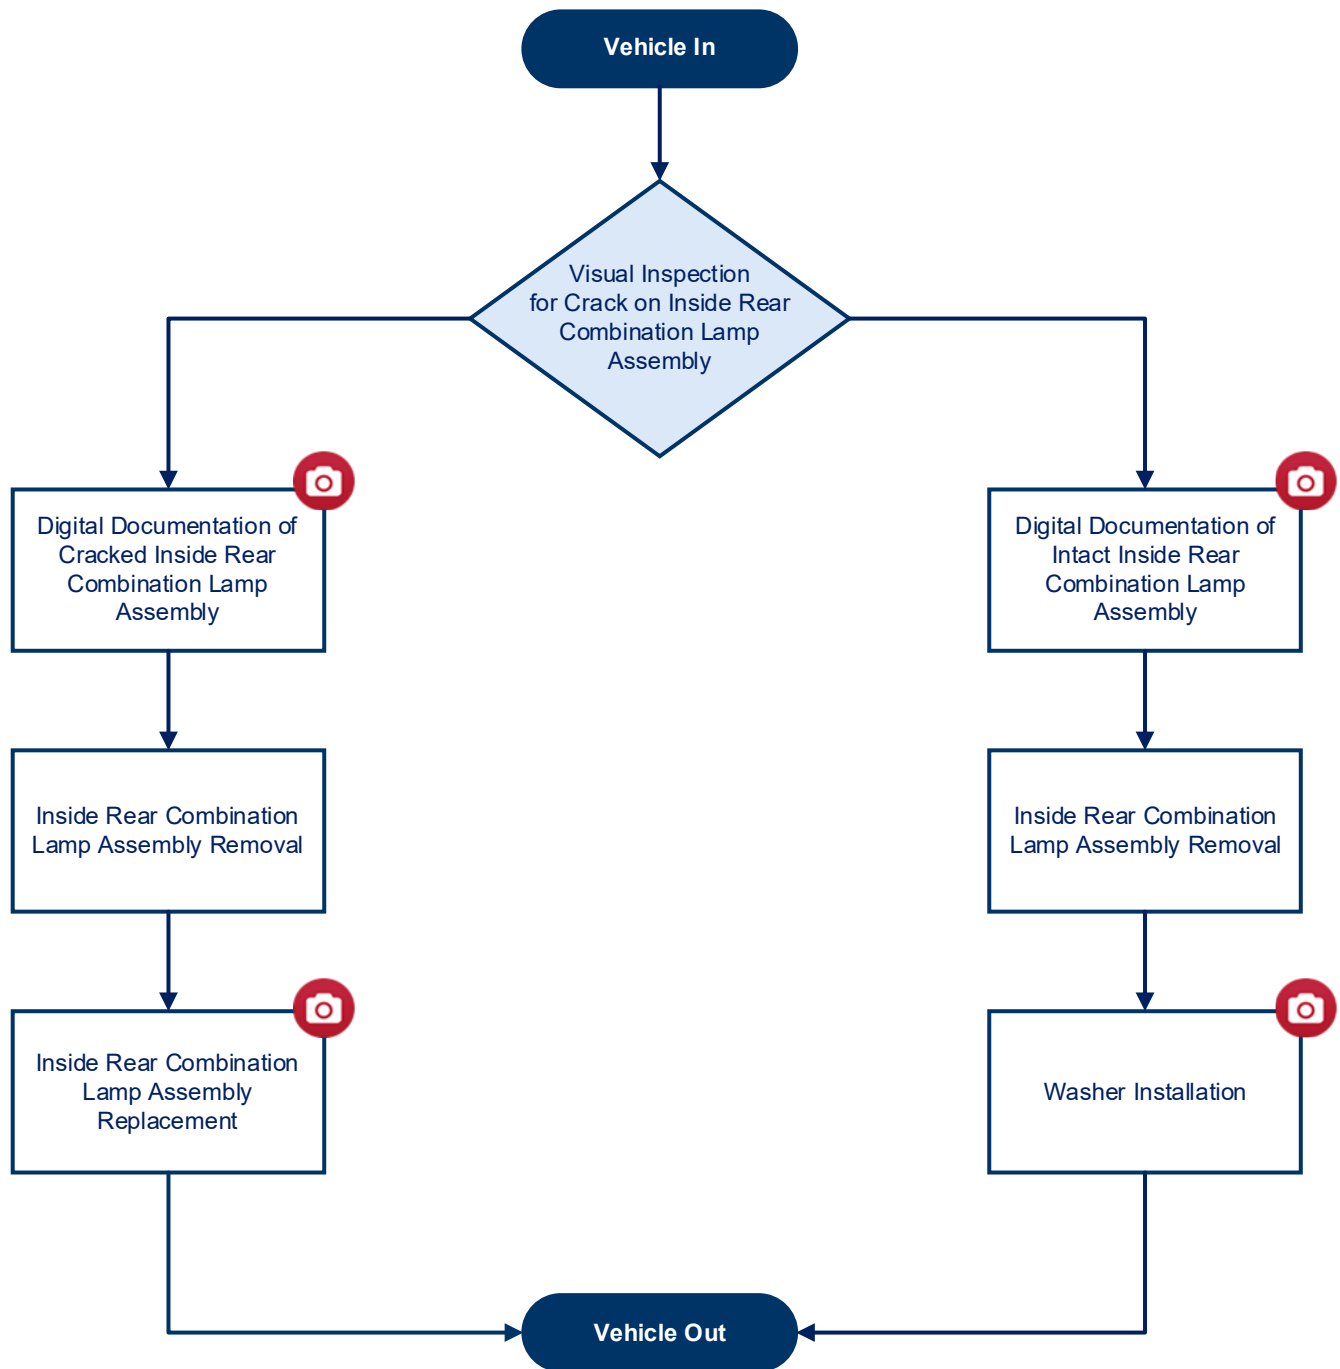

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

**Inside Rear Combination Lamp Assembly Inspection & Removal**

1. Visually inspect the LH side of the removed inside rear combination lamp assembly for a crack (A).

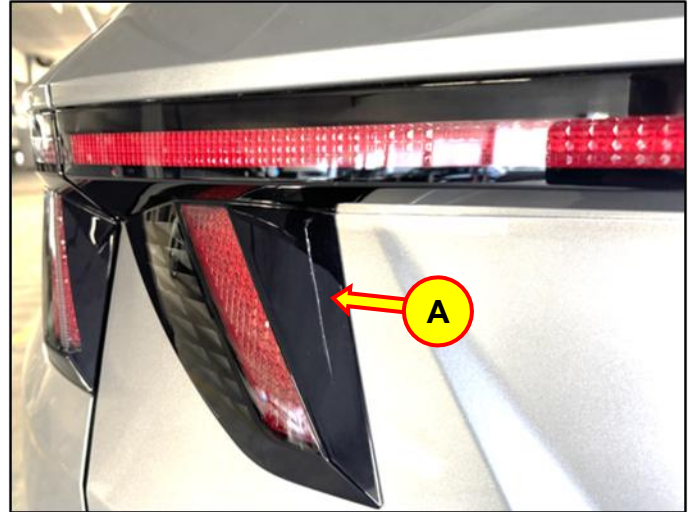

- 2.

**DIGITAL DOCUMENTATION**



Using the STUI camera function, take a photo of the LH side of the existing inside rear combination lamp assembly.

Upload the photo to STUI.

**NOTE:** If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



**Information**


Digital Documentation of the inside rear combination lamp assembly is required whether the assembly displays a crack **OR** is intact.

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

3. Open the tailgate and remove the tailgate upper trim (B).

**i Information**



Replace any damaged or broken clips (P/N: **82315-2P000**).

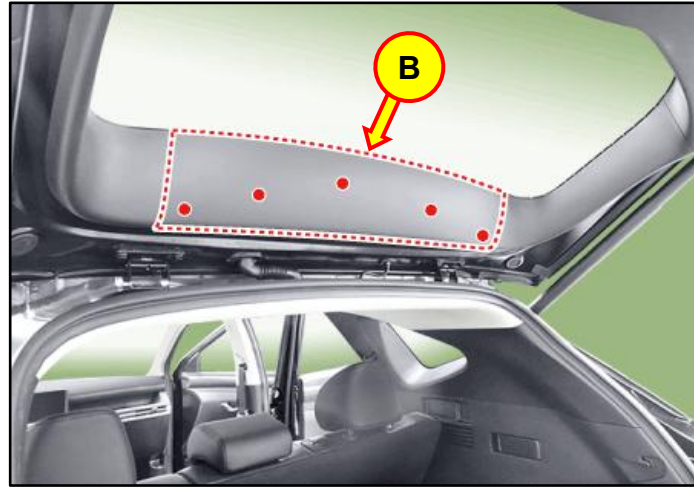

4. Remove the LH and RH tailgate side trim (C).

**i Information**

Replace any damaged or broken clips (P/N: **82315-2P000**).

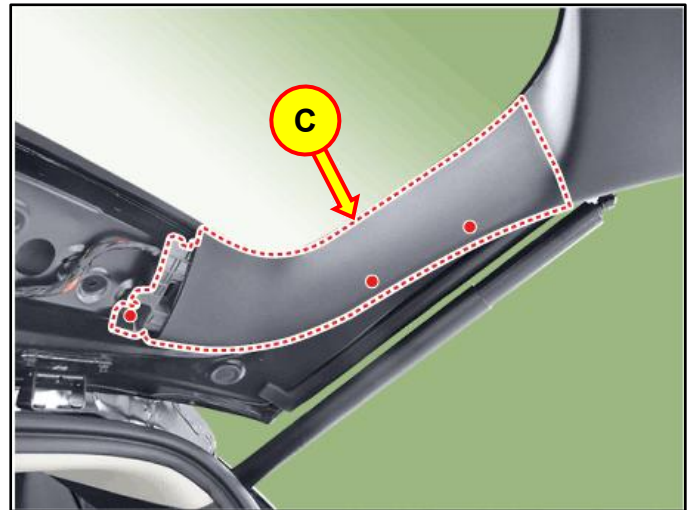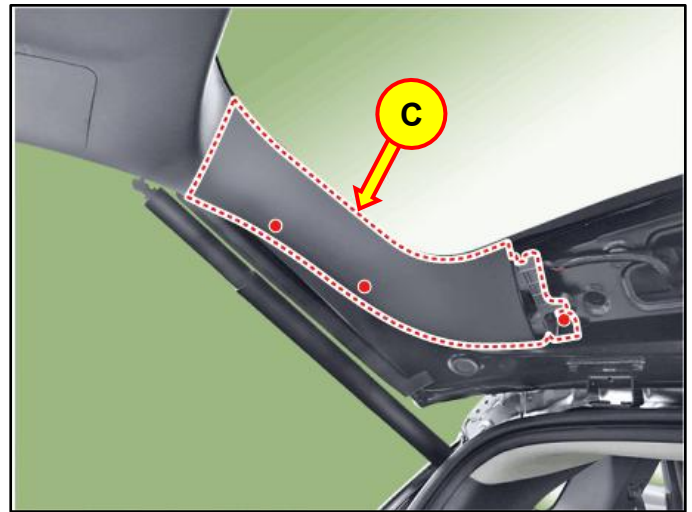


**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)


5. Remove the power tailgate inner switch (D) if equipped.

**i Information**


Skip **steps 5 and 6** if the vehicle is **NOT** equipped with a power tailgate.

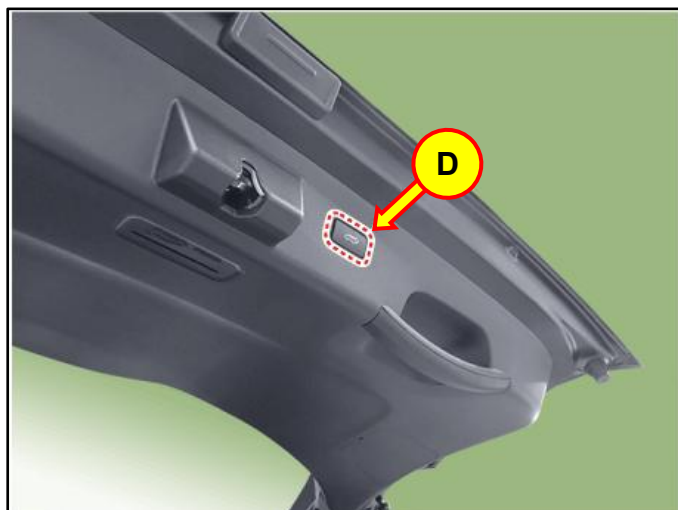

6. Disconnect the power tailgate inner switch connector (E) if equipped.

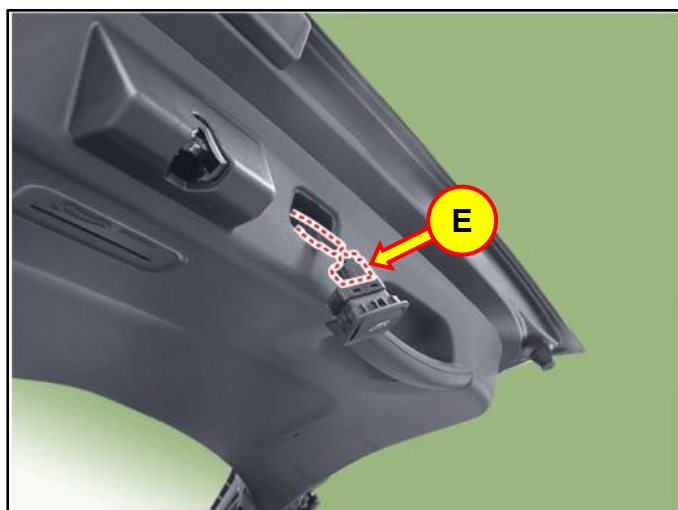

7. Remove the tailgate handle cover (F).

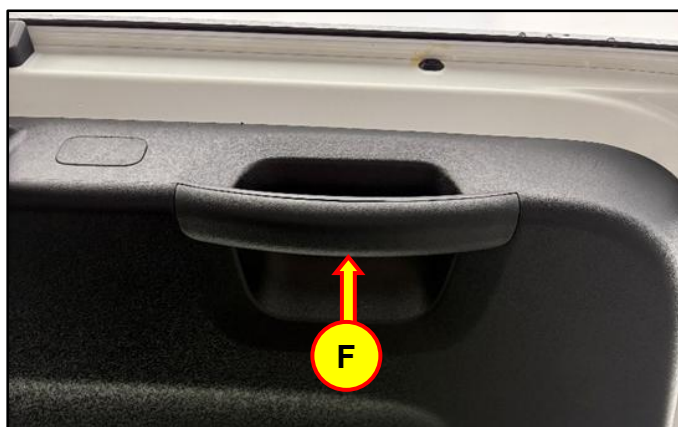


**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)




8. Remove the **4** screws then remove the tailgate lower trim (G).

**i** **Information**

Replace any damaged or broken clips (P/N: **82315-2P000** & **82315-33020**).

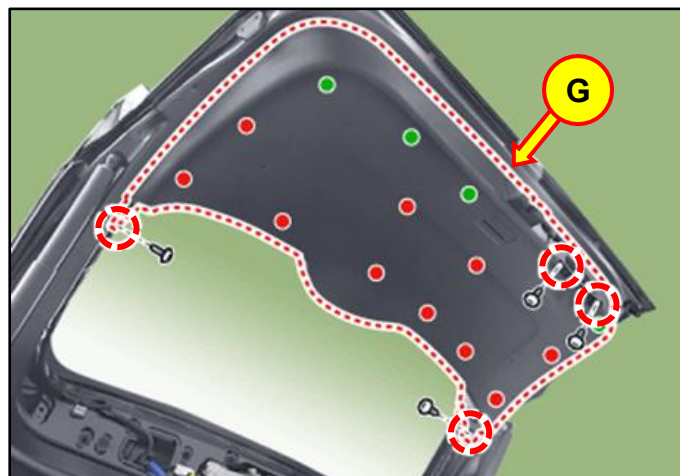

9. Disconnect the **3** inside rear combination lamp connectors (H).

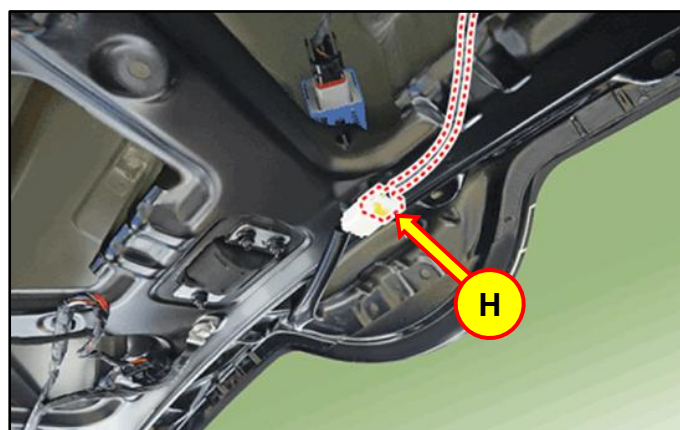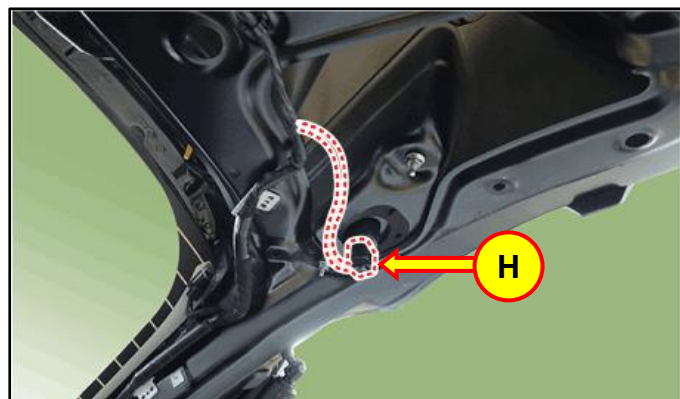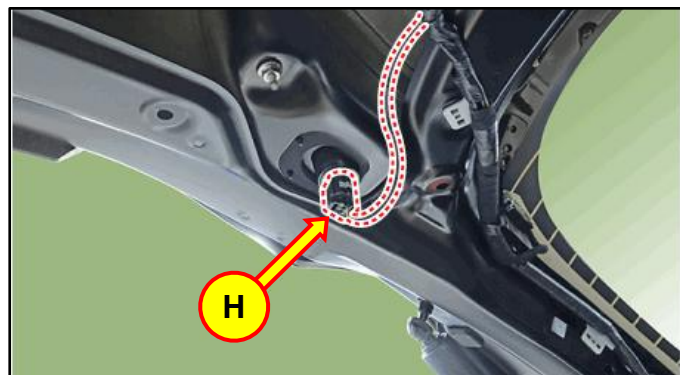

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

10. Disengage the **2** yellow clips from inside the tailgate then remove the tailgate upper garnish (I).

**i** **Information**

Replace any damaged or broken clips (P/N: **87378-A4000**).



**i** **Information**

Replace any damaged or broken clips (P/N: **82315-2P000** & **82315-33020**).





**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

11. Remove the 7 nuts then remove the inside rear combination lamp assembly (J).


**NOTICE**

Use caution when removing the lamp assembly to prevent damage to the lamp and vehicle.

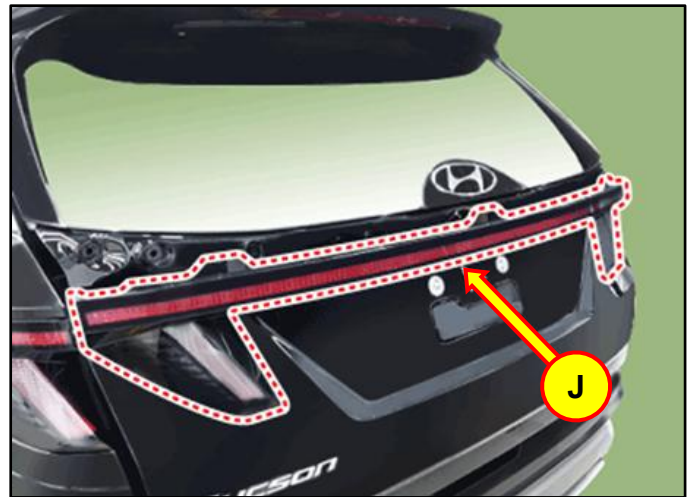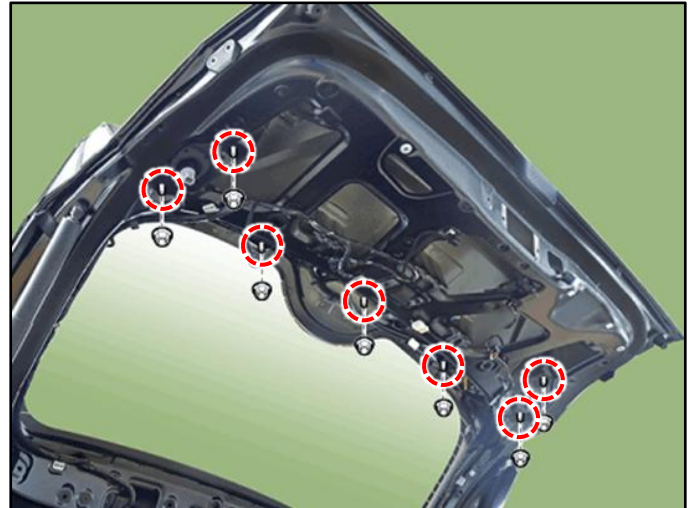

12. If the inside rear combination lamp assembly is cracked (K), then proceed to the [Inside Rear Combination Lamp Assembly Replacement](#) procedure.

If the inside rear combination lamp assembly is intact, then proceed to the [Washer Installation](#) procedure.

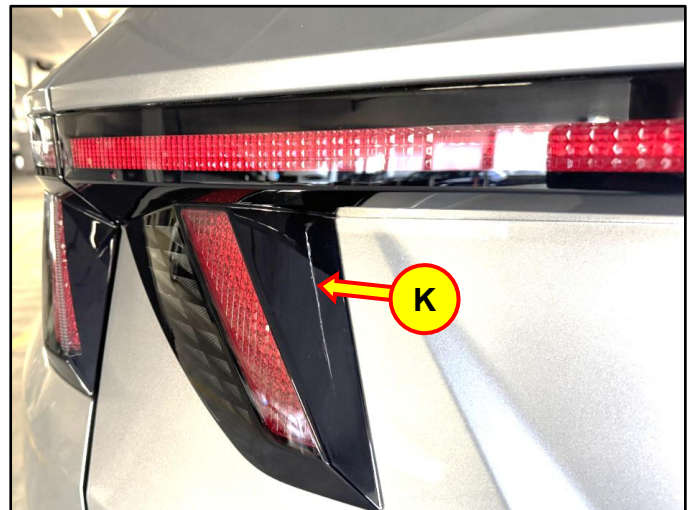

### Inside Rear Combination Lamp Assembly Replacement

1. Install the new inside rear combination lamp assembly by first clipping it into place, then securing the **7** nuts.
2. Reinstall all parts in the reverse order of the removal process.

3.

**DIGITAL  
DOCUMENTATION**



Using the STUI camera function, take a photo of the LH side of the new inside rear combination lamp assembly installed on the vehicle.

Upload the photo to STUI.

**NOTE:** If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.




4. Confirm the proper operation of the inside rear combination lamp assembly and the power tailgate if equipped.
5. The service procedure is now complete.

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

**Washer Installation**


1. Remove the **2** rubber gaskets from the top and bottom studs (A) of the LH side of the inside rear combination lamp assembly.

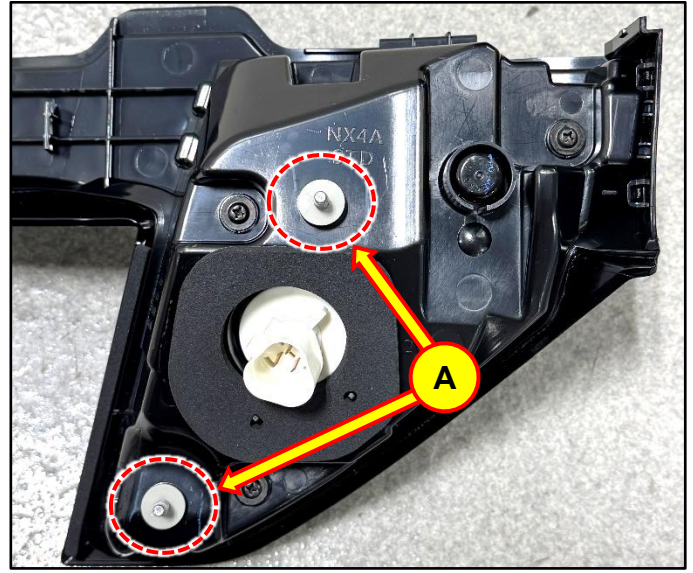

2. On each stud, install the supplied metal washer (B) first, then replace the rubber gasket (C).

**NOTICE**

The metal washers **MUST** be installed before the rubber gaskets. Installing the metal washers after the rubber gaskets may damage the tailgate body and may **NOT** provide an adequate seal, potentially leading to water ingress into the tailgate panel.

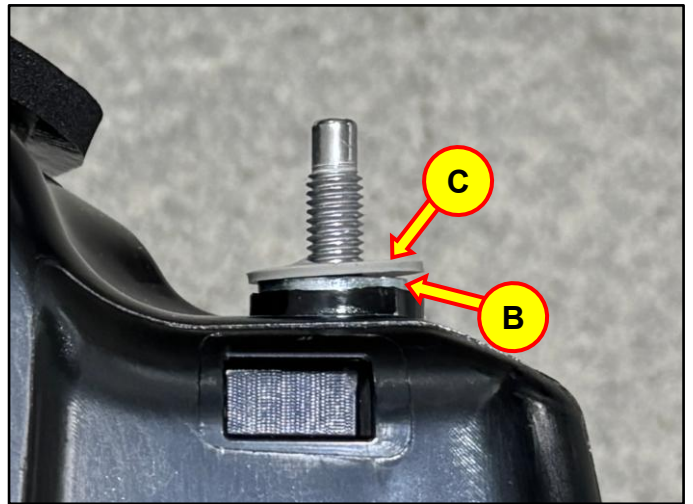

**SUBJECT:** INSIDE REAR COMBINATION LAMP ASSEMBLY INSPECTION – REPLACEMENT OR WASHER INSTALLATION (LIMITED COVERAGE CAMPAIGN LA19)

3.

**DIGITAL  
DOCUMENTATION**



Using the STUI camera function, take a side-profile photo of the LH side inside rear combination lamp assembly with the washers installed, ensuring the image clearly shows the metal washer beneath the rubber gasket on the studs.

Upload the photo to STUI.

**NOTE:** If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



4. Reinstall all parts in the reverse order of the removal process.
5. Confirm the proper operation of the inside rear combination lamp assembly and power tailgate if equipped.
6. The service procedure is now complete.