



GROUP

MODEL

BOD

2022-2024MY
Carnival (KA4)

NUMBER

DATE

358


August 2026

TECHNICAL SERVICE BULLETIN

SUBJECT:

HORN ASSEMBLY INSPECTION/REPLACEMENT (WTY048)

This bulletin provides information associated with the Warranty Extension Program (WTY048) to inspect and, if necessary, replace both the high-pitch and low-pitch horn assemblies on certain 2022-2024MY Carnival (KA4) vehicles produced from January 4, 2021 through July 4, 2024. The affected vehicles may experience a distorted or inoperative horn sound caused by excessive moisture and dust exposure over time. The warranty coverage for repairs related to the horn assembly has been extended from 5 years / 60,000 miles to 10 years / 120,000 miles, whichever comes first, starting from the date the vehicle was first put into service. Follow the procedure outlined in this publication to inspect and, if necessary, replace both the high-pitch and low-pitch horn assemblies with new ones on the applicable vehicle.

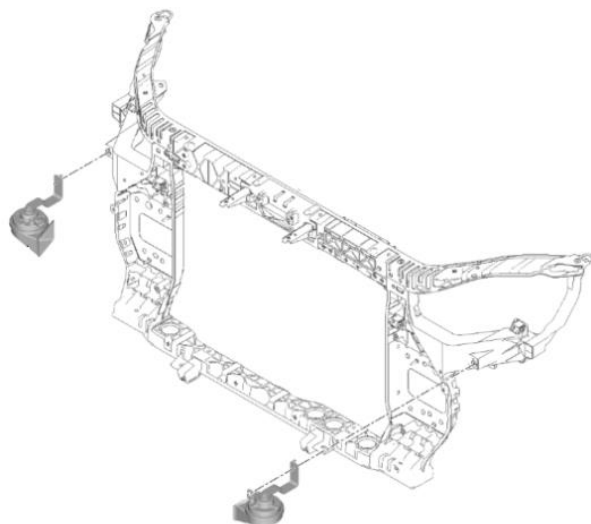 NOTICE

A Warranty Extension Campaign is a repair program with customer notification based on a valid customer complaint during the extended warranty period. There is no charge to the vehicle owner for this repair.

Repair status for a VIN is provided on KDealer+ (Service → Warranty → Warranty Coverage Inquiry). Not completed Campaign reports are available on KDealer+ (Service → Campaigns → Open Campaign Report), which includes a list of affected vehicles.

This issue number is WTY048.

A printed copy is for reference only; publication information can be updated at any time.
Always refer to KGIS for the latest information. After logging in kdealer.com, the newest technical publications are listed in 'Service Releases' and has the latest service information that has been released.

Inspection Procedure:


1. Press the Horn Pad (A) to confirm normal operation:
 - If the horn operates **normally**, this TSB does not apply. **Claim inspection only labor op 262068R0.**
 - If the horn is **inoperative** or the **tone is distorted**, proceed to the 'Replacement Procedure' below.

**Repair Procedure:**


1. **Replace** the High Pitch (A) **and** Low Pitch (B) Horn Assemblies by referring to "Body Electrical System → Horn → Removal and Installation" in the applicable Shop Manual on KGIS.



Tightening torque for bolt:
8.0 - 8.7 lb.ft (10.8 - 11.8 N.m)

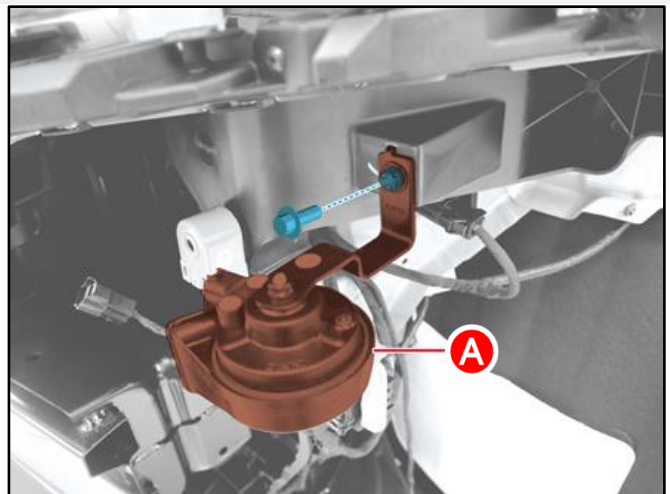

2. Install all removed parts in reverse order of removal.
3. Confirm normal operation.

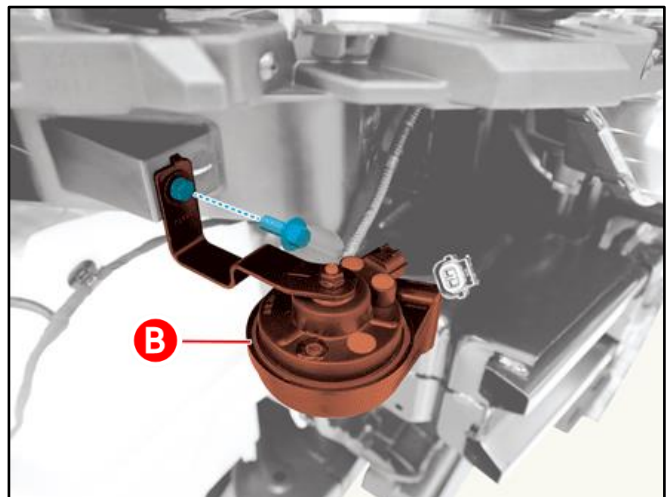

SUBJECT:

HORN ASSEMBLY INSPECTION/REPLACEMENT (WTY048)**AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Carnival (KA4)	January 4, 2021 to July 4, 2024

REQUIRED PART:

Part Name	Part Number	Figure	Qty.	Comments
Horn Assembly	96611 R0000QQK		1	LOW Pitch
	96621 R0000QQK		1	HIGH Pitch

Note: The replacement part numbers will require a VIN entry for parts ordering. **DO NOT** order these parts for stocking purposes, related to this field fix. Supply is very limited. Until supply stabilizes, please confirm part availability before scheduling customers. Please be sure to expedite warranty claim filing.

WARRANTY INFORMATION:

N Code: I11 C Code: ZZ3

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	96621 R0000	0	(WTY048) Inspection Only	262068R0	0.1 M/H	N/A	0
			(WTY048) Inspection + Horn Assembly Replacement	262068R1	0.7 M/H	96611 R0000QQK <u>and</u> 96621 R0000QQK	1 1

Note: Refer to [Warranty Extension Bulletin 2605](#) for claim submission procedures. For Substitute Transportation policy, please refer to [Service Policy and Procedures Manual \(SPPM\) 6.11 "Kia Substitute Transportation"](#).

