

REFERENCE:	TSB: 08-323-26 GROUP: 08 - Electrical	Date:	August 25, 2026	REVISION:	—
VEHICLES AFFECTED:	2018 - 2026 (MP) Jeep Compass			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☒ EE☐ CH NOTE: This bulletin applies to North America and Enlarged Europe markets.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set the following Diagnostic Trouble Code (DTC): - C2260-63 - ECU Internal Performance - Circuit Component Protection Time-Out Customers may also comment on the following: - Service 4WD indicator is illuminated.				
CAUSE:	DTCM software				

DISCUSSION:

This Information Only bulletin provides guidance for a customer-reported condition in which the **Service 4WD** indicator may illuminate. Investigation has determined that this condition is related to software. If this DTC is present, **do not replace the Drivetrain Control Module (DTCM)**. Instead, clear the DTC and cycle the ignition. Engineering is currently developing a software update to address this condition, with release planned for **Q4 2026**.

POLICY:

Information Only.