



**IMPORTANT SERVICE
INFORMATION FOR:**

- ✓ SERVICE MANAGER
- ✓ SERVICE ADVISOR
- ✓ TECHNICIAN
- ✓ PARTS DEPARTMENT
- ✓ WARRANTY PERSONNEL

BULLETIN NUMBER:
IB26-J-003

ISSUE DATE:
AUGUST 2026

GROUP:
ENGINE

DTC U0101 (00) CAUSED BY IDLE SHUTDOWN

AFFECTED VEHICLES

- 2022i-Current Isuzu N-Series Vehicles equipped with 5.2L (4HK1) Diesel Engines

INFORMATION

Technicians may encounter DTC U0101 (00) Lost Communication with Transmission Control Module (TCM) stored in the Electronic Hydraulic Control Unit (EHCU) as a history code.

IMPORTANT: DTC U0101 (00) will set during idle shutdown events. This is a normal condition.

When an idle shutdown event occurs, communication between the TCM and the EHCU is temporarily suspended. This can cause DTC U0101 (00) to set in the EHCU although there is no fault in the system.

If DTC U0101 (00) is stored in the DTC history (past), use IDSS to determine if the idle shutdown feature is enabled. This feature can be found in the Vehicle Option Programming section.

If it is determined that the DTC U0101 (00) was set as a result of idle shutdown being engaged, the DTC may be cleared without any further diagnosis.