



Connection offline

Technical Service Bulletin

Transaction No.: **2074475/5**

47 Service Info : DTC U010100 Lost Communication with TCM in diagnostic address 23

Release date: Aug 21, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A3, S3, and RS 3	2022 - 2027	All	Not applicable
Q3	2020 – 2025		

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised header (Add Model Year)
4	06/27/2026	Revised header (Add Model Year) Revised <i>Service</i> (Updated information)
3	02/24/2025	Revised <i>Condition</i> (Updated information)

Customer states:

- A warning/indicator lamp is lit up in the instrument cluster.

or

- The DTC **U010100** with the symptom 107008 and/or 108560 and/or 108624 (software version 553) is identified during maintenance work / inspection and there is no customer complaint.

Workshop findings:

- The DTC **U010100** “Lost Communication with TCM” with the symptom 107008 and/or 108560 and/or 108624 is identified in the electromechanical brake servo (diagnostic address 23).

Technical Background

Software issue in electromechanical brake servo control unit.

Production Solution

Not applicable.

Service

The DTC **U010100** in the A3 8Y with software version 0372 or 0272 or 0307 or 0309 or 0553 or 562 or 563 and in the Q3 F3 with software version 0372 or 0272 or 0207 or 0209 in the electromechanical brake servo does not lead

to a customer complaint and can be ignored. Permission to ignore this DTC must be stored in ODIS, please also always observe this.

There must be a different cause for the warning/indicator lamp.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2074475**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.