



Connection offline

Technical Service Bulletin

Transaction No.: **2082977/1**

69 Airbag warning lamp active, event memory entry "B200000 - Faulty control module, symptom 305"

Release date: Aug 7, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A4, and A4 allroad	2017 – 2023	All	Not applicable
S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, and Q7	2018 – 2023		
RS 5	2018 – 2019 2021 – 2023		
RS 5 Sportback	2019 2021 – 2023		
SQ7	2020 – 2023		
Q8, SQ8, and RS Q8	2023		

Customer states:

The airbag warning lamp in the instrument cluster is active.

Workshop findings:

The customer statement can be reproduced.

In addition to this, the event memory entry "**B200000 – Faulty control module, symptom 305**" is logged in the airbag control unit (diagnostic address 0015).



NOTICE

Important: If a different event memory entry and/or a symptom code other than "symptom 305" is found in the airbag control unit, this TSB will not resolve the issue and cannot be processed.

Technical Background

Highly sporadic incorrect diagnosis in airbag control unit.

Production Solution

Not applicable.

Service



NOTICE

Important: This measure must only be performed once. If the issue occurs again, the airbag control unit must be replaced.

Please first perform Guided Fault Finding for this event memory entry.

Then run **SVM code 15A010**.

After running the SVM code, please check whether the event memory entry has now disappeared from the airbag control unit. If this is not the case, please work through the relevant test plan using Guided Fault Finding.

Warranty

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6953		
Damage Code:	0040		
Labor Operations:	Software update	0151 0000	Labor according to the diagnostic log
	Charge battery	2706 8950	See SRT with associated operations
Claim Comment:	As per TSB 2082977/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2082977**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.