

REFERENCE:	TSB: 08-339-26 GROUP: 08 - Electrical	Date:	September 24, 2026	REVISION:	08-374-25
VEHICLES AFFECTED:	2024 - 2026 (D2) RAM 3500 Pickup This bulletin applies to vehicles built on or after **October 01, 2024 (MDH 1001XX) and on before April 01, 2026 (MDH 0401XX)** and equipped with 12.0" Dual Wheel Rear Axle (Sales Code DRC).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to the North America markets.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set one or more of the following Diagnostic Trouble Codes (DTCs): - C003A-62 - Right Rear Wheel Speed Sensor - Signal Compare Failure. - C0037-62 - Left Rear Wheel Speed Sensor - Signal Compare Failure. - C003A-2F - Right Rear Wheel Speed Sensor - Signal Erratic. - C0037-2F - Left Rear Wheel Speed Sensor - Signal Erratic. Customers may comment on one or more of the following: - The check engine light is illuminated. - The Anti-Lock Brake System (ABS) light is illuminated. - The Traction Control System (TCS) light is illuminated. - The Forward Collision Warning (FCW) light is illuminated. - The "4WD Unavailable" message is displayed in the Instrument Panel Cluster (IPC). - Vehicle might not shift from Drive to Park or vice versa. NOTE: The vehicle safe hold systems are in place if the vehicle does not shift to Park. - Vehicle will not shut off.				
CAUSE:	Manufacturing issue				

This bulletin supersedes Technical Service Bulletin (TSB) 08-374-25, date of issue November 15, 2026, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include updated build dates, Parts Table, Failure Code, new RSU number and Repair Procedure step. Changes not highlighted with asterisks include removal of a sales code.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) ****26-174, date of issue September 24, 2026****. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves replacing both rear wheel speed sensors.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-14-18-9L	Wheel Speed Sensor, Rear - Replace Both Sides (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.4 Hrs.
Failure Code	**ZY**	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1	**68360876AD	Sensor, Wheel Speed	Right
1	68360877AD	Sensor, Wheel Speed	Left**

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customers VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	—	—

REPAIR PROCEDURE:

1. Replace both rear wheel speed sensors. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 05 - Brakes / Sensors / Removal and Installation.
2. **Clear DTCs.**

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.