

Technical Service Bulletin (TSB)

Heads Up Display (HUD) Dimming Too Low

REFERENCE:	TSB: 08-341-26 GROUP: 08 - Electrical	Date:	September 24, 2026	REVISION:	
VEHICLES AFFECTED:	2026 (WS) Jeep Wagoneer / Grand Wagoneer This bulletin applies to vehicles built on or after November 18, 2025 (MDH 1118XX) and on or before March 18, 2026 (MDH 0318XX) equipped with Augmented HUD (Sales Code LBK).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to North America markets.	
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: • HUD is very dark and hardly viewable. • HUD cannot be seen in daytime and very dim at night.				
CAUSE:	The setting for over brightness was incorrectly set to 0 at supplier factory.				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-175, date of issue September 24, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting and possibly replacing the HUD module.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-19-1Q-90	Module, Heads Up Display - Inspection (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
08-19-1Q-91	Module, Heads Up Display - Inspect and Replace (0 - Introduction)	6 - Electrical and Body Systems	3.7 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68613172AG	Module, Heads Up Display	

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles on the RSU VIN list.**

REPAIR PROCEDURE:

1. Is the vehicle on the RSU VIN list?
 - YES >>> Proceed to [Step 2](#).
 - NO >>> This bulletin does not apply.
2. Verify that the HUD is turned on and brightness is set to max.
3. Is the HUD legible and easily visible to the driver? Refer to [Fig.1](#).



Fig. 1
HUD

- YES>>> Use Inspection LOP (08-19-1Q-90) to close the active RSU.
 - NO>>> Proceed to [Step 4](#).
4. Replace the HUD module. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 08 - Electrical / 8J - Instrument Cluster / Display, Heads Up / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.