

September 25, 2026

Version 1

Warranty Extension: 2015-17 TLX Fuel Smell from Fuel Fill Pipe (6 Months) - Expires May 31, 2027

APPLIES TO

Year	Model	Trim Level	VIN Range
2015–17	TLX	ALL	Check iN VIN status for eligibility.

BACKGROUND

The factory fuel fill pipe assembly may not have been manufactured to specification. As a result, small contamination particles inside the fuel fill neck may prevent the primary shut-off valve flap seal from sealing properly. This may result in a fuel smell from the fuel fill neck area and may cause DTC P0455 or P0456 (EVAP system leak detected) to be set.

To ensure client satisfaction and confidence, Acura is extending the warranty coverage on the fuel fill pipe assembly related to this condition to **May 31, 2027**, regardless of time in service or mileage. Any repair orders issued after that date will not qualify for warranty coverage. This warranty extension only covers vehicles that have an original defective fuel fill pipe assembly from the factory.

This warranty extension applies to any vehicle, regardless of whether it has ever been declared a total loss or sold for salvage by a financial institution or insurer, or has a branded or similar title under any state's law.

OWNER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

CORRECTIVE ACTION

Replace the fuel fill pipe assembly and retainer.

WARRANTY CLAIM INFORMATION

The warranty coverage under this extension expires on **May 31, 2027**. Repair orders dated on or prior to **May 31, 2027** remain eligible and should reference the warranty claim information below.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
3101JW	Replace fuel fill pipe, (includes DTC clear)	0.5hr	6Z900	DPS00	B26025A	17650-TZ3-A02

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

PARTS INFORMATION

NOTE: The fuel fill pipe is available through normal ordering in **WARP**. For program details, refer to the Parts Information Bulletin 26-0003.

Part Name	Part Number	Quantity
Pipe Assy, Fuel Fill	17650-TZ3-A03	1
Retainer (Natural)	17711-SDC-L01	1

REPAIR PROCEDURE

WARNING

Leaking fuel can ignite, causing a fire or an explosion. This can cause serious injury or death. Always work in a well-ventilated area and keep sparks or open flames away.

NOTE:

- Safety glasses and protective gloves are recommended.
- Fuel may spill out during the repair process. Use towels to absorb any spilled fuel, and place the towels in an approved container.
- Fuel tank draining is **not** required.


1. Replace the fuel fill pipe assembly and retainer. [Fuel Fill Pipe Removal and Installation](#)

NOTE: **Step 2** (Fuel Tank - Drain) of the service manual procedure is **not** required.

Before disconnecting the fuel fill pipe assembly, use compressed air and a clean shop towel to remove dirt and debris from the area around the fuel fill pipe connectors.

NOTICE

Do not allow debris to enter the fuel tank from the fuel fill pipe assembly. Debris may damage the fuel system.

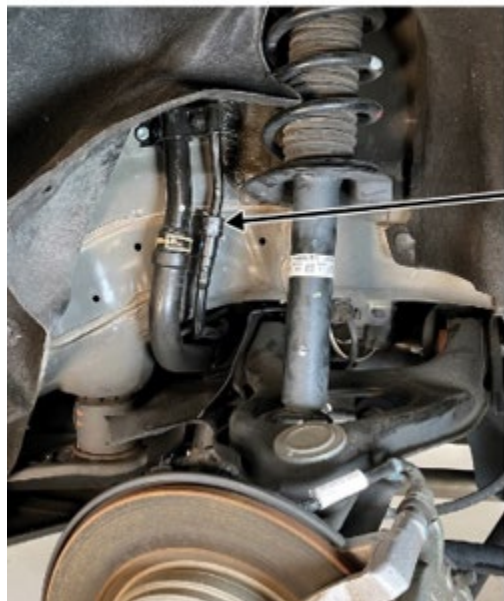

AIR NOZZLE
Do not allow debris to
enter the fuel tank from
the fuel fill pipes.

FUEL FILL
PIPE ASSEMBLY
CONNECTORS

2. Reinstall all removed parts in the reverse order of removal.
3. Connect i-HDS, check for stored DTCs P0455 and P0456, and clear all stored DTCs, including any codes set during the repair procedure.