

SERVICE BULLETIN

Reference number:	SB-01-1168	Issued: 11 December, 2018
Subject:	Boot-Lid Trim Clips	
Model(s):	Vanquish Zagato Volante and Vanquish Zagato Speedster	
VIN Range:	All Vanquish Zagato Volante vehicles to chassis no. K34421 All Vanquish Zagato Speedster vehicles to chassis no. K54470	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason for this Service Bulletin

There is a problem with the clips for the boot lid trim on Vanquish Zagato Volante and Vanquish Zagato Speedster vehicles. In some conditions the clips are not sufficiently strong to hold the boot lid trim in the boot lid. New boot-lid trim clips are available to replace the clips initially installed in the vehicles.

Do the workshop procedure that follows if a customer vehicle has this problem.

Workshop Procedure

1. Open the boot lid.
2. Remove the emergency release handle for the boot lid (refer to Figure 1).

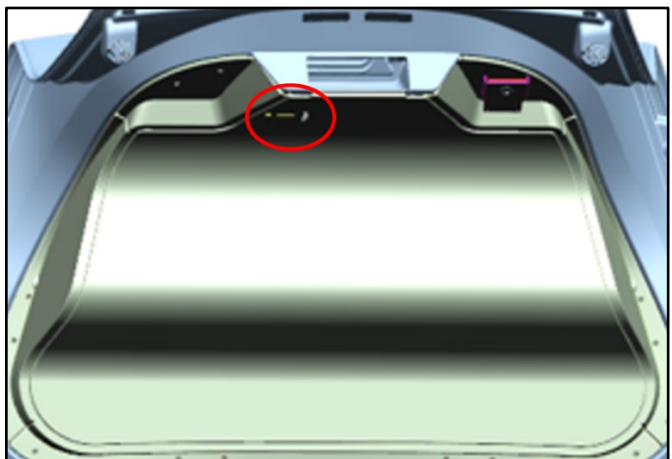


Figure 1

3. Remove the screw that attaches the boot lid trim and pull-down-strap to the boot lid (refer to Figure 2 and Figure 3).



Figure 2

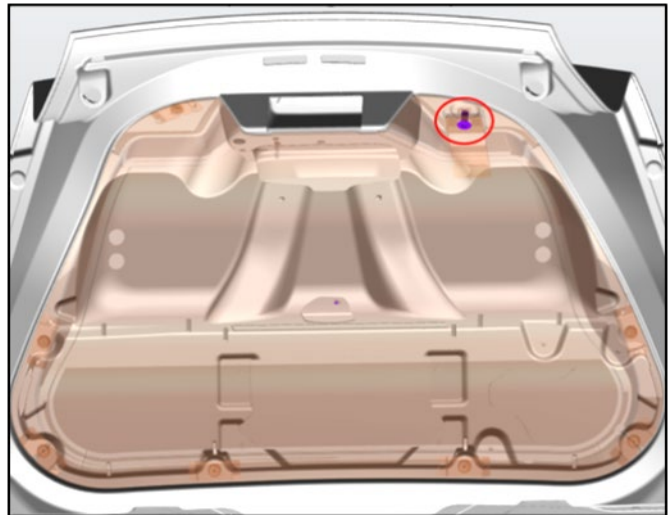


Figure 3

CAUTION: BE CAREFUL NOT TO CAUSE ANY DAMAGE TO THE VEHICLE IN THE STEP THAT FOLLOWS. DO NOT USE A METAL TOOL THAT COULD SCRATCH THE PAINTWORK.

4. Use a trim removal tool to release the boot lid trim from the boot lid (refer to Figure 4).

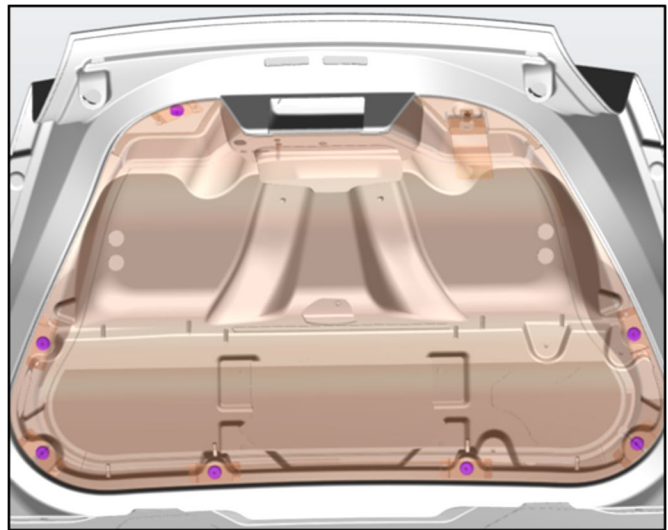


Figure 4

5. Remove the boot lid trim from the boot lid.
6. Replace the seven boot-lid trim clips with seven fir tree clips.
7. Move the boot lid trim into position in the boot lid.
8. Install the boot lid trim in the boot lid. Make sure the clips go in the center of the holes. Replace the clips if they become damaged.
9. Install the screw that attaches the boot lid trim and the pull-down-strap to the boot lid (refer to Figure 2 and Figure 3).
10. Tighten the screw to 8Nm.
11. Install the emergency release handle for the boot lid (refer to Figure 1).
12. Close the boot.

Part Data

Description	Part Number	Quantity
FIR TREE CLIP	JD3Y-MWC1474-AA	7

Warranty Data

Procedure and Labour Time

Description	Labour Time	ROT Code
Trim Panel for the Boot Lid.	0.5 hours	01.05.FJ

Failure Mode Description

Select the failure modes that follow when you make a claim through the Warranty system:

Subsystem	Location	Component	Mode of Failure
INTERIOR TRIM	BODY - BOOT / TRUNK	BOOT / TRUNK - TRIM	POOR FIT - WRINKLED / LOOSE

If you have any questions related to this Service Bulletin, please contact: Aston Martin Technical Services on: +44 (0) 1926 644720, email: askamtech@astonmartin.com,
Or contact your After Sales Manager.

The English version of this Service Bulletin is written in Simplified Technical English to ASD-STE100™.