

We have attached a copy of a receipt for the recall work we had done back in 2010. Some of it has faded but we had problems with the ignition back then. We now expect to receive a refund of the charges since it was not recalled until now.

OCT -1 2014

Thank you

[REDACTED]
Germantown, WI [REDACTED]

NAM
10/29/14
SHB



IMPORTANT SAFETY RECALL

September 2014

[REDACTED]
Germantown, WI [REDACTED]

Dear [REDACTED]

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

General Motors has decided that a defect which relates to motor vehicle safety exists in your 2002 model year Oldsmobile Alero. As a result, GM is conducting a safety recall. We apologize for this inconvenience. However, we are concerned about your safety and continue to strive for your satisfaction with our products.

IMPORTANT

- This notice applies to your 2002 model year Oldsmobile Alero, VIN 1G3NL52E72C [REDACTED]
- Your vehicle is involved in GM recall 14350.
- **Until the recall has been performed, it is very important that you remove all items from your key ring, leaving only the vehicle key. The key fob (if applicable), should also be removed from the key ring.**
- Schedule an appointment with your GM dealer on or after October 1, 2014.
- The recall repairs will be performed for you at **no charge**.

Why is your vehicle being recalled?

If the key ring is carrying added weight and the vehicle goes off road or experiences some other jarring event, it may unintentionally move the key away from the "run" position. If this occurs, engine power, power steering and power braking may be affected, increasing the risk of a crash. If the ignition switch is not in the run position, the air bags may not deploy if the vehicle is involved in a crash, increasing the risk of injury or fatality.

GM

What will we do?

PARTS WILL SOON BE AVAILABLE. We are working as quickly as possible to correct this condition and expect to have sufficient parts to begin repairs by October 1, 2014. When parts are available, your GM dealer will install two key rings and an insert in the key slot or a cover over the key head on all ignition keys. This service will be performed for you at **no charge**. Because of scheduling requirements, it is likely that your dealer will need your vehicle longer than the actual service correction time of approximately 15 minutes.

Also included with this letter is an owner manual supplement. Please review this document and retain it with your vehicle's owner manual.

What should you do?


You should contact your GM dealer to arrange a service appointment on or after October 1, 2014. When you arrive for your appointment, please bring both sets of keys. **In the meantime, it is very important that until the recall has been performed, you remove all items from your key ring, leaving only the vehicle key. The key fob (if applicable), should also be removed from the key ring.**

Do you have questions?

If you have questions or concerns that your dealer is unable to resolve, please contact the Oldsmobile Customer Assistance Center at 1.800.442.6537 (TTY 1.800.833.6537).

If after contacting your dealer and the Customer Assistance Center, you are still not satisfied we have done our best to remedy this condition without charge and within a reasonable time you may wish to write the Administrator, National Highway Traffic Safety Administration, 120 New Jersey Avenue, SE., Washington, DC 20590, or call the toll-free Vehicle Safety Hotline 1.888.327.4236 (TTY 1.800.424.9153), or go to <http://www.safercar.gov>. The National Highway Traffic Safety Administration Campaign ID Number for this recall is 14V400.

Federal regulation requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

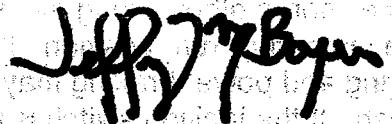

Jeff Boyer
Vice President – Global Vehicle Safety

GM Recall Number: 14350

Supplement to the Owner Manual

This information is in addition to and/or replaces information located under "Keys" found in Section 2 of your owner manual.

WARNING

If the key is unintentionally rotated while the vehicle is running, the ignition could be moved out of the RUN position. This could be caused by heavy items hanging from the key ring, or by large or long items attached to the key ring that could be contacted by the driver or steering wheel. If the ignition moves out of the RUN position,

(Continued)



Litho in U.S.A.
Part No. 23259399

WARNING (Continued)

the engine will shut off, braking and steering power assist may be impacted, and airbags may not deploy. To reduce the risk of unintentional rotation of the ignition key, do not change the way the ignition key and Remote Keyless Entry (RKE) transmitter, if equipped, are connected to the provided key rings.

The ignition key and key rings, and RKE transmitter, if equipped, are designed to work together as a system to reduce the risk of unintentionally moving the key out of the RUN position. The ignition key has a small hole to allow attachment of the provided key ring. It is important that any replacement ignition keys have a small hole. See your dealer if a replacement key is required.

The combination and size of the rings that came with your keys were specifically selected for your vehicle. The rings are connected to the key like two links of a chain to reduce the risk of unintentionally moving the key out of the RUN position. Do not add any additional items to the ring attached to the ignition key. Attach additional items only to the second ring, and limit added items to a few essential keys or small, light items no larger than an RKE transmitter.



©2014 General Motors LLC. All Rights Reserved.

AUTO SELECT of STEVENS POINT

3145 CHURCH ST

STEVENS POINT, WI. 54481

Phone - 715-341-1576 Fax - 715-344-2880

You're Good to Go! Visit us @ www.autoselectonline.com

INVOICE

Org. Est. # [REDACTED]

INVOICE

Print Date : 04/03/2010

Hudson, WI

Home [REDACTED]

Cust ID : [REDACTED]

Ref # :

2002 Oldsmobile Alero GL

3.4L, V6, VIN (E)

Lic # : [REDACTED]

Unit # : RED

Vin # : 1G3NL52E72C [REDACTED]

Hat # :

Odometer In : 120894

Odometer Out : 120894

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
Ignition Starter Switch KS6206	1.00	189.99	189.99	CLIENT REQUESTS	N/C
Ignition Lock Cylinder KS6747L	1.00	269.99	269.99	1. Security lamp goes on and will not start car, replace ignition switch per customer request.	
				IGNITION SWITCH AND LOCK CYLINDER - Remove & Replace	127.40

[Technicians : Maluka, Jeff]

Org. Estimate \$0.00 Revisions \$142.47 Current Estimate \$ 142.47 Additional Cost Revised Estimate

04/03/2010 - 6:51 <none>

Parts: \$0.00 Labor: \$127.40 Sublet: \$0.00 Taxes & Fees: \$15.07

\$142.47

\$142.47

Labor:	127.40
Parts:	459.98
Sublet:	0.00

Sub:	587.38
Tax:	32.31
Total:	619.69
Bal Due:	\$619.69

[Payments -]

Warranty - 12 Months/12,000 Miles (Most Services & Repairs)

SIGNATURE.....

Date..... Time.....

Written By: Salchert, Matt

Page 1 of 1

01.17.07 Copyright Mitchell 1 Invoice1

AUT

Phone
You're Good to

INVOICE

Org. Est. #

INVOICE

Print Date : 04/03/2010

Hudson, WI

Home

Cust ID :

R

Part Description / Number

Qty

Ignition Starter Switch

KS6206

1.00

Ignition Lock Cylinder

KS6747L

1.00

269.99

269.99

IGNITION SWITCH AND LOCK CYLINDER -
Remove & Replace

127.40

APPROVED

Customer Copy

le Alero GL

E)

Odometer In : 120894

Odometer Out : 120894

NL52E72C

619.69

[Technicians : Maluka, Jeff]

Org. Estimate \$0.00

Revisions \$142.47

Current Estimate \$ 142.47

Additional Cost

Revised Estimate

04/03/2010 - 6:51 <none>

Parts: \$0.00 Labor: \$127.40 Sublet: \$0.00 Taxes & Fees: \$15.07

\$142.47

\$142.47

Labor: 127.40

Parts: 459.98

Sublet: 0.00

Sub: 587.38

Tax: 32.31

Total: 619.69

Bal Due: \$619.69

[Payments -]

Warranty - 12 Months/12,000 Miles (Most Services & Repairs)

SIGNATURE.....

Date.....

Time.....

Written By: Salchert, Matt

Page 1 of 1

01.17.07 Copyright Mitchell 1 Invoic1

Germantown, WI

MILWAUKEE WI 530

23 SEP 2014 PM 3.1



National Highway Traffic Safety Administration
ADMINISTRATOR
1200 New Jersey Ave S.E.
Washington, DC 20590

20590

