



U.S. Department  
of Transportation  
**National Highway  
Traffic Safety  
Administration**

1200 New Jersey Avenue SE.  
Washington, DC 20590

APR - 7 2015

Mr. Brian Rosa  
22 Millton Avenue  
Union, NJ 07083

NVS-213ps  
DP14-002

Dear Mr. Rosa:

This correspondence is in response to your petition dated July 7, 2014, requesting the National Highway Traffic Safety Administration (NHTSA) conduct a defect investigation into the unreasonable risk of engine stalling without warning after refueling when operating your model year (MY) 2007 Dodge Grand Caravan. Your vehicle is a Chrysler RS family minivan, which includes MY 2003 through 2007 Dodge Grand Caravan, Dodge Caravan, Chrysler Town and Country and Chrysler Voyager vehicles.

NHTSA's Office of Defects Investigation (ODI) evaluated your petition by analyzing the following information related to stalling after refueling in RS minivans: 1) consumer complaints submitted to the Agency; 2) field data and technical information provided by Chrysler in response to a formal information request letter from the Agency; and 3) data from testing of an RS minivan that was the subject of a post-refuel stall complaint to NHTSA. After completing this evaluation, we have concluded that further investigation is unlikely to result in a finding that a defect related to motor vehicle safety exists given the fact that these stalls occur right after refueling at very low speeds, low failure rates after these vehicles have been in service for 8 to 13 years and the absence of any reports of crashes or injuries.

In view of the need to allocate and prioritize NHTSA's limited resources to best accomplish the agency's safety mission, we are denying your petition. A detailed summary of ODI's analysis of your petition is presented in the enclosed notice, which is to be published in the Federal Register.

Thank you for bringing this matter to our attention.

Sincerely,

Frank S. Borris II  
Acting Associate Administrator  
for Enforcement



Enclosure:  
Federal Register Notice



U.S. Department  
of Transportation  
**National Highway  
Traffic Safety  
Administration**

# ODI RESUME

OFFICE OF DEFECTS INVESTIGATION

**NHTSA**

Authentic US Government Information  
National Highway Traffic Safety Administration  
uses a digital certificate to ensure  
the content has remained unchanged

**Investigation:** DP 14-002  
**Prompted by:** Defect Petition  
**Date Opened:** 09/05/2014  
**Investigator:** Paul Simmons  
**Approver:** Otto Matheke  
**Subject:** Engine Stall After Refueling  
**Date Closed:** 04/06/2015  
**Reviewer:** Jeff Quandt

## MANUFACTURER & PRODUCT INFORMATION

**Manufacturer:** Chrysler (FCA US LLC)  
**Products:** 2003-07 Caravan, Grand Caravan, Town & Country, Voyager  
**Population:** 1,855,333

**Problem Description:** The engine may stall shortly after refueling.

## FAILURE REPORT SUMMARY

	ODI	Manufacturer	Total
<b>Complaints:</b>	161	632	720**
<b>Crashes/Fires:</b>	0	0	0
<b>Injury Incidents:</b>	0	0	0
<b>Fatality Incidents:</b>	0	0	0

\*\* Total eliminates duplicates received by ODI and manufacturer.

## ACTION / SUMMARY INFORMATION

**Action:** This petition has been denied.

### Summary:

This defect petition evaluates July 7, 2014 allegations from an owner of a model year (MY) 2007 Dodge Grand Caravan minivan that engine stall occurs in these vehicles without warning after refueling. The petitioner's vehicle is a Chrysler RS platform minivan. The RS platform includes MY 2003 through 2007 Dodge Grand Caravan, Dodge Caravan, Chrysler Town and Country and Chrysler Voyager minivans. NHTSA evaluated the petition by analyzing consumer complaints submitted to the Agency, analyzing field data, reviewing technical information provided in Chrysler's response to an Agency information request and testing an RS minivan identified by its owner as experiencing post-refuel engine stalls.

After completing this evaluation, NHTSA has concluded that further investigation is unlikely to result in a finding that a defect related to motor vehicle safety exists. The stalls occurring in these vehicles only occur immediately after filling up the fuel tank and happen at low engine speeds. The failure rate is low, even after 8 to 13 years of the vehicles being in service, and there are no reports of crashes or injuries resulting from the stall condition. In the Agency's view, additional investigation is unlikely to result in finding the existence of a safety-related defect in the subject vehicles. Given the need to allocate and prioritize NHTSA's limited resources to best accomplish the Agency's safety mission, the petition is denied.

This action does not constitute a finding by NHTSA that a safety-related defect does not exist. The Agency will take further action if warranted by future circumstances. More details concerning our review can be found in the Federal Register Notice for this action.

The following 161 VOQs are included in the petition evaluation: 10209242, 10229468, 10240708, 10260923, 10275939, 10276532, 10296487, 10298175, 10328669, 10330144, 10346517, 10349789, 10354758, 10363689, 10372112, 10372368, 10372514, 10378031, 10379764, 10382938, 10387448, 10394063, 10398877, 10413918, 10418652, 10420924, 10427063, 10437525, 10445392, 10446902, 10470028, 10471249, 10473733, 10502231,

10503114, 10504260, 10509862, 10511988, 10512120, 10512385, 10512650, 10513147, 10538154, 10549841,  
10551763, 10555188, 10555418, 10556754, 10565367, 10574012, 10574398, 10586555, 10587212, 10587559,  
10593433, 10607841, 10607913, 10608922, 10615810, 10622468, 10628141, 10632112, 10632128, 10632172,  
10632175, 10632231, 10632262, 10632266, 10632270, 10632305, 10632316, 10632326, 10632370, 10632385,  
10632399, 10632492, 10632542, 10632765, 10632833, 10632928, 10633197, 10633281, 10633409, 10633421,  
10633483, 10633507, 10637752, 10637804, 10637950, 10637975, 10638032, 10638289, 10638290, 10638401,  
10638968, 10639218, 10639623, 10641157, 10641603, 10641614, 10641836, 10644339, 10644705, 10649713,  
10649895, 10649932, 10650313, 10652590, 10653147, 10653783, 10654533, 10655226, 10658900, 10659679,  
10660320, 10662588, 10662645, 10662662, 10663473, 10667056, 10667437, 10668081, 10668094, 10668131,  
10668612, 10668969, 10668970, 10669584, 10669678, 10669729, 10669775, 10669866, 10669895, 10669992,  
10670422, 10670506, 10676348, 10676732, 10677120, 10679795, 10679934, 10680057, 10680290, 10680342,  
10680714, 10681512, 10682584, 10682906, 10683022, 10683114, 10683549, 10683620, 10683697, 10683743,  
10689898, 10690761, 10691284, 10691556, 10691751, 10693061, 10694300

**DEPARTMENT OF TRANSPORTATION**

National Highway Traffic Safety Administration

Denial of Motor Vehicle Defect Petition, DP14-002

**AGENCY:** National Highway Traffic Safety Administration (NHTSA), Department of Transportation.

**ACTION:** Denial of petition for a defect investigation.

**SUMMARY:** This document denies a July 7, 2014 petition from Mr. Brian Rosa of Union, NJ, requesting that the agency open an investigation into an alleged defect resulting in engine stall without warning after refueling in a model year (MY) 2007 Dodge Grand Caravan minivan. The petitioner's vehicle is a Chrysler RS platform minivan. The RS platform includes MY 2003 through 2007 Dodge Grand Caravan, Dodge Caravan, Chrysler Town and Country and Chrysler Voyager minivans. NHTSA evaluated the petition by analyzing consumer complaints submitted to the Agency, analyzing field data and reviewing technical information provided by Chrysler in response to an information request letter from the Agency, and testing an RS minivan that was the subject of a post-refuel engine stall complaint to NHTSA. After completing this evaluation, NHTSA has concluded that further investigation of the alleged defect in the subject vehicles is unlikely to result in a determination that a safety-related defect exists. The agency accordingly denies the petition.

**FOR FURTHER INFORMATION CONTACT:** Mr. Paul Simmons, Vehicle Control Division, Office of Defects Investigation, NHTSA, 1200 New Jersey Avenue, SE, Washington, DC 20590. Telephone: (202) 366-2315.

**SUPPLEMENTARY INFORMATION:**

**Alleged Defect**

The petitioner alleges that his MY 2007 Dodge Grand Caravan vehicle experienced multiple incidents of engine stall without warning after refueling. The petitioner discovered that the defective part is a valve that is integral to the fuel tank, requiring tank replacement to repair the

problem. The petitioner alleged that stalling without warning is an unreasonable risk to motor vehicle safety and requests the agency take action by opening a Preliminary Evaluation fully evaluate the defect.

### **Engine Stall Defects**

The United States Code for Motor Vehicle Safety (Title 49, Chapter 301) defines motor vehicle safety as “the performance of a motor vehicle or motor vehicle equipment in a way that protects the public against unreasonable risk of accidents occurring because of the design, construction, or performance of a motor vehicle, and against unreasonable risk of death or injury in an accident, and includes nonoperational safety of a motor vehicle.” NHTSA considers several factors when assessing the safety risk posed by conditions that may result in engine stall while driving. These include the speeds at which stalling may occur, the ability of the driver to restart the vehicle, the warning available to the driver prior to stalling, the effects of engine stall on vehicle controllability, when and where the stalling will occur and the effects of the condition on other safety systems of the vehicle. In general, conditions that result in engine stall during low-speed operation at idle, such as when slowing to a stop, and which do not affect the operator’s ability to immediately restart the engine are considered the least hazardous types of stalling problems and, absent other safety factors, are not considered to be unreasonable risks to safety.

### **Background (PE13-016)**

On February 10, 2014, ODI closed an investigation of an alleged defect in approximately 153,817 MY 2006 Chrysler 300, Dodge Charger and Dodge Magnum vehicles (LX cars) that may result in engine stall shortly after refueling (PE13-016). In response to ODI’s information request for PE13-016, Chrysler identified a problem with the multifunction control valve (MFCV) fuel shutoff float integrated into 19-gallon fuel tanks in certain LX vehicles. According to Chrysler, the float may swell after exposure to fuels with high ethanol content, which may cause the valve to stick. A float valve that is stuck open during refueling, could result in fuel tank overfill and allow raw fuel to enter the purge line. This could result in problems with engine driveability (e.g., stumble or hesitation) or stall while driving in the brief period immediately after filling the fuel tank.

ODI's analysis of complaints related to this condition determined that most of the incidents of engine stall were occurring when the vehicles were stopped or travelling at low speeds and there were no reports of any difficulty restarting the engines after such incidents. No crashes or injuries were identified in the subject vehicles, which had been in service for 7 to 8 years. The investigation was closed with no safety recall due to the low safety risk associated with the alleged defect condition.

### **RS Minivan analysis**

In response to ODI's information request letter for DP14-002, Chrysler indicated that the RS Minivans may experience a condition with MFCV float sticking similar to the one investigated in the LX Cars in PE13-016:

*"The failure mechanism is a result of a swollen refueling float within the multifunction control valve. Studies have proven that elevated ethanol additives cause the float and housing to swell, which, in turn, causes the float to intermittently stick. Once stuck, a limited amount of fuel will pass beyond the refuel float and enter the vapor recovery system before the fill pressure threshold is reached and shuts the fuel nozzle off.*

*"Once fuel has entered into in the vapor recovery system, it can then be purged into the engine's intake system in place of anticipated vapor within the first minute of starting the engine. The result of fuel rather than vapor entering in the engine intake system will cause the engine to stumble or, when the vehicle is not in motion and/or the engine at idle, a stall can occur. The condition is often contained to a momentary engine stumble as the purge event is immediately turned off when a rich fuel condition is detected by the Powertrain Control Module.*

*"Chrysler believes there is no unreasonable risk to motor safety because an engine stumble or rough idle will occur at a low driving speed, and while a stall is most likely to occur at an idle or stop. There have been no reported accidents or property damage in over 1.8 million vehicles. Additionally, when a refuel valve does stick, there is sufficient back pressure in the fuel system to shut off the fuel pump and limit the amount of the fuel into the purge line."*

ODI's analysis of complaints, field reports, legal claims and warranty data related to the alleged defect in Chrysler RS Minivans identified a total of 720 post-refueling engine stall incidents in approximately 1.8 million vehicles, resulting in an overall rate of 0.39 per incidents per thousand vehicles (IPTV). Similar to the LX Car analysis in PE13-016, the engine stalls were mostly

occurring when the vehicle was stopped or coasting to a stop at low speed. There were no allegations of difficulty restarting the engines immediately after the stalls occurred. There were no allegations of crash or injury.

Differences in tank design, exhaust routing and purge strategy may influence the incident rate at which the MFCV float sticking condition occurs and/or the potential for engine stall or other performance concerns. As a result, ODI's analysis examined incident rates over the full range of RS Minivan production to assess the effects of changes in tank design and purge control logic. This analysis identified an elevated incident rate for approximately 208,000 MY 2004 and 2005 RS Minivans built during a seventh month period from September 2003 through March 2004, which exhibited a failure rate similar to the LX Cars investigated in PE13-016. Table 1 summarizes the field data for DP14-002 and PE13-016.

NHTSA Inv. No.	Vehicles	Build Range	Population	Vehicle Age (Yrs)	Total Reports	Report Rate (IPTV)	Crashes/Injuries
PE13-016	LX cars, 2006	4/05 – 7/06	153,817	7-8	299	1.94	0/0
DP14-002	RS vans, 2003-04	7/02 – 8/03	425,544	11-12	34	0.08	0/0
	RS vans, 2004-05	9/03 – 3/04	208,419	10-11	445	2.14	0/0
	RS vans, 2005-07	4/04 – 5/07	1,221,370	7-10	241	0.20	0/0
	Total RS, 2003-07	7/02 – 5/07	1,855,333	7-12	720	0.39	0/0

**Table 1. Summary of NHTSA complaints and Chrysler complaints, field reports and lawsuits.**

### **Subject Vehicle Test Results**

As part of its evaluation of this defect petition, NHTSA's Vehicle Research and Test Center (VRTC) conducted testing on a 2005 Chrysler Town & Country LMT (3.6L SFI, 20 gal. fuel tank) vehicle that was the subject of an ODI complaint (VOQ 10641603) that provided the following description of the problem:

*After fill up, vehicle stalls, the engine cuts off and the vehicle loses all power and power steering. This happened first on a cross country trip and caused some serious safety concerns when attempting to exit the gas station and merge onto the highway. This problem has been occurring regularly from the first instance in 2011. When fueling, the van is never over filled; we fill until the pump clicks off. This seems to be a fairly common problem in this generation of minivans as represented in online forums trying to diagnose the problem.*

VRTC conducted tests on the complaint vehicle to assess engine performance after refueling, including the driving conditions and ease of engine restart associated with any observed engine stalls. When refueling the vehicle up to the initial shut-off of the filling station pump nozzle, the VRTC testing was able to reproduce stalling incidents when the vehicle was stopped or coasting to a stop at low speed. The vehicle did not stall 4 out of 5 times when travelling at 5 mph, but minor hesitation was noted. No stalls and only minor hesitation were occurred when travelling at 10 mph or above in tanks filled to the initial nozzle shut-off. Stalling was more likely to occur if the tank was overfilled (i.e., adding fuel past the initial fill nozzle shutoff). Testing after overfilling resulted in stalls in 4 of 5 tests at speeds up to 10 mph. Regardless of fill condition, the vehicle could always be immediately restarted after each engine stall.

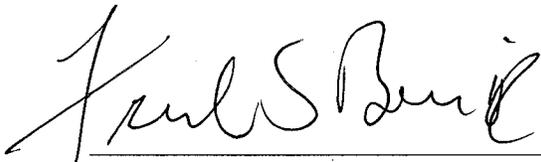
### **Conclusion**

In the Agency's view, additional investigation is unlikely to result in a finding that a defect related to motor vehicle safety exists given the limited conditions under which the subject condition may result in engine stall, the low failure rate in vehicles with approximately 8 to 13 years in service and the absence of any reports of crashes or injuries. Therefore, in view of the need to allocate and prioritize NHTSA limited resources to best accomplish the Agency's safety mission, the petition is denied. This action does not constitute a finding by NHTSA that a safety-related defect does not exist. The Agency will take further action if warranted by future circumstances.

Authority: 49 U.S.C. 30162(d); delegations of authority at CFR 1.50 and 501.8.

Issued on:

APR -7 2015

A handwritten signature in black ink, appearing to read "Frank S. Borris II". The signature is written in a cursive style with a horizontal line underneath it.

Frank S. Borris II  
Acting Associate Administrator for Enforcement

Billing Code 4910-59-P