



U.S. Department
of Transportation

400 Seventh Street, SW
Washington, DC 20590

**National Highway
Traffic Safety
Administration**

AUG - 5 2005

MR. STEVE GLADOW
ENGINEERING MANAGER
COLLINS BUS CORPORATION
P.O. BOX 2946
HUTCHINSON, KS 67504

NVS-215kjs
05V-343

Subject: STOP ARM MALFUNCTIONS

Dear MR. GLADOW:

This letter is to acknowledge your recent defect or noncompliance information report. Please review the following information to ensure that it conforms to your records as this information will be made accessible to the public.

Makes/Models/Model Years:

COLLINS/BANTAM/2002-2005
COLLINS/GRAND BANTAM/2002-2005
COLLINS/SUPER BANTAM/2002-2005

NHTSA Campaign Number: 05V-343

Recall Date: July 27, 2005

Components:

OTHER:SCHOOL BUS STOP ARM ASSEMBLY

Potential Number of Units Affected: TO BE DETERMINED

Summary:

CERTAIN 2002-2005 MY COLLINS BANTAM, SUPER BANTAM, AND GRAND BANTAM SCHOOL BUSES EQUIPPED WITH SPECIALTY MANUFACTURING "5" SERIES STOP ARMS ORIGINALLY SOLD OR CURRENTLY REGISTERED IN THE FOLLOWING STATES: ALASKA, COLORADO, CONNECTICUT, DELAWARE, IDAHO, ILLINOIS, INDIANA, IOWA, KANSAS, KENTUCKY, MAINE, MARYLAND, MASSACHUSETTS, MICHIGAN, MINNESOTA, MISSOURI, MONTANA, NEBRASKA, NEVADA, NEW HAMPSHIRE, NEW JERSEY, NEW MEXICO, NEW YORK, NORTH DAKOTA, OHIO, OREGON, PENNSYLVANIA, RHODE ISLAND, SOUTH DAKOTA, TENNESSEE, UTAH, VERMONT, VIRGINIA, WASHINGTON, WEST VIRGINIA, WISCONSIN, WYOMING, AND THE DISTRICT OF COLUMBIA. IN EXTREMELY COLD WEATHER, THE MICROSWITCHES USED INTERNALLY TO POSITION THE SIGN IN THE OPEN AND CLOSED POSITIONS MAY MALFUNCTION, CAUSING THE SIGN TO OPEN OR CLOSE IN AN IMPROPER POSITION, OR TO NOT OPEN AT ALL.

Consequence:

SHOULD THE STOP ARM NOT PERFORM PROPERLY, A CHILD OR PEDESTRIAN MAY BE ENDANGERED BY PASSING VEHICLES SHOULD THE MOTORIST NOT STOP AT THE CORRECT LOCATION.

Remedy:

COLLINS BUS WILL NOTIFY ITS CUSTOMERS AND THE ORIGINAL SWITCH WILL BE REPLACED FREE OF CHARGE WITH A SWITCH PACK THAT IS NOT SENSITIVE TO EXTREME COLD WEATHER AND WILL INSPECT TO ENSURE THE MICROSWITCH HEATER WIRING IS PROPERLY CONNECTED. THE RECALL IS EXPECTED TO BEGIN AUGUST 19, 2005. CUSTOMERS SHOULD CONTACT SPECIALTY MANUFACTURING AT 1-800-951-7867 OR COLLINS BUS CUSTOMER SERVICE AT 1-800-533-1850.

Notes:

CUSTOMERS CAN CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236; (TTY: 1-800-424-9153); OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).

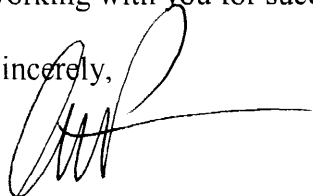
This recall is the result of an investigation conducted by the Office of Defects Investigation, PE05-011.

We have received Collins' proposed owner notification letter and it is currently under review. You will be notified of any changes or concerns once our review is complete. Also, copies of all notices, bulletins, dealer notifications, and other communications that relate to this recall, including a copy of the final owner notification letter and any subsequent owner follow-up notification letter(s), are to be submitted to this office no later than 5 days after they are originally sent (if they are sent to more than one manufacturer, distributor, dealer, or purchaser/owner).

As stated in Part 573.7, submission of the first of six consecutive quarterly status reports is required within one month after the close of the calendar quarter in which notification to purchasers occurs. As stated in your report, the recall is expected to begin on August 19, 2005. Therefore, the first quarterly report will be due by October 30, 2005.

Your contact for this recall will be Kelly Schuler, who may be reached by phone at 202-366-5227 or by email at KSCHULER@NHTSA.DOT.GOV. We look forward to working with you for successful completion of this recall campaign.

Sincerely,

A handwritten signature in black ink, appearing to read 'G. Person', with a long horizontal flourish extending to the right.

George H. Person
Chief, Recall Management Division
Office of Defects Investigation
Enforcement