

NVS-2... OGE-065
(10 pgs.)

Noncompliance Report Guide for Equipment
PART 573 Defect and Noncompliance Responsibility and Reports

On July 6, 2006, AJ Motorsport [MFR] decided that a noncompliance with Federal Motor Vehicle Safety Standard No. 108 exists in items of motor vehicle equipment listed below, and is furnishing notification to the National Highway Traffic Safety Administration in accordance with 49 CFR Part 573 Defect and Noncompliance Responsibility and Reports.

Date this report was prepared: 7/6/06

Furnish the manufacturer's identification code for this recall (if applicable): _____

1. Identify the full corporate name of the fabricating manufacturer/brand name/trademark owner of the recalled item of equipment. If the recalled item of equipment is imported, provide the name and mailing address of the designated agent as prescribed by 49 U.S.C. §30164.

AJ Motorsport
10166 Olney St.
El Monte, CA 91731

Identify the corporate official, by name and title, whom the agency should contact with respect to this recall.

Jack Hsu, Owner

Telephone Number: 626-618-2026 Fax No.: 626-452-9225

Name and Title of Person who prepared this report.

Jack Hsu
Owner

Signed:

Jack Hsu

¹ Each manufacturer must furnish a report, to the Associate Administrator for Enforcement, for each noncompliance condition.

This guide was developed from 49 CFR Part 573, "Defect and Noncompliance Responsibility and Reports" and also outlines information currently requested. Any questions, please consult the complete Part 573 or contact Mr. George Person at (202) 366-5210 or by FAX at (202) 366-7882.

RECEIVED
2006 JUL 17 A 8:10
OFFICE OF DEFECT
INVESTIGATION

I. Identify the Recalled Items of Equipment

2. Identify the Items of Equipment Involved in this Recall, *for each make and model or applicable item of equipment product line (provide illustrations or photographs as necessary to describe the item of equipment), provide:*

Generic name of the item:

Make: _____ **Model:**

Part Number: _____ **Size:** SEE TABLE R2 FOR LIST.

Function:

Other information which characterizes/distinguishes the items of equipment to be recalled:

Make: _____ **Model:**

Part Number: _____ **Size:**

Function:

Other information which characterizes/distinguishes the items of equipment to be recalled:

Make: _____ **Model:**

Part Number: _____ **Size:**

Function:

Model Years Involved:

Other information which characterizes/distinguishes the items of equipment to be recalled:

Make: _____ **Model:**

Part Number: _____ **Size:**

Function:

Other information which characterizes/distinguishes the items of equipment to be recalled:

Identify the approximate percentage of the production of all the recalled models manufactured by your company between the inclusive dates of manufacture provided above, that the recalled model population represents. For example, if the recall involved Widgets equipped with certain items of equipment from January 1, 1996, through April 1, 1997, then what was the percentage of the recalled Widgets of all Widgets manufactured during that time period.

II. Identifying the Recall Population

3. Furnish the total number of items of equipment recalled potentially containing the noncompliance.

Items		Number of
Model	Year	Potentially
<u>Involved</u>		
Refer to table R3		

Total Number Potentially Affected by the Recall: _____

4. Furnish the approximate percentage of the total number of items of equipment estimated to actually contain the noncompliance: 100%

Identify and describe how the recall population was determined--in particular how the recalled models were selected and the basis for the beginning and final dates of manufacture of the recalled items of equipment:

Recall applications have specific years for each vehicle. Refer to Table R3.

Attn: Sam
 From: Jack Hsu
 AS Motorsport

III. Describe the Noncompliance

5. Describe the noncompliance. The description should address the nature and physical location of the noncompliance. Illustrations should be provided as appropriate.

Combination Lamps that do not contain the amber side reflex reflectors. See Illustration R2 for reference of physical location.

Describe the cause(s) of the noncompliance condition.

The combination lamps, when manufactured, omitted the amber side reflex reflectors or were replaced with clear side reflex reflectors.

Describe the consequence(s) of the noncompliance condition.

Visual sight of oncoming vehicles is decreased or diminished, which may cause collisions or even death.

Identify any warning which can (a) precede or (b) occur.

N/A - There is no warning

If the noncompliance is in a component or assembly purchased from a supplier, identify the supplier by corporate name and address.

Anzo USA, 19888 Quiroz Court, Walnut, CA 91789
 E-Speed Racing 2275 E. Locust Court, Ontario, CA 91761

Yuio Li Industrial Co. LTD. No. 11 Alley 28,
 Min Hua Lane, Fuan Tsun, HSIU HSIANG, Chang Hua Hsien
 Identify the name and title of the chief executive officer or knowledgeable representative of the supplier: TAIWAN R.O.C.

Anzo USA - Calvin Law
 E-Speed Racing - Steward
 Yuio Li Industrial Co. LTD - Lin Shu-Kuo

IV. Provide the Chronology in Determining the Noncompliance

6. With respect to a noncompliance, identify and provide the test results or other data (in chronological order and including dates) on which the noncompliance was determined.

No test data is available. Non-compliance was determined by professional judgement.

V. Identify the Remedy

7. A description of the manufacturer's program for remedying the noncompliance. This program shall include a plan for reimbursing an owner or purchaser who incurred costs to obtain a remedy for the problem addressed by the recall within a reasonable time in advance of the manufacturer's notification of owners, purchasers and dealers, in accordance with §573.13 of this part. A manufacturer's plan may incorporate by reference a general reimbursement plan it previously submitted to NHTSA, together with information specific to the individual recall. Information required by §573.13 that is not in a general reimbursement plan shall be submitted in the manufacturer's report to NHTSA under this section. If a manufacturer submits one or more general reimbursement plans, the manufacturer shall update each plan every two years, in accordance with §573.13. The manufacturer's remedy program and reimbursement plans will be available for inspection by the public at NHTSA headquarters.

A recall notification will be sent to all affected customers and we will arrange for the lamps to be returned to us, at no cost to the customer, and a full refund will be issued for the purchase price.

8. Furnish a description of the manufacturer's remedy for the noncompliance. Clearly describe the differences between the recall condition and the remedy.

See answer #7. A recall condition is information describing the recall while the remedy

is the actions taken to resolve the issue.

Clearly describe the distinguishing characteristics of the remedy component/assembly versus the recalled component/assembly.

Remedy components/assembly requires accepting non-compliance equipment & issuing refunds. Recall components, assembly is mailing out recall notices.

Identify and describe how and when the recall condition was corrected in production. If the production remedy was identical to the recall remedy in the field, so state. If the product was discontinued, so state.

The product will not be corrected, but will be discontinued.

VI. Identify the Recall Schedule

9. Furnish a schedule or agenda (with specific dates) for notification to other manufacturers, dealers/retailers, and purchasers. Please, identify any foreseeable problems with implementing the recall.

7/17/06 - Mail Safety Recall Notice (after approval)
7/31/06 - Mail follow-up notice for recall

VII. Furnish Recall Communications


10. Furnish a final copy of all notices, bulletins, and other communications that relate directly to the noncompliance and which are sent to more than one manufacturer, distributor, or purchaser. This includes all communications (including both original and follow-up) concerning this recall from the time your company determines the noncompliance condition on, not just the initial notification. *A DRAFT copy of the notification documents should be submitted to the Office of Defects Investigation by Fax (202-366-7882) for review prior to mailing.*

Note: These documents are to be submitted separately from those provided in accordance with Part 579.5 requirements.

A copy of the completed Part 573 report guide should be
faxed to:

Mr. Sam Campbell at (202) 366-7097


Illustration R2

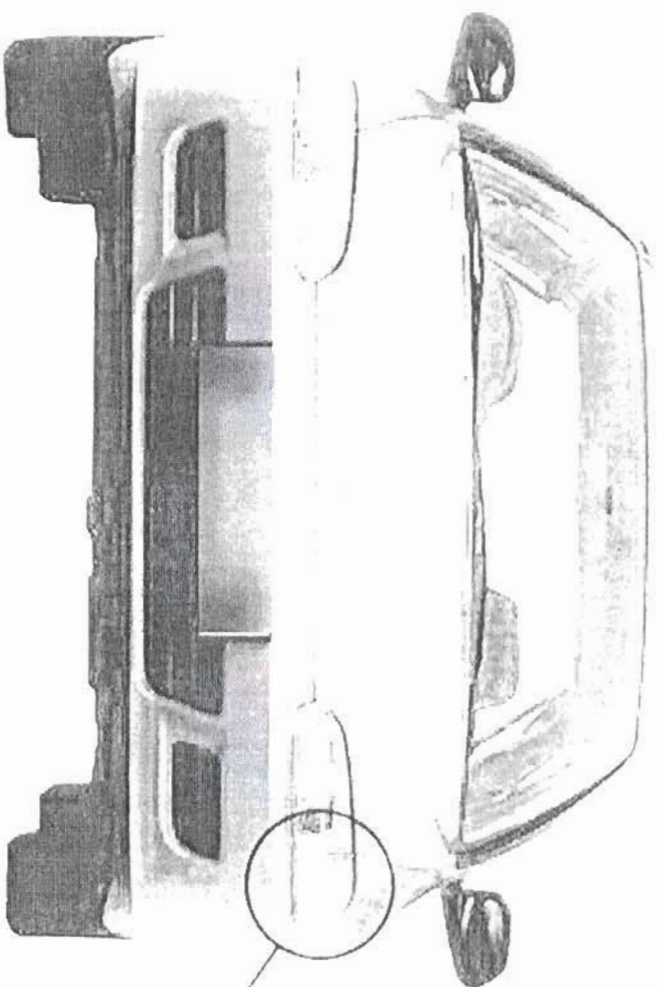

Ref. 1

Corner Lamp

Location: Front Side

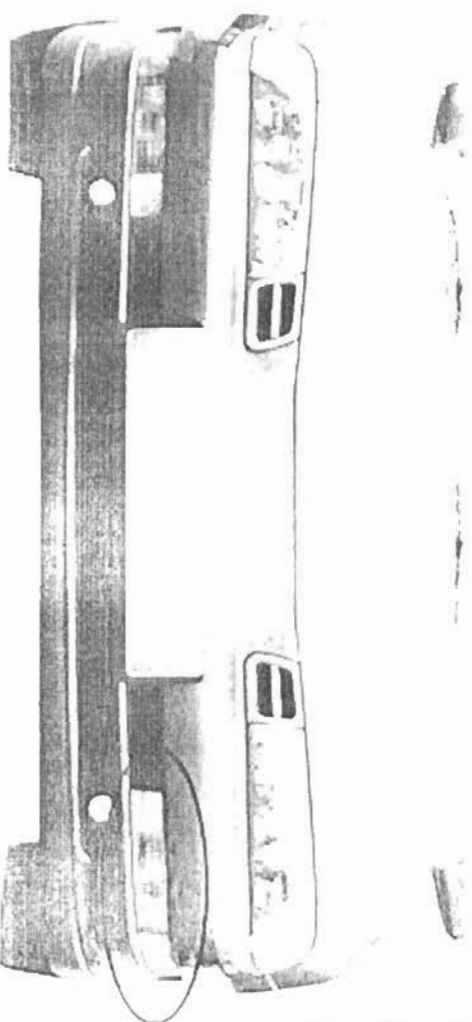

Ref. 2

Bumper Lamp

Location: Front

Bottom/Side

Table R2

	Part No.	Years, Make, Model, Generic Name	Size	Function	Location (Refer to Illustration R2)	Other
1	AI9195C-4	91-95 Acura Legend Corner Lamp	N/A	Park Light	Ref 1	N/A
2	CCAM9302C-E	93-02 Chevy Camaro Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
3	CCI9196C	91-96 Chevy Caprice Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
4	CF99C-E	99-05 Chevy Full Sized Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
5	CS98B-E	98-04 Chevy S10 Bumper Lamp	N/A	Park/Signal Light	Ref 2	N/A
6	DD9702C-E	97-03 Dodge Dakota Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
7	FF9702C-E	97-02 Ford F150 Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
8	FP9397B-GTSE	93-97 Ford Probe Bumper Lamp	N/A	Park/Signal Light	Ref 2	N/A
9	FR01C	01-05 Ford Ranger Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
10	FT9679C	96-97 Ford Thunderbird Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
11	HA9497C-E	94-97 Honda Accord Corner Lamp	N/A	Park Light	Ref 1	N/A
12	HC9295C-2-JC	92-95 Honda Civic Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
13	HDS9397C-E	93-97 Honda Del Sol Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
14	IR9197C	91-97 Isuzu Rodeo Corner Lamp	N/A	Park Light	Ref 1	N/A
15	JC9701B	97-01 Jeep Cherokee Corner Lamp	N/A	Signal Light	Ref 2	N/A
16	JC9701C	97-01 Jeep Cherokee Bumper Lamp	N/A	Park Light	Ref 1	N/A
17	JL02B	02-04 Jeep Liberty Bumper Lamp	N/A	Park/Signal Light	Ref 2	N/A
18	ME9091C	90-91 Mitsubishi Eclipse Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
19	MM9396C	93-96 Mitsubishi Mirage Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
20	PF9397B	93-97 Pontiac Firebird Bumper Lamp	N/A	Park/Signal Light	Ref 2	N/A
21	TO9800C	98-00 Toyota Corolla Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
22	TT01-C-CHR	01-04 Toyota Tacoma Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A
23	TTUN00C	00-04 Toyota Tundra Corner Lamp	N/A	Park/Signal Light	Ref 1	N/A

Table R3

Items/Model	Years	Number of Potentially
AI9195C-4	1991-1995	176
CCAM9302C-E	1993-2002	151
CCI9196C	1991-1996	249
CF99C-E	1999-2005	65
CS98B-E	1998-2004	89
DD9702C-E	1997-2003	90
FF9702C-E	1997-2003	100
FP9397B-GTSE	1993-1997	289
FR01C	2001-2005	189
FT9679C	1996-1997	122
HA9497C-E	1994-1997	193
HC9295C-2-JC	1992-1995	142
HDS9397C-E	1993-1997	195
IR9197C	1991-1997	152
JC9701B	1997-2001	136
JC9701C	1997-2001	239
JL02B	2002-2004	125
ME9091C	1990-1991	246
MM9396C	1993-1996	184
PF9397B	1993-1997	76
TO9800C	1998-2000	85
TT01-C-CHR	2001-2004	170
TTUN00C	2000-2004	130

Total Number Potentially Affected by the Recall: 3593