



Revision (1) November 2022

Dealer Service Instructions for:

Safety Recall R37 / NHTSA 15V-444

Driver Airbag Inflator

NOTE: 2008-2010 Dodge Challenger included in this campaign are part of a STOP DRIVE initiative. Please reference ZD1 for more information.

Models

2008-2010 (LC) Dodge Challenger

IMPORTANT: Some of the involved vehicles may be in dealer used vehicle inventory. Dealers should complete this recall service on these vehicles before retail delivery. Dealers should also perform this recall on vehicles in for service. Involved vehicles can be determined by using the VIP inquiry process.

Subject

The driver airbag inflator housing on about 88,000 of the above vehicles may rupture, due to excessive internal pressure, during normal airbag deployment events. This condition is more likely to occur if the vehicle has been exposed to high levels of absolute humidity for extended periods of time. An inflator rupture, during airbag deployment events, could result in metal fragment(s) striking and potentially seriously injuring the vehicle occupant(s).

Repair

The driver airbag inflator must be replaced.

Parts Information

NOTE: Do not destroy the original airbag packaging, it will be used to return the original inflator to the supplier.

Part Number

Description

CBXZP812AA

Inflator Kit, Driver Airbag (TRW)

Each kit contains the following components:

<u>Quantity</u>	<u>Description</u>
1	Inflator

Parts Return

Shipping/return instructions are provided with each inflator kit.

For Continental US 48 States use the procedure on page 3 to package the original airbag inflator in the replacement kit box and return. Shipping/return instructions are also provided with each inflator kit.

All International, Mexico, Canada, Hawaii, Alaska, Puerto Rico, and US Virgin Islands dealers MUST contact the following Takata/Menlo USA representative directly for shipping instructions:

Miguel Prigadaa – Tel #: 210-250-5078 or

Email: MLGTakataRestraints_International@menloworldwide.com.


Parts Return Continued

NOTE: For Continental US 48 State dealerships, please follow steps 1-8 below.
 • Specific to Step 4 below:
 • Follow step 4a if you receive the updated NON-FedEx label. Proceed to step 5.
 • Follow step 4b if you receive the FedEx label. Proceed to step 5.

1. Shipping Documents


a) Box Label

- Supplied with each Kit
- To be affixed to each box




b) Over-pack Label

- To be supplied by Stericycle.
- To be affixed to the outside of each pallet

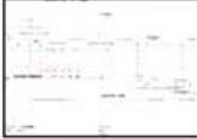


c) Bill of Lading

- To be supplied by Stericycle.
- Print 2 copies: 1 for Dealer Records, 1 for LTL Driver



d) ERG Document

- To be supplied by Stericycle.
- To be provide by the Dealer to the LTL Driver for each shipment




4b. Shipping Instructions – Label each Box

a) If you continue receiving Inflator Kits with the original FedEx Documentation:

1. Peel off the backing of the FedEx Ground PRP Shipping label and affix to top of box to left of the Class 9 label.
- Use the scribe line on the box as a guide
- The FedEx Ground PRP Shipping label must not touch any portion of the printing to the right of the scribe line.


2. Discard the remaining Documentation
3. **Do Not** contact FedEx



2. Packing Instructions

a) Confirm box is in acceptable condition. If a new box is needed, follow the New Box instructions located in Box 8 of this page.

b) Place the un-deployed air bag inflator in the "cradle" of the box insert.



5. Shipping Instructions – Prepare the Pallet


a) Accumulate and palletize Kits

b) Arrange Kits on Pallet as pictured here

- 20 boxes per row/layer (5x4)
- 10 rows/layers per pallet (200 boxes)


c) Shrink-wrap Kits to Pallet

d) Affix Over-pack Label on (1) side of Pallet (Not on Top)



3. Closure Instructions

a) Close the top box flap, per box closure instructions located on front panel of box.

6. Shipping Instructions – Schedule LTL Pickup

a) Upon Accumulating 200 kits (1 Over-pack/Pallet) Minimum

- Call Stericycle at 1-888-708-5712
- If 200 Kits have not been accumulated in 30 days, please call Stericycle for direction

c) Have the following Information Available

- Dealer #
- Quantity of Over-pecks/Pallets
- Quantity of Passenger Inflator Kits on each Pallet
- Email Address where shipping Documentation can be received


7. Shipping Instructions – Ship

a) Give 1 Copy of BOL and 1 Copy of ERG to Driver

b) Retain 1 Copy of BOL for Dealership records and archive for 2 Years

4a. Shipping Instructions – Label each Box

a) New Labels will begin shipping in each kit starting mid May, 2015

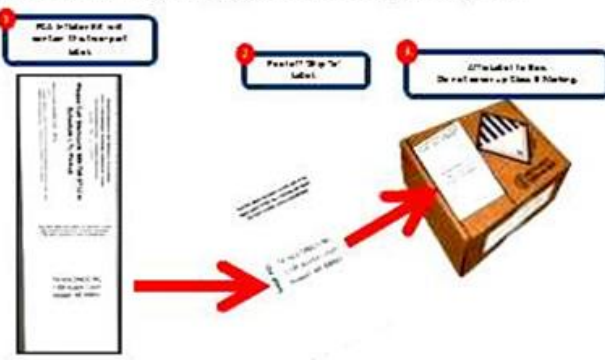

8. Requesting a New Box / Shipping Labels

If a new box or replacement shipping labels are needed, please contact the representative listed below by phone or email to request replacement materials.

Primary Contact: Armando Gorzalez - Tel #: 210-250-5079
 E-Mail: FieldAction.14305@menlowordwide.com

To help expedite your request, please be prepared to provide the following information:

- Serial number on the original box
- What Type of shipping material needed
 - Replacement Box
 - Two Part Return Label
 - Bill of Lading
 - ERG Form
- Dealer Shipping Information
 - Contact name
 - Dealer Address
 - Phone Number



Service Procedure**A. Replace Driver Airbag Inflator**

WARNING: To avoid serious or fatal injury on vehicles equipped with airbags, disable the Supplemental Restraint System (SRS) before performing this service procedure.

Disconnect and isolate the battery negative (ground) cable, then wait two minutes for the system capacitor to discharge before performing this procedure. This is the only sure way to disable the SRS. Failure to take the proper precautions could result in accidental airbag deployment.


At no time should any source of electricity be permitted near the inflator on the back of a non-deployed airbag. When carrying a non-deployed airbag, the trim cover or airbag cushion side of the unit should be pointed away from the body to minimize injury in the event of an accidental deployment.

1. Use this procedure to replace the driver airbag inflator.
2. Disconnect and isolate the negative battery cable. Wait two minutes for the system capacitor to discharge before further service.
3. Remove and save the two screws that secure the driver airbag assembly to the steering wheel armature from the underside of the steering wheel (Figure 1).

CAUTION: Do not pull on the horn switch feed pigtail wire to disengage the connector from the driver airbag housing or to disconnect the horn switch to steering wheel wire harness connection. Improper pulling on this pigtail wire or connection can result in damage to the horn switch membrane or feed circuit.



Figure 1 - Driver Airbag Screw Location

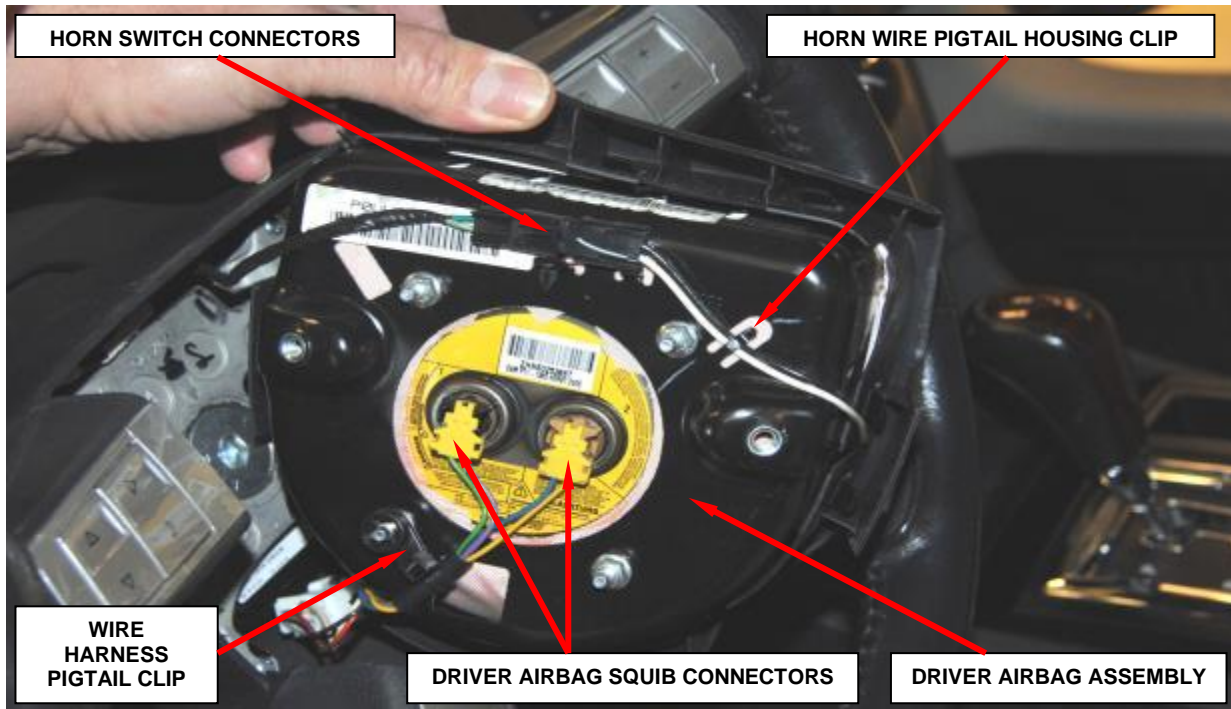Service Procedure Continued**Figure 2 – Electrical Connectors**

4. Pull the driver airbag assembly away from the steering wheel far enough to access the three electrical connections on the back of the airbag housing (Figure 2).
5. Disconnect the steering wheel wire harness connector for the horn switch from the horn switch feed pigtail wire connector, which is located on the back of the driver airbag housing (Figure 2).

CAUTION: Do not pull on the clockspring pigtail wires or pry on the connector insulator to disengage the connector from the driver airbag inflator connector receptacle. Improper removal of these pigtail wires and their connector insulators can result in damage to the airbag circuits or connector insulators.

Service Procedure Continued

6. Disconnect the driver airbag squib connectors. Depress the latches on each side of the connector insulator and pull the insulators straight out from the airbag inflator to disconnect them from the connector receptacles (Figure 3).
7. Disengage the wire harness pigtail clip from the housing (Figure 4).
8. Remove the driver airbag assembly from the steering wheel.



Figure 3 – Airbag Squib Connectors

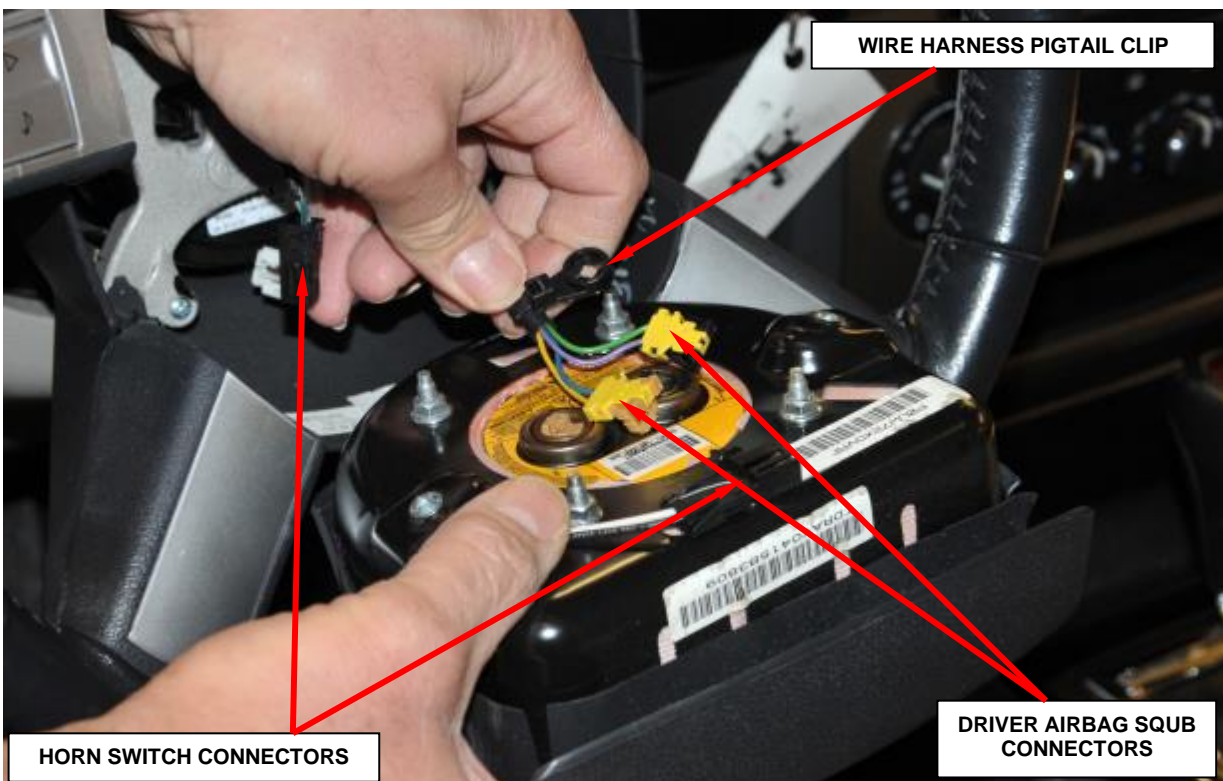


Figure 4 – Wire Harness Pigtail Clip

Service Procedure Continued

9. Place the driver airbag on a soft surface to prevent damage using the foam block provided with the inflator kit.
10. Remove the horn switch connector from the housing (Figure 5).
11. Remove the horn wire pigtail from the housing clip (Figure 5).
12. Remove the driver airbag cover starting with the left side by pressing down on the driver airbag housing until the hooks unsnap from the windows (Figure 6).

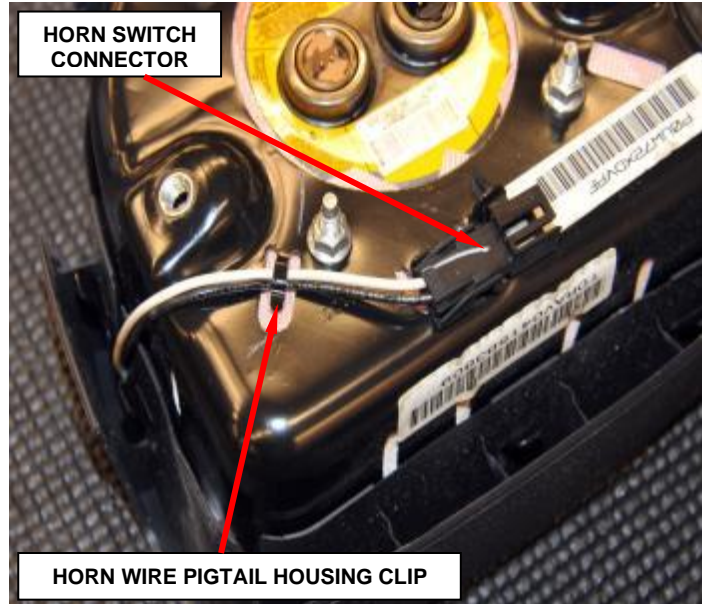


Figure 5 – Horn Connector

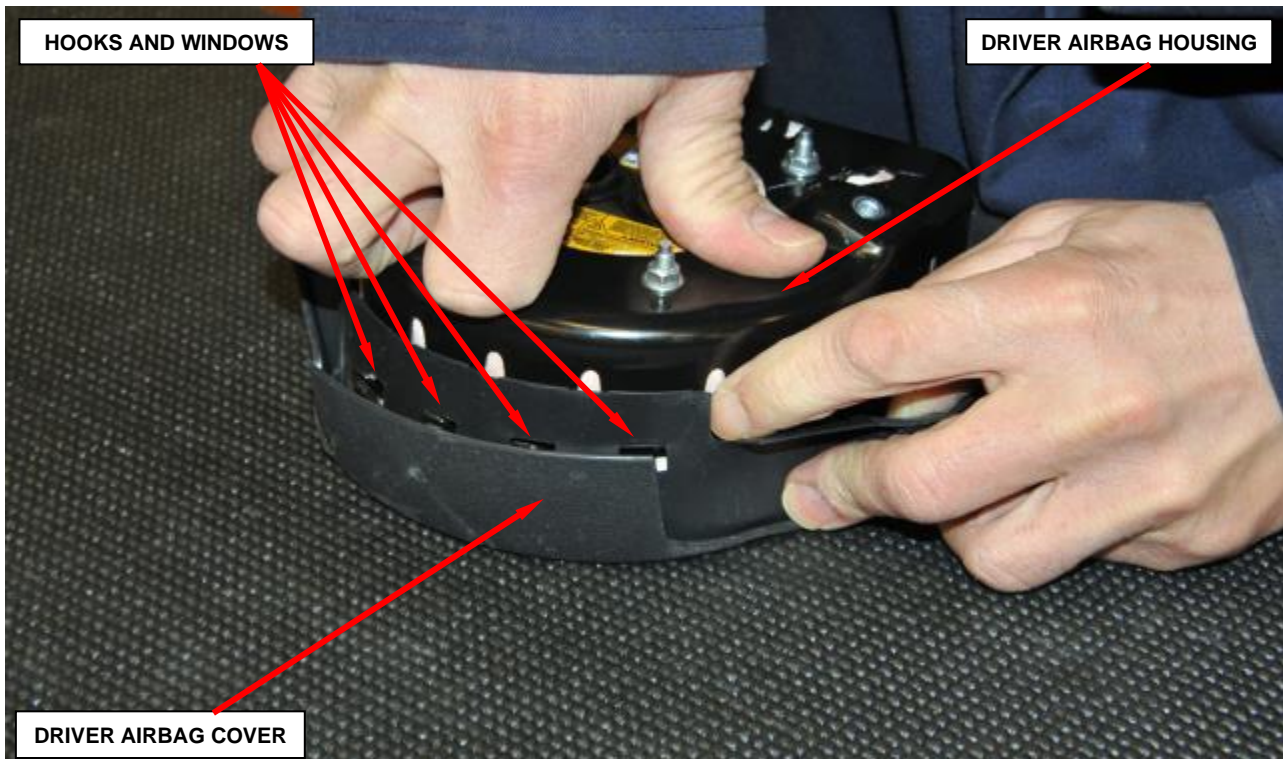


Figure 6 – Driver Airbag Cover

Service Procedure Continued

13. Unsnap the bottom hooks by pressing down on the housing until the hooks unsnap from the cover.
14. Unsnap the right side hooks by pressing down on the housing until the hooks unsnap from the cover.
15. Gently pull the housing up slowly making sure that the hooks are clear from the windows on all sides.
16. Disengage the old inflator assembly from the driver airbag cover and set aside for shipping.
17. Install the new inflator assembly to the original driver airbag cover by first inserting the top hooks into the windows (Figure 7).

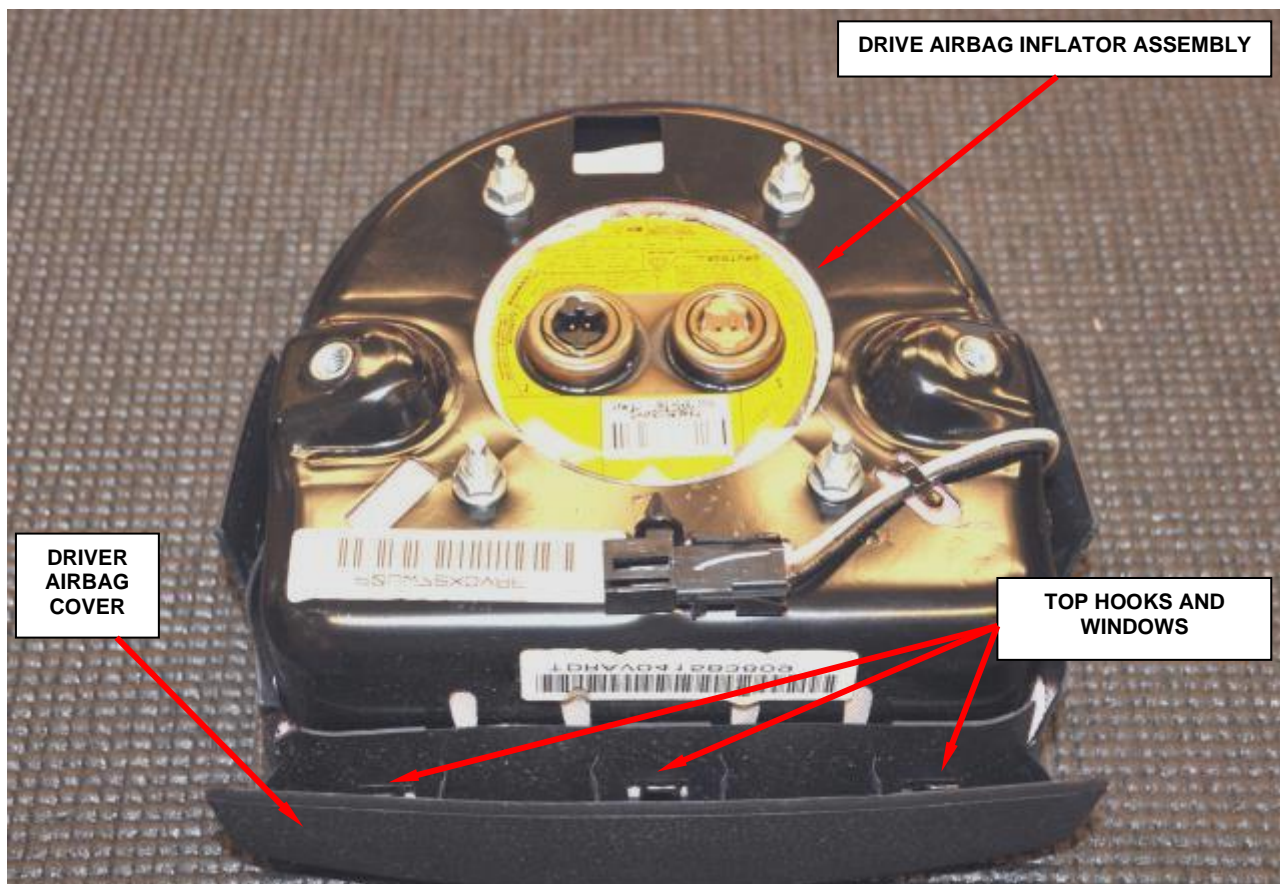


Figure 7 – Driver Airbag Inflator Assembly to Cover

Service Procedure Continued

18. Snap the remaining hooks in the windows on all sides into place.
19. Pull on the driver airbag inflator assembly to fully engage the hooks and windows on all sides of the driver airbag cover (Figure 8).

NOTE: Visually inspect and verify that all the hooks are fully engaged with the windows on all sides.

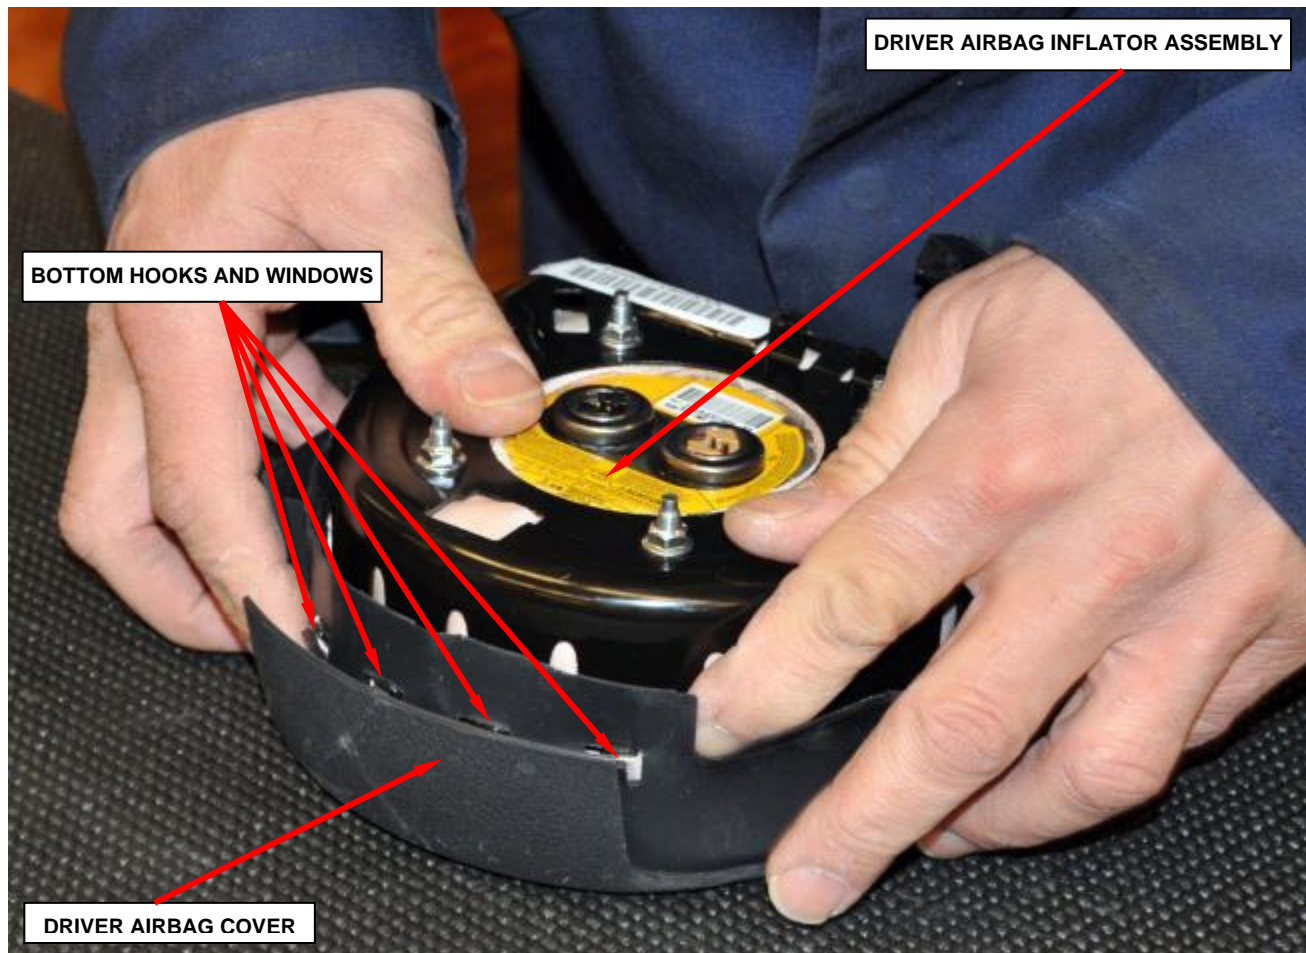


Figure 8 - Verify Hook and Window Engagement

Service Procedure Continued

20. Clip the horn switch connector to the driver airbag housing bracket (Figure 9).
21. Engage the horn switch wire harness pigtail to the driver airbag housing clip (Figure 9).
22. Driver airbag retrofit is complete (Figure 9).

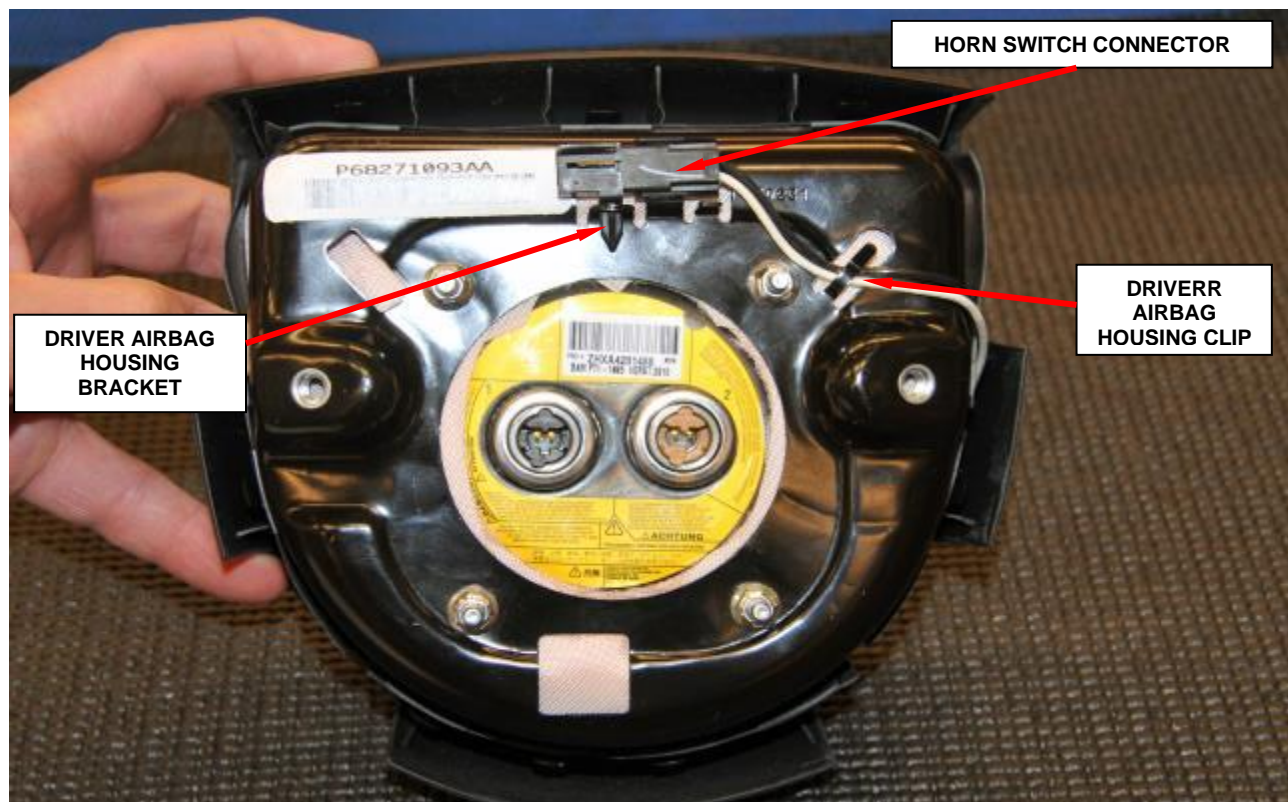


Figure 9 – Horn Switch Connector

Service Procedure Continued

23. Position the driver airbag to the steering wheel to connect the three electrical connections on the back of the airbag housing.
24. Connect the two driver airbag squib connectors to the airbag inflator connector receptacles by pressing straight in on the connector. Be certain to engage each keyed and color-coded connector to the matching connector receptacle. Be certain that each connector is fully engaged in its receptacle by listening carefully for a distinct, audible click as the connector latches snap into place (Figure 10).

NOTE: The squib connector receptacle locations on the driver airbag inflators are switched between the original Takata inflator and the TRW replacement inflator kits. Squib connectors are keyed and color coded for error proofing (Figure 2).

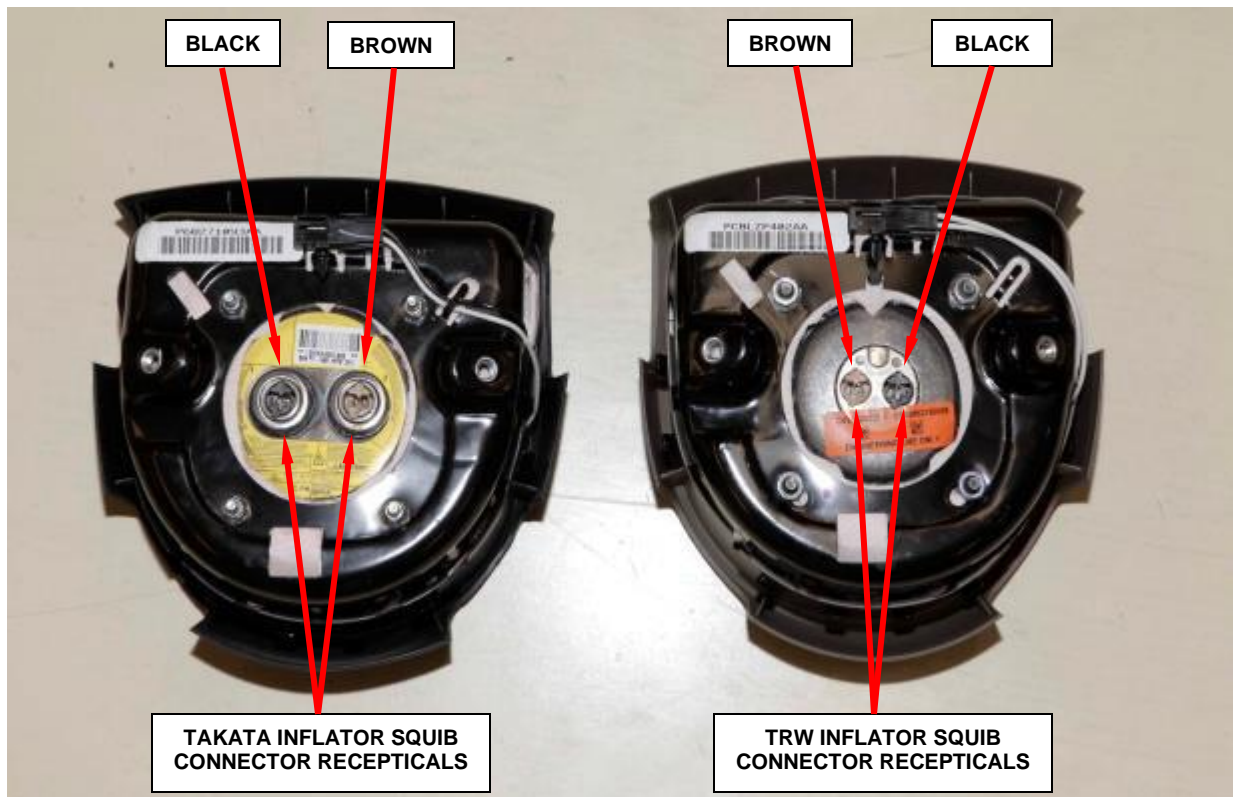


Figure 10 - Squib Connector Receptacles

Service Procedure Continued

25. Connect the steering wheel wire harness connector for the horn switch to the horn switch connector which is located on the back of the driver airbag housing and clip the wire harness pigtail to the housing (Figure 4).
26. Carefully position the driver airbag in the steering wheel. Be certain that the clockspring pigtail wires and the steering wheel wire harness in the steering wheel hub area are not pinched between the driver airbag and the steering wheel armature.
27. Install and tighten the two screws that secure the driver airbag assembly to the steering wheel armature. Tighten the screws to 90 in. lbs. (10 N·m) (Figure 1).
28. Continue with **Section B. Supplemental Restraint System (SRS) Verification Test.**

Service Procedure Continued**B. Supplemental Restraint System (SRS) Verification Test**

NOTE: During the following test, the negative battery cable remains disconnected and isolated during steps 1 and 2 of the Supplemental Restraint System (SRS) Verification Test.

NOTE: The wiTECH scan tool must be used to perform this recall. This procedure must be performed with software release level 15.04 or higher.

1. Connect the wiTECH VCI pod to the vehicle data link connector located under the steering column.
2. Turn the ignition switch to the “ON” position and exit the vehicle and close the doors.
3. Check to be certain that nobody is in the vehicle, then connect the battery negative cable(s).
4. Open the wiTECH Diagnostic application.
5. Starting at the “Select Tool” screen, select the row/tool for the wiPOD device you are using, then select “Next”.
6. Enter your “**User id**” and “**Password**”, then select “**Finish**”.

NOTE: If wiTECH is unable to identify the connected vehicle, click on the Launch DRB III button and use the DRB III Emulator tool.

7. Clear all DTC’s in all modules using either the wiTECH or the DRB III mode.

NOTE: Any active Diagnostic Trouble Codes (DTC’s) may require an additional key cycle from “ON” to “OFF” to change DTC status from “active” to “stored”.

Service Procedure Continued

8. Turn the ignition switch to the “OFF” position for about 15 seconds, and then back to the “ON” position. Observe the airbag indicator in the instrument cluster.
 - The airbag indicator in the instrument cluster should illuminate for six to eight seconds, and then go out. This indicates that the SRS is functioning normally and that the repairs are complete. Turn the ignition to the “OFF” position, remove the wiPOD and return the vehicle to the customer.
 - If the airbag indicator fails to light or the light and stays ON, there is still an active SRS fault or malfunction. Refer to the appropriate diagnostic information to diagnose the problem.
9. Close the hood, remove the wiTECH VCI pod.
10. Use the procedure on pages 4 and 5 to return the original inflator kit.
11. Return the vehicle to the customer.

Completion Reporting and Reimbursement

Claims for vehicles that have been serviced must be submitted on the DealerCONNECT Claim Entry Screen located on the Service tab. Claims submitted will be used by FCA US LLC to record recall service completions and provide dealer payments.

Use one of the following labor operation numbers and time allowances:

	Labor Operation Number	Time Allowance
Replace Driver Airbag Inflator and Conduct Supplemental Restraint System Verification Test	08-R3-71-82	0.5 hours

NOTE: See the Warranty Administration Manual, Recall Claim Processing Section, for complete recall claim processing instructions.

Dealer Notification

To view this notification on DealerCONNECT, select “Global Recall System” on the Service tab, then click on the description of this notification.

Owner Notification and Service Scheduling

All involved vehicle owners known to FCA US LLC are being notified of the service requirement by first class mail. They are requested to schedule appointments for this service with their dealers. A generic copy of the owner letter is attached.

Enclosed with each owner letter is an Owner Notification postcard to allow owners to update our records if applicable.

Vehicle Lists, Global Recall System, VIP and Dealer Follow Up

All involved vehicles have been entered into the DealerCONNECT Global Recall System (GRS) and Vehicle Information Plus (VIP) for dealer inquiry as needed.

GRS provides involved dealers with an updated VIN list of their incomplete vehicles. The owner's name, address and phone number are listed if known. Completed vehicles are removed from GRS within several days of repair claim submission.

To use this system, click on the “**Service**” tab and then click on “**Global Recall System.**” Your dealer's VIN list for each recall displayed can be sorted by: those vehicles that were unsold at recall launch, those with a phone number, city, zip code, or VIN sequence.

Dealers must perform this repair on all unsold vehicles before retail delivery. Dealers should also use the VIN list to follow up with all owners to schedule appointments for this repair.

Recall VIN lists may contain confidential, restricted owner name and address information that was obtained from the Department of Motor Vehicles of various states. Use of this information is permitted for this recall only and is strictly prohibited from all other use.

Additional Information

If you have any questions or need assistance in completing this action, please contact your Service and Parts District Manager.

Customer Services / Field Operations
FCA US LLC

IMPORTANT SAFETY RECALL

R37 / NHTSA 15V-444

This notice applies to your vehicle (VIN: xxxxxxxxxxxxxxxxxxxx).

This notification letter is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

Dear: (Name)

FCA US LLC has decided that a defect, which relates to motor vehicle safety, exists in certain **2008 through 2010 model year Dodge Challenger vehicles**.

The problem is... **The driver airbag inflator housing in your vehicle may rupture, due to excessive internal pressure, during normal airbag deployment events. This condition is more likely to occur if your vehicle has been exposed to high levels of absolute humidity for extended periods of time. The inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death.**

What your dealer will do... **FCA will repair your vehicle free of charge (parts and labor). To do this, your dealer will replace your driver airbag inflator. The work will take up to 1 hour to complete. However, additional time may be necessary depending on service schedules.**

What you must do to ensure your safety... **Simply contact your Chrysler, Jeep, Dodge or RAM dealer right away to schedule a service appointment. Ask the dealer to hold the parts for your vehicle or to order them before your appointment. Please bring this letter with you to your dealer.**

If you need help... **If you have questions or concerns which your dealer is unable to resolve, please contact the FCA Recall Assistance Center at 1-800-853-1403.**

Please help us update our records by filling out the attached prepaid postcard if any of the conditions listed on the card apply to you or your vehicle. If you have further questions go to **recalls.mopar.com**.

If you have already experienced this specific condition and have paid to have it repaired, you may visit **www.fcarecallreimbursement.com** to submit your reimbursement request online or you can mail your original receipts and proof of payment to the following address for reimbursement consideration: **FCA Customer Assistance, P.O. Box 21-8004, Auburn Hills, MI 48321-8007, Attention: Recall Reimbursement**. Once we receive and verify the required documents, reimbursement will be sent to you within 60 days. If you've had previous repairs and/or reimbursement you may still need to have the recall repair performed on your vehicle.

If your dealer fails or is unable to remedy this defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., S.E., Washington, DC 20590, or you can call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to **safecar.gov**.

We're sorry for any inconvenience, but we are sincerely concerned about your safety. Thank you for your attention to this important matter.

Customer Services / Field Operations
FCA US LLC

Note to lessors receiving this recall: Federal regulation requires that you forward this recall notice to the lessee within 10 days.