

Service Bulletin

15-060

June 23, 2016 02376 Version 3

Safety Recall: Ignition Coils

Supersedes 15-060, dated September 16, 2015, to revise the information highlighted in yellow.

AFFECTED VEHICLES

Year	Model	Trim	VIN Range	
2015	Fit	ALL	Check the iN VIN status for eligibility	

REVISION SUMMARY

Under BACKGROUND, a note was added for vehicles that come in with the MIL on that are eligible for this recall.

BACKGROUND

The noise suppression capacitors inside the ignition coils may degrade over time causing the MIL to come on, the engine or fuel injection system to malfunction, or in severe cases, the engine to stall.

NOTE: If the MIL is on with DTC P0300 (random misfire detected) or P0301–P0304 (cylinder misfire detected), refer to service bulletin 16-034, *MIL Comes On with DTC P0300, P0301, P0302, P0303, P0304,* and do that procedure first. Then, make sure you do this bulletin to complete the repair.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. These vehicles must be repaired before they are sold.

Should a dealership sell an unrepaired vehicle that subsequently causes an injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party, and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this campaign, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the four ignition coils and, if necessary, clean the spark plug connection ends.

PARTS INFORMATION

Part Name	Part Number	Quantity
Ignition Coil	30520-5R0-013	4

Page 1 of 3

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION


The normal warranty applies.

Operation	Description	Flat Rate	Defect	Symptom	Template	Failed Part
Number		Time	Code	Code	ID	Number
1175A2	Replace the ignition coils and if necessary, clean the spark plug connection end.	0.4 hr	5YW00	JT900	15-060A	30520-5R0-003


Skill Level: Repair Technician

REPAIR PROCEDURE


1. Disconnect the ignition coil connectors.

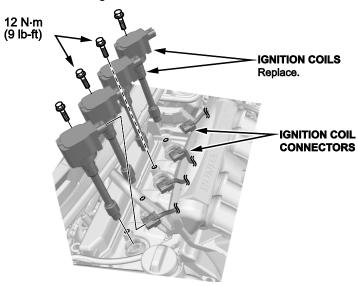

- 2. Remove the ignition coils.
- 3. Remove the spark plugs.

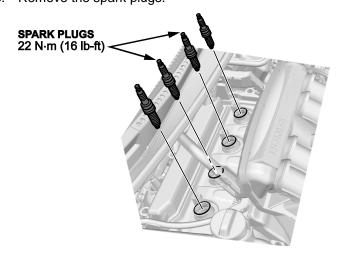

4. Inspect the connection end of the spark plugs.

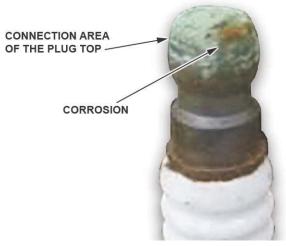

- If the spark plug connection ends have corrosion on them, clean them with a commercially available cleaner, then reinstall the spark plugs and torque them to 22 N·m (16 lb-ft).
- If the spark plug connection ends does not have any corrosion on them, reinstall the spark plugs and torque them to 22 N·m (16 lb-ft).
- 5. Install the new ignition coils and torque them to 12 N·m (9 lb-ft).
- California residents only: Fill out a Vehicle Emissions Recall Proof of Correction certificate, and use JT9 as the
 recall number. Give the certificate to your customer, and advise him or her to keep it as proof that the recall was
 completed. Your customer will need to submit this certificate to the DMV only if the DMV requests it. If you need
 more certificates, use reorder number Y0657.



END