Safety Recall **Code: 69M8**



		REVISION	
Subject	TAKATA PSDI-5 Driver Fronta	I Airbag Inflator	
Release Date	April 7, 2017		
Revision Summary	Updated Priority Group 5 repa	ir availability.	
Affected Vehicles		2006-2007 MY Volkswagen Passat Sedan & Passat Wagon s equipped with a Takata PSDI-5 driver frontal airbag	
	Check Campaigns/Actions screen in E action. Elsa is the <u>only</u> valid campaig	Elsa on the day of repair to verify that a VIN qualifies for repair under this n inquiry & verification source.	
	 ✓ Campaign status must show "open." ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at 		
		in the workshop for this campaign.	
Takata Recall Priority Groups and Repair Rollout	Third Amendment to the Coordin	ccording to the requirements mandated by the NHTSA in the nated Remedy Order. Transport Canada is following the same by this recall fall into the following priority groups established	
	Priority Group	Sufficient Supply & Remedy Launch Deadlines	
	Priority Group 4	Released for repair	
	Priority Group 5	Released for repair	
	Priority Group 6	September 30, 2017	
		NHTSA priority groups and the Takata recall can be found at ca/takata-recalls and www.tc.gc.ca/rappels-takata.	
Problem Description	propellant degradation occurrin temperature cycling) if the vehic to deploy. In the event of an in	driver frontal airbag inflator could potentially rupture (due to og after long-term exposure to absolute high humidity and le is involved in a crash where the frontal airbags are designed flator rupture, metal fragments could pass through the airbag ult in serious injury or death to vehicle occupants.	
Corrective Action	Replace the driver frontal airbag	inflator with a newly manufactured version.	
	information it has collected, that moisture are likely the root cau	Safety Administration (NHTSA) has concluded, based on the age of the inflator, temperature cycling, and environmental se of rupturing. Therefore, replacing the older inflator with a ety risk associated with the vehicle until a final remedy is	
Precautions	Takata airbag inflator is involved	inflator replaced as soon as possible. If a vehicle with a recalled d in a crash with airbag deployment, the inflator could rupture one in the vehicle. People have been killed and seriously injured	
	Owners are also advised to info this important information.	rm all other drivers and passengers of an affected vehicle about	
Critical Information		mited industry-wide and will continue to be so due to supplier d demand from all vehicle manufacturers.	

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2017 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. April 2017

- Due to limited industry supply and climate variances the NHTSA has created priority groups to help ensure the highest priority vehicles are remedied first. These factors are the age of the inflator (with older presenting a greater risk), geographic registered history of the vehicle (with prolonged exposure to high absolute humidity (Zone A) presenting a greater risk), and location of the Takata inflator in the vehicle.
- The NHTSA has created the priority groups based on testing, field experience, and research. Older inflators in vehicles that have experienced prolonged exposure to hot and humid conditions pose a much greater risk of rupturing. Accordingly, the NHTSA has ordered manufacturers to replace inflators in older vehicles that are most likely to have been exposed to prolonged hot and humid conditions first.
- Part allocations will be prioritized to ensure availability for customer vehicles that fall within the highest-risk locations for the priority groups.
- Dealers are expected to manage the limited allocations they receive carefully and schedule customers accordingly to ensure that the highest-risk customer vehicles are repaired promptly and without unreasonable delay.
- Due to limited parts supply and focus on highest-risk priority groups, dealers should not expect to keep stock on hand at all times. Rather, dealers should ensure their allocated parts are installed on the priority group vehicles that are released for repair.
- The chart below can be used to help identify which priority group is released for repair. The criteria for each VIN may be found in Elsa in the Campaigns/Actions screen. As new priority groups are released for repair, this will be updated. Please ensure that you are using the latest version of the circular available in Elsa.

Criteria (Priority Gr		Group)		
Criteria	Part Number	P4	P5	P6
N1	3C0 898 201 D	Released	Released	Restricted
T1	3C0 898 201 E	Released	Released	Restricted

Released - Perform repair without delay

Restricted – Advise customer that parts are not released for their priority group as defined by the NHTSA and may be available by the dates above in the Takata Recall Priority Groups and Repair Rollout section.

- Parts were allocated prior to campaign launch and repair availability for each priority group. You may not have received an allocation if your dealership was projected to not have affected vehicles in your area.
- Future replenishments/allocations will be based on paid SAGA claims for priority groups that have been released for repair with the respective part number. These replenishments/allocations are expected to be sent weekly.
- All SAGA claims will be stopped for review to ensure the appropriate priority level.
- Do not call a Parts Specialist to request additional parts. These requests cannot and will not be fulfilled.

Code Visibility On or about March 8, 2017, affected vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <u>www.vwhub.com</u> & OMD Web). A list will not be posted for dealers who do not have any affected vehicles.

On or about March 8, 2017, this campaign code will show open on affected vehicles in Elsa.

On or about March 8, 2017, affected vehicles will be identified with this campaign code in the VIN Lookup tool at <u>www.vw.com</u> and on the NHTSA VIN lookup tool at <u>www.safercar.gov</u>.

Owner Notification Owner notification will take place for vehicles in each priority group as shown in the chart below. Owner letter examples are included in this bulletin for your reference.

Priority Group	Sufficient Supply & Remedy Launch Deadlines
Priority Group 4	Completed
Priority Group 5	Completed
Priority Group 6	September 30, 2017

Additional Information Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.

IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS

<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.

<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.

Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u>.

Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. Labels can be ordered at no cost via the Compliance Label Ordering portal at www.vwhub.com.

Claim Entry Instructions

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action open on the day of repair to the repair order.

If customer refused campaign work:

- U.S. dealers: Submit the request through Audi Warranty Online under the Campaigns/Update option. √
- Canada dealers: Fax repair order to Warranty at (905) 428-4811. ✓

Service Number	69M8				
Damage Code	0099				
Parts Vendor Code	WWO				
Claim Type	Sold vehicle: 7	10			
	Unsold vehicle	: 7 90			
Causal Indicator	*Mark airbag ir	nflator kit as causal p	art		
Vehicle Wash/Loaner	Do not claim wash/loaner under this action				
Vehicles will have m	ehicles will have more than one criteria. Complete and claim all applicable criteria on <u>one</u> claim.				
Criteria I.D.	01, N1, P4 or				
	02, N1, P4 or				
	01, N1, P5 or				
	02, N1, P5				
	Install new airb Labor operatio		105 T.U.		
	Quantity	Part Number	Description		
	1.00	3C0898201D*	Airbag Inflator Kit Without Vibration Damper		
Criteria I.D.	01, T1, P4 or				
	02, T1, P4 or				
	01, T1, P5 or				
	02, T1, P5				
	Install new airb	ag inflator kit.			
	Labor operation	n: 6958 56 99	105 T.U.		
	Quantity	Part Number	Description		
	1.00	3C0898201E*	Airbag Inflator Kit With Vibration Damper		
Criteria I.D.	P6, 01, N1				
	P6, 02, T1				
	P6, 01, T1				
	Repair not rele	ased.			

This notice applies to your vehicle: <VIN>

NHTSA: 16V079

Subject:Safety Recall 69M8 - Takata PSDI-5 Driver Frontal Airbag Inflator

Certain 2006-2007 Model Year Volkswagen Passat Sedan & Passat Wagon Vehicles Equipped with a Takata PSDI-5 Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2006-2007 model year Volkswagen Passat Sedan & Passat Wagon vehicles equipped with a Takata PSDI-5 driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?	Takata has reported that the driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after long-term exposure to absolute high humidity and temperature cycling) if the vehicle is involved in a crash where the frontal airbags are designed to deploy. In the event of an inflator rupture, metal fragments could pass through the airbag cushion material, which may result in serious injury or death to vehicle occupants.	
What will we do?	To address this defect, your authorized Volkswagen dealer will replace the driver frontal airbag inflator with a newly manufactured version. This work will take about an hour to complete and will be performed for you free of charge. PRECAUTIONS YOU SHOULD TAKE	
	• <u>Do not delay in having this recall repair performed.</u> Make an appointment with your authorized dealer to have the recalled Takata airbag inflator in your vehicle replaced as soon as possible. If a vehicle with a recalled Takata airbag inflator is involved in a crash with airbag deployment, the inflator could rupture and send shrapnel toward everyone in the vehicle. People have been killed and seriously injured by this defect.	
	 If you are not the only driver of this vehicle, please advise all other drivers and passengers of this important information. 	
What should you do?	Please contact your authorized Volkswagen dealer without delay to schedule this recall repair. For your convenience, you can also visit <u>www.vw.com</u> and click on the "Owners" link to locate a dealer near you and schedule this service online.	
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.	
Can we assist you further?	If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, or if you should have any questions about this communication, please reach out to us using your preferred method of communication at www.vw.com/contact or by calling 1 800-893-5298. Our phone team is available Monday through Friday from 8AM to 10PM EST and Saturday from 9AM to 5PM EST.	
Checking your vehicle for open Recalls and Service Campaigns	To check your vehicle's eligibility for repair under this or any other recall/service campaign, please click on the <i>Look Up Recalls</i> link at <u>www.vw.com</u> and enter your Vehicle Identification Number (VIN) into the <i>Recall/Service Campaign Lookup</i> tool.	

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <u>http://www.safercar.gov</u>.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

Customer Letter Example (CANADA)

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 69M8 - Takata PSDI-5 Driver Frontal Airbag Inflator

Certain 2006-2007 Model Year Volkswagen Passat Sedan & Passat Wagon Vehicles Equipped with a Takata PSDI-5 Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2006-2007 model year Volkswagen Passat Sedan & Passat Wagon vehicles equipped with a Takata PSDI-5 driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

- What is the issue? Takata has reported that the driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after long-term exposure to absolute high humidity and temperature cycling) if the vehicle is involved in a crash where the frontal airbags are designed to deploy. In the event of an inflator rupture, metal fragments could pass through the airbag cushion material, which may result in serious injury or death to vehicle occupants.
- What will we do? To address this defect, your authorized Volkswagen dealer will replace the driver frontal airbag inflator with a newly manufactured version. This work will take about an hour to complete and will be performed for you free of charge.

PRECAUTIONS YOU SHOULD TAKE

Do not delay in having this recall repair performed. Make an appointment with your authorized dealer to have the recalled Takata airbag inflator in your vehicle replaced as soon as possible. If a vehicle with a recalled Takata airbag inflator is involved in a crash with airbag deployment, the inflator could rupture and send shrapnel toward everyone in the vehicle. People have been killed and seriously injured by this defect. If you are not the only driver of this vehicle, please advise all other drivers and passengers of this important information. What should you do? Please contact your authorized Volkswagen dealer without delay to schedule this recall repair. Lease vehicles and If you are the lessor and registered owner of the vehicle identified in this action, the law address changes requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records. Can we assist you If your authorized Volkswagen dealer fails or is unable to complete this work free of further? charge within a reasonable time, please contact Customer Relations, Monday through Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us" page at www.vw.ca.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

- Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document. •
- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after long-term exposure to absolute high humidity and temperature cycling. In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.

Required Parts

<u>Criteria</u>	<u>Quantity</u>	Part Number	Part Description
N1	1	3C0898201D	Airbag Inflator Kit Without Vibration Damper
T1	1	3C0898201E	Airbag Inflator Kit With Vibration Damper

All inflator kits include inflator, inflator nuts, horn ring bolts, one replacement horn ring spring and return instructions


Required Safety Equipment



Ear Protection (locally sourced)



Required Tools

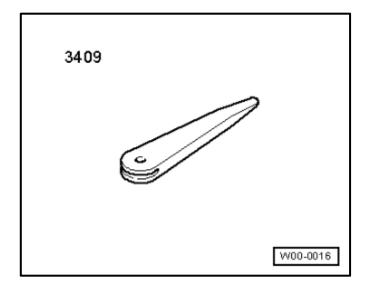

Face Shield (locally sourced)

• Trim Removal Wedge – 3409 (or equivalent)







• ESD Worksurface - VAS 6613

• Bar Code Scanner – VAS6161/1

• Airbag Support - T10568





Lever - T10571

• VAS6150D - Diagnostic Tester (or equivalent)



Required Work Environment

Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.

INOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.



- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2017 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. April 2017

VAG1410 - Torque Wrench (or equivalent)

Repair Instruction

Section A - Check for Previous Repair

i TIP

If Campaign Completion label is present, no further work is required.



• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B


Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.

repair.



https://vwcup.track360.com/?p=vwiqCertification&id=11288

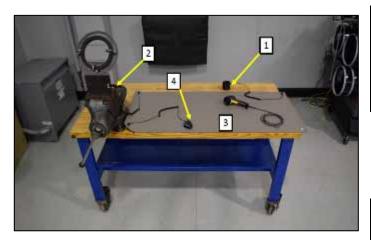


\bigcirc NOTE

Prior to beginning work, all parts and tools are to be placed on the ESD table mat.

Use the QR code or the link to view a video detailing the repair process prior to performing the

- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3, • and 4>.
- Plug ESD workplace into a wall socket using plug • <1>.

The wall socket or extension cord must have a sufficient ground.

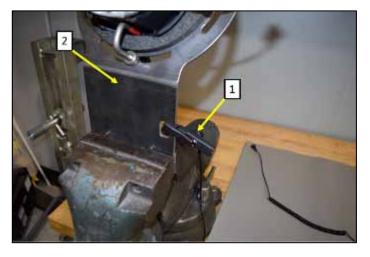



- Clamp Airbag Support T10568 <2> into the vice.
- Connect crocodile clip <1> to airbag support <2> and ESD workplace -VAS 6613-.


- Ensure ODIS is updated to the latest version.
- Connect vehicle diagnostic tester.
- Select Start Diagnosis function and identify vehicle.
- After identification of control units, Guided Fault Finding is started automatically.
- Follow the instructions on screen.


mporter: Jealer: IO:	444 03999 	VIN: Engine:	CCTA 2.0 L Motronic/147kW	🥔 🛃 📎 0	
ontroi modu	les Orders DISS TSB Test plan Oper	ation Special Functions			080
ests for the	entire vehicle				-6 Int
Status	Tests				Measurement
-	Showroom mode				
	Special actions				inte 🖉
-	Adapt Mechatronics software				Admin 😧
		til mind (DOM)		E.	
1250	Adapt SW for pwr. supply sys. ctrl. mod. (BCM)				Log
	Adapt akbag software				Data
-	Adapt software steering wheel e	lectronics		1.1	
	Adapt software, diesel, exhaust	EA189 action 23Q3			Extras
-	Production status documentatio	n part number on the replacement	airbag moduleigas generator 🛛 🥌 👘		Help
-	Reset the assembly sate test/D	C memory			🕑 Onine Help
	Software version management				🐉 Support
1		H		1. 7	
^l orform test	Display documents			A Your device	e is ready to use
e e) at 🛪 🕅 🗲 1041

In operating mode <u>Special Functions</u>, Select "**Production status documentation part number on the replacement airbag module/gas generator**" <a row >. ٠

moorten	444	VIN				
Deales: RO:	03999	Engine:	CCTA 2.0 L Motronio/147kW			ren .
a verse till deller af the	- 18 AV	Operation Science Foreneities			Operating modes *	
Airbag ABD	dare de la como			Complete/Cordinue	S Glagnosis	1
NOTE:				COLUMN A STATISTICS	() · · · · · · · · · · · · · · · · · · ·	
	sts you with the back documen	ntation of the part number of the new g	as generator/airbag module for the		Cartine 1	
airbag system.					A Measurement	=
	anned value with the value	shows the bar code on			😫 Info	-
the gas generato	or or between the asterisks there be a discrepancy in the	("") on the airbag			S Anna	
- correct the valu - configure the s	ue manually in the input field canner after the completion r code from the description	n of the program with			Log *	
ule ald of the bal	Code iron the description				Data *	5
					Current View	1
					3 Print	
					Diagnostic Session	
					RL North	
	K	< > >	Holo Cancel test		>	3
a e c		78 - 201 W			N	States


- Scanning the bar code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating bar code may not have to be done every time (only when the scanner requires calibration). You will know if the scanner needs calibrating if the scanner does not scan the inflator's bar code.
- If the inflator bar code cannot be scanned, then print out the barcode shown below and scan the printout.

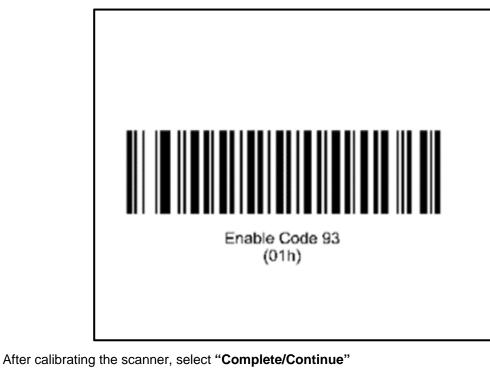

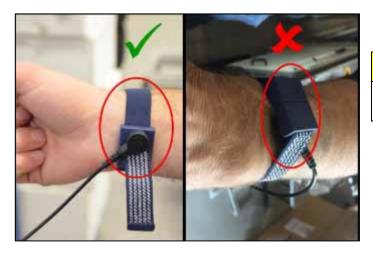

• Put the wrist strap from the ESD workplace on your wrist.

The white dots on the wrist strap must be against the skin.

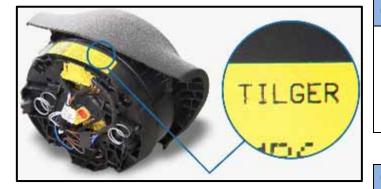

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be identified by the word "TILGER" on the label found on the airbag.

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.



- Place the new inflator on the ESD mat. •
- Scan the bar code of the new inflator at a distance • of about 15 cm.

ACAUTION

Ensure the correct inflator bar code is scanned at this time.

<u>Criteria</u>	Part Number
N1	3C0898201D
T1	3C0898201E

ronic/147kW	Accept	Operating modes *
	Accept	Operating modes *
	Accept	Clagnosis Clagnosis Chi Chi Chi Chi Measurement Chi Measurement Chi Chi Chi Chi Chi Chi Chi Chi Chi Chi
	Accept	Image: Second
	Accept	Contraction Contraction Contraction Contraction Contraction
		Ca Weasurement
		info Gift Somin (
		Quintan (
		Log *
		Data *
		Current View
		Diagnostic Session
		(Base)
		1 (B) (mare
anceltest		> 2 0
	- 5 8 8	250 PM
ept"		
	ence tess	+ 5/6 O


- If there is a discrepancy, manually enter the value from the new inflator in the input field.
- If no value appears, recalibrate the scanner.

mporter: Dealer: KO:	444 03999	VIN: Engine:	CCTA 2.0 L Motronic/147KW	🛫 🛃 📎		107-018 T
onicentidates (0)	DISS TSB	Operation			Operating modes	
Airbag ABD				-1-	Diagnosis	
Driver/front passen	gerside			.2.	100 C	
On which side was	the gas generator replaced?		×	-9-	C fuils	
1. Driver side 2. Front passenger	cide.				A Measurement	=
3. Back 1. Cancel	sue		1	-4.	😝 Info	(
					(Q.Sum)	
					Log ¥	
					Data A	
					Current View	
					Diagnostic Session	
					CB-0mb	
					B. train	-
4 R	K	< > >	Help Cancel test		> 0	51

After selecting option 1, a valid GeKo ID will need to be entered in order to upload the new inflator identification.

Continue to Section C.

Section C – Battery Disconnect

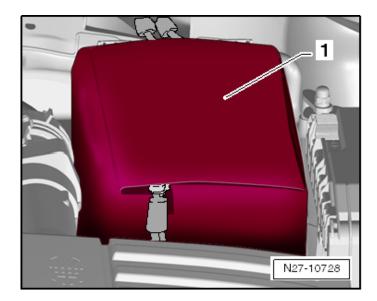

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

I NOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.


ACAUTION

Reclining the driver seat before disconnecting the battery allows for additional safety in the event


Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

- Open the battery protective covering <1>.
- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.

Continue to Section D.

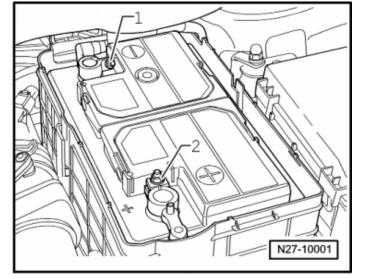


Section D – Airbag Removal

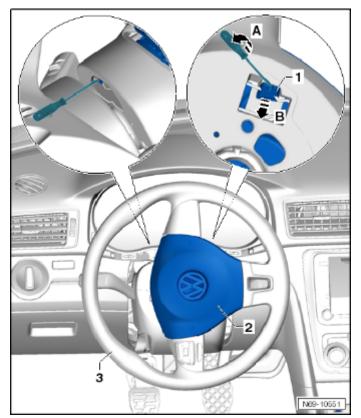

Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

- Lower the steering wheel <3> as far as possible.
- Adjust steering wheel depth (reach) <3> so it is in the fully extended position.
- Turn the steering wheel <3> to the position illustrated.
- Insert a screwdriver all the way into the hole on the back of the steering wheel (approximately 8 mm).
- Turn the screwdriver toward the driver door <arrow A>. This will unlock the airbag unit <2> locking mechanism <1> in direction of <arrow>, on the right side of the steering wheel.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

The screwdriver previously mentioned should be about 175 mm long and have a blade width of 7 mm.

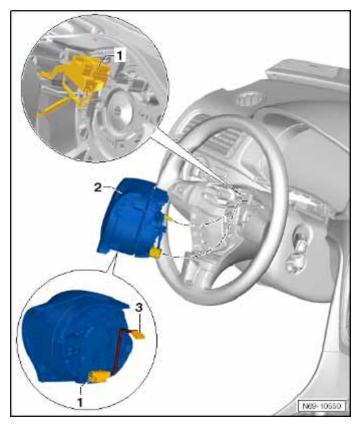

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Turn the steering wheel back to its center position.
- Remove the airbag unit <2> from the steering wheel.
- Release the connector lock on the airbag connector <1> and remove it.
- Disconnect the connector <3> (if equipped).

WARNING

Set the airbag down so the logo on the impact cushion faces upward.

Section E – Inflator Replacement


Risk of injury.


- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.

Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.



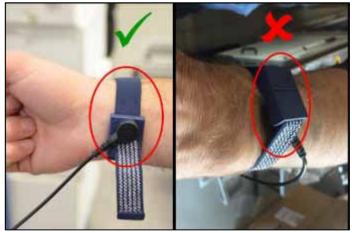

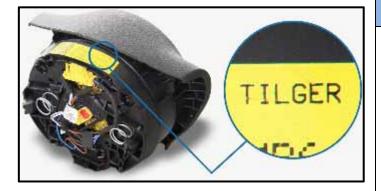

NOTE

- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

Put the wrist strap from the ESD workplace on your wrist.


A CAUTION


The white dots on the wrist strap must be against the skin.

$(\mathbf{)}$ NOTE

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- If the version "with vibration absorption" is installed, this can be identified by "TILGER" (vibration damper) on the label of the airbag module.
- If the version "without vibration absorption" is • installed, there is NO lettering on the label of the airbag module
- Identify inflator version by criteria and proceed to • the proper subsection.
 - Criteria N1: Renewing inflator, four 0 spoke steering wheel, without vibration absorption: Proceed to Subsection 1.
 - o Criteria T1: Renewing inflator, four spoke steering wheel, with vibration absorption: Proceed to Subsection 2.

Subsection 1 - Renewing inflator, four spoke steering wheel, without vibration absorption

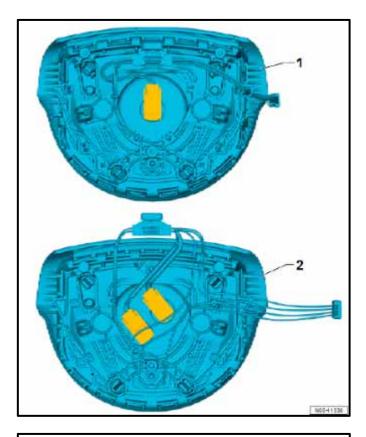

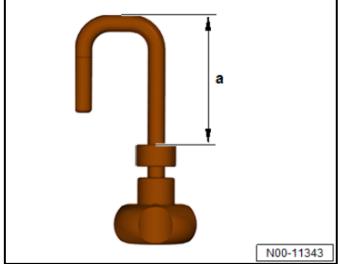


Removal Procedure:

INOTE


The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.

- The four spoke steering wheel has two mounting • points.
- Tighten mounting by hand to prevent damage. •
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

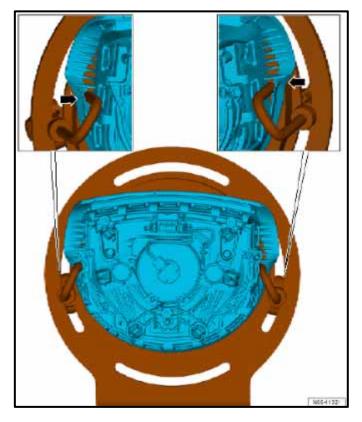



• Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel opposite each other.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

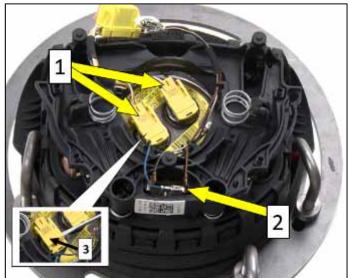


- Remove connector(s) <1> using a small flat bladed screwdriver to disengage connector lock <3>.
- Remove ground cable <2>.

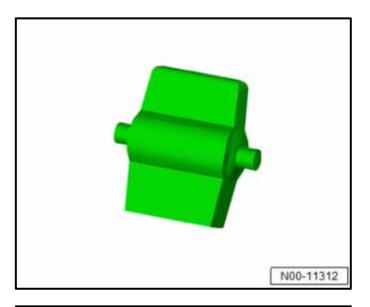

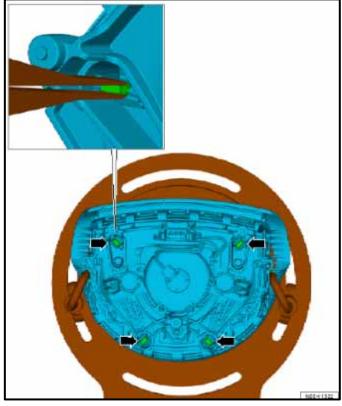

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

Remove locking pins <arrows> for horn ring with • aid of longnose pliers.

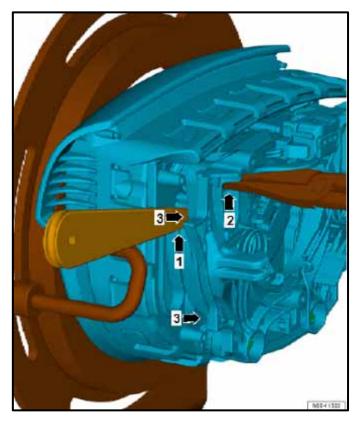




Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side. •

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

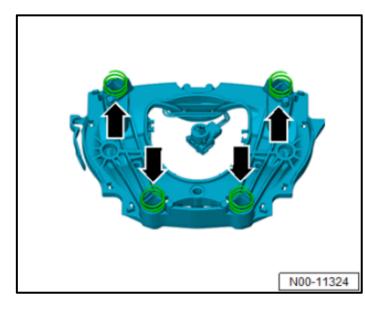



Remove horn ring with springs <arrows>.

ACAUTION

- When removing the horn ring, take care that the • springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator • kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the • airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>. •
- Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.

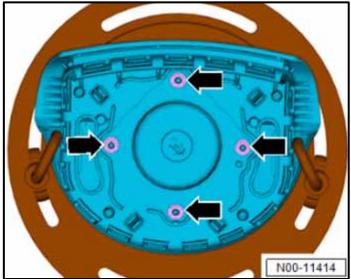

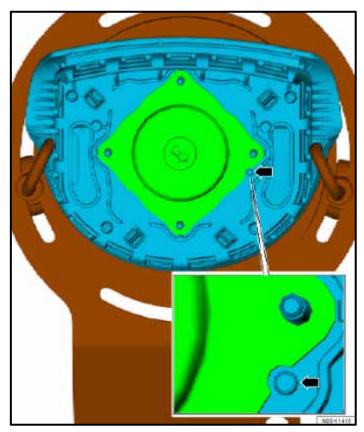

Installation Procedure:


• Insert new inflator and check to ensure it is seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N1	3C0898201D

INOTE


In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption (part # 3C0898201E) MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator (part # 3C0898201E) from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption (Criteria T1)" instructions.

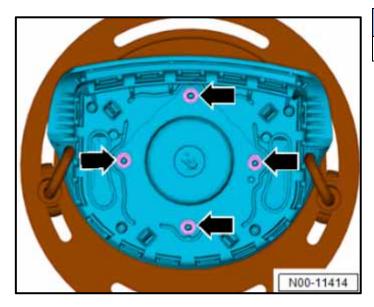

The nuts are self-locking and must be replaced

Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

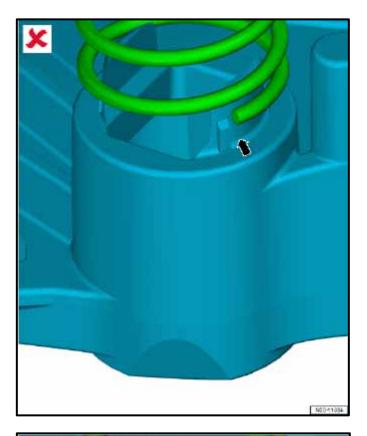



- If one of the springs is damaged or has been lost, • it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>. •

- Spring seated correctly <arrow>.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2017 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. April 2017 69M8 Page 29 of 43


N00-11353

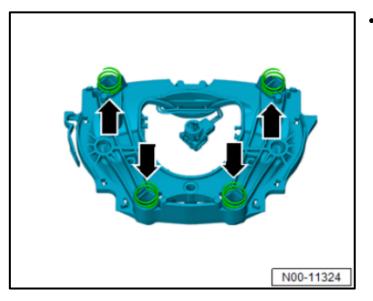

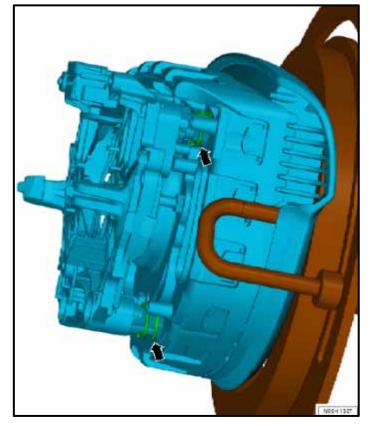

Fit springs <arrows> for horn ring again if necessary.

• Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

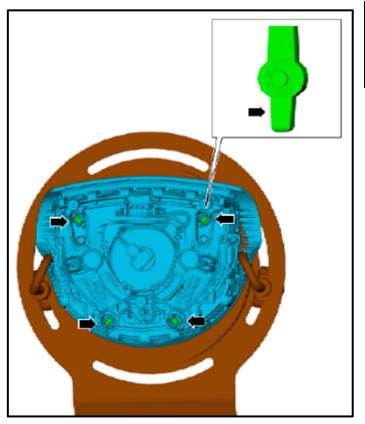


INOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.


- Connect central connector(s) <1> on inflator.
- Press central connector lock(s) in until fully locked. •
- Connect ground cable <2>. •


Continue to Section F.

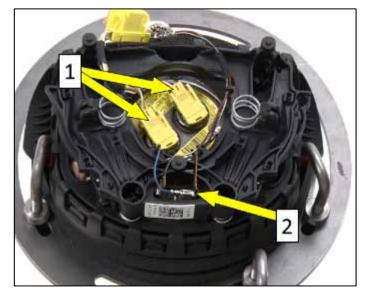

Subsection 2 – Renewing inflator, four spoke steering wheel, with vibration absorption

Removal Procedure:

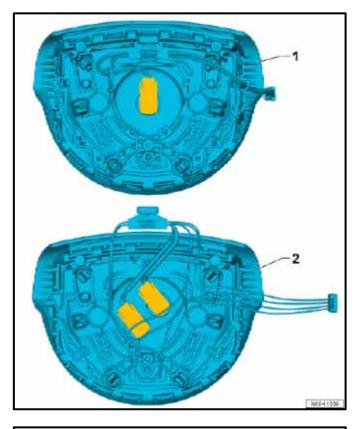


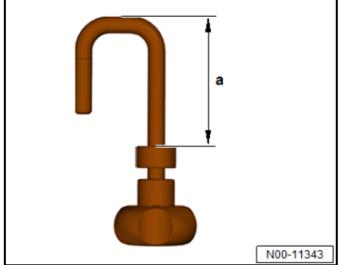

INOTE


- The inflator comes as a single-stage <1> or • two-stage <2> version. The work steps for inflator renewal are the same.
- Tighten mounting by hand to prevent • damage.

- The four spoke steering wheel has two mounting • points.
- Tighten mounting by hand to prevent damage. •
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

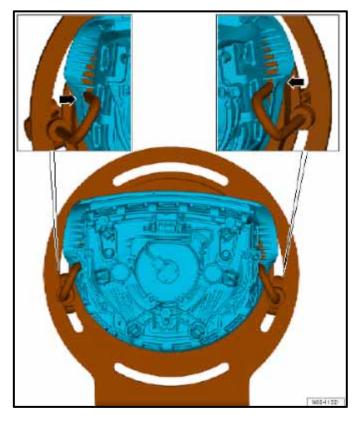



 Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel opposite each other.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

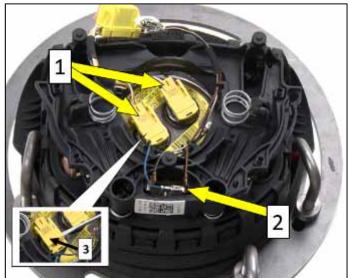


- Remove connector(s) <1> using a small flat bladed screwdriver to disengage connector lock <3>.
- Remove ground cable <2>.

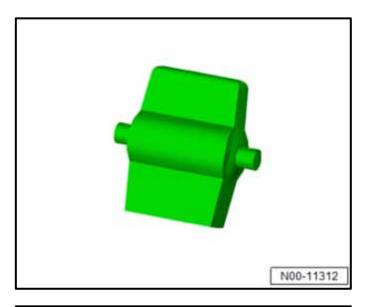

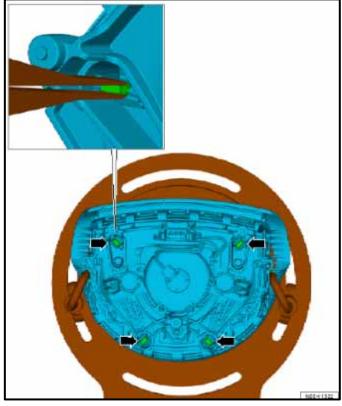

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

Remove locking pins <arrows> for horn ring with • aid of longnose pliers.

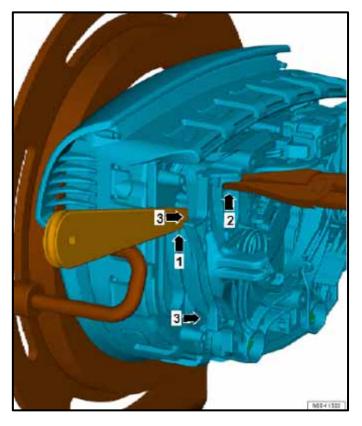




Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side. •

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

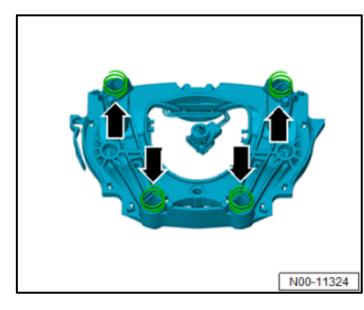



Remove horn ring with springs <arrows>.


ACAUTION

- When removing the horn ring, take care that the • springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator • kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the • airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>. •
- Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.

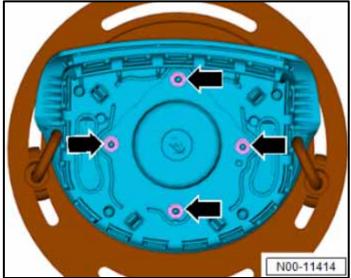

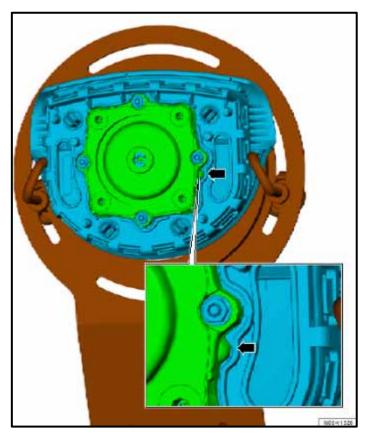

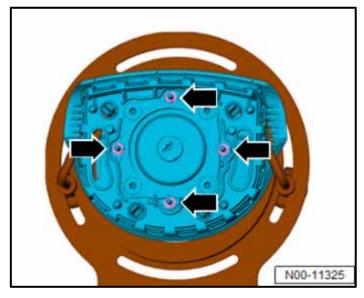


Installation Procedure:

Insert new inflator and check to ensure it is • seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
T1	3C0898201E

The nuts are self-locking and must be replaced

• Install new nuts <arrows> and torque to 5 Nm \pm 0.4 Nm.

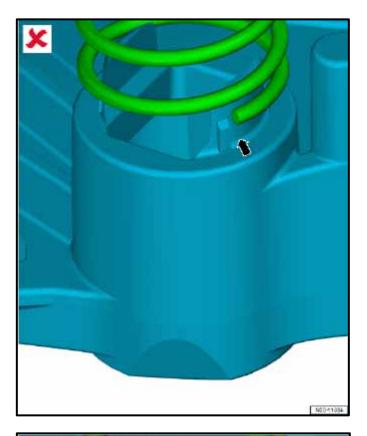



- If one of the springs is damaged or has been lost, • it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>. •

- Spring seated correctly <arrow>.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2017 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. April 2017 69M8 Page 38 of 43


N00-11353

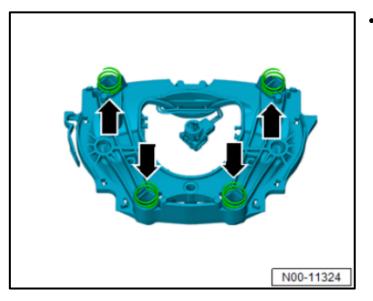

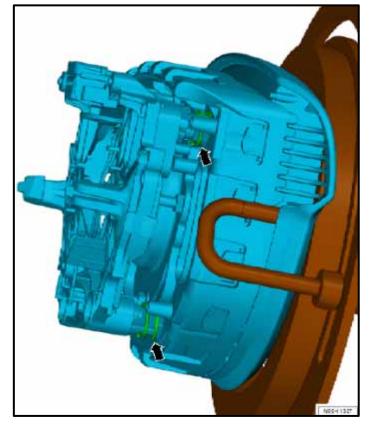

Fit springs <arrows> for horn ring again if necessary.

• Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

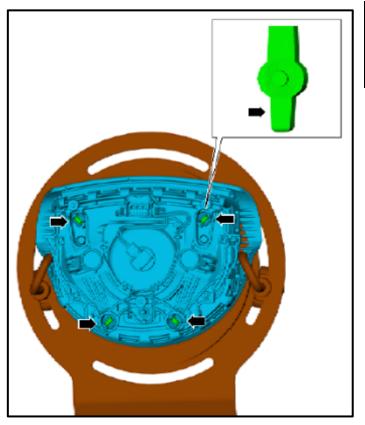

INOTE


If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.




- Press central connector lock(s) in until fully locked. •
- Connect ground cable <2>. •

Continue to Section F.

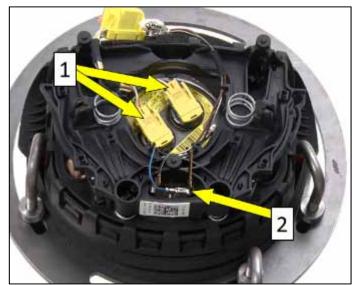


Section F – Airbag Installation

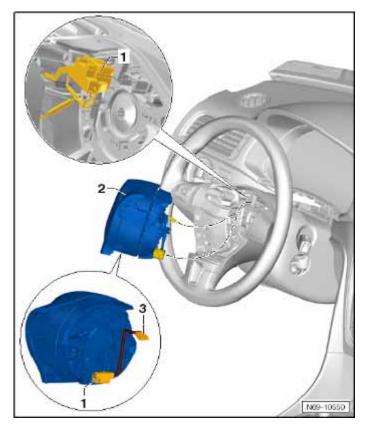

- The battery must be disconnected before • installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the connector <1>. The connector must click into place during this.
- Press the connector lock on the connector <1>.
- Connect the connector <3> (if equipped).
- Insert the airbag unit <2> into the steering wheel but do not press on it.

I NOTE

Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

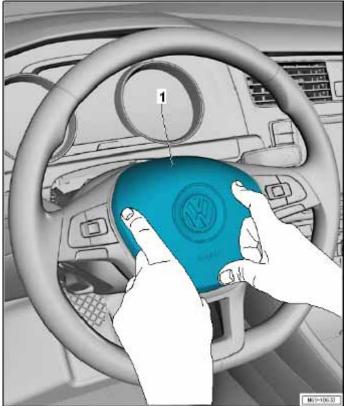


- Press on the edge of the airbag unit <1> with both . hands until it locks into place.
- Gently pull on the airbag unit to make sure the airbag unit is secured correctly at all three attachment points in the steering wheel.

Continue to Section G.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2017 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. April 2017 69M8 Page 41 of 43

Section G – Battery Reconnect

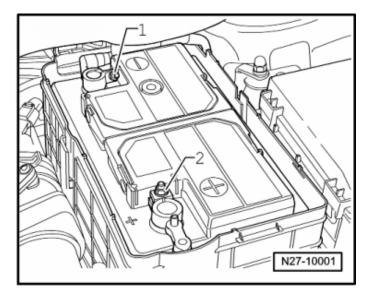

Ignition must be ON when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 15 to 20 km/h. This activates Steering Angle Sensor -G85-.

- Close the cover <1>.
- Cycle the ignition off and back on. •
- Bring driver seat to an upright position.
- Store previously recorded radio presets (if • necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.

Proceed to Section H.



Section H – Campaign Completion Label

Install Campaign Completion Label

Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.

Ensure Campaign Completion Label does not cover any existing label(s).


Appendix A – Warning and Safety Precautions

General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a . replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing • and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground • strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system.
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury. •
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the . electrical connector. This can be done by touching grounded metal objects such as the door striker pin.
- Install pyrotechnic components immediately after removing them from their transport packaging. If you must . stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products. •
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

Appendix B – Mandatory Takata Inflator Return Process

- Properly store (retain) removed parts in accordance with all state/province, local requirements.
- Questions regarding the return process should be directed to the contacts listed on the included return instructions.
- Additional instructions are located in the attachments in Elsa and ServiceNet.

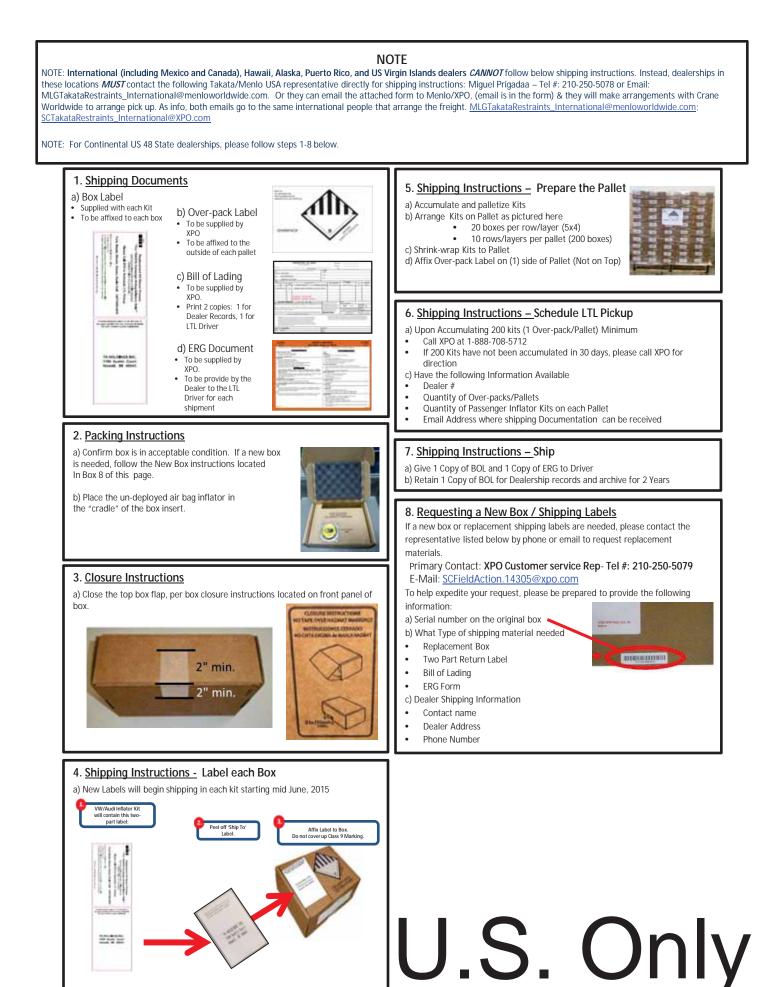

Crane Worldwide Logistics will arrange pick-up of all return Takata product. Dealers MUST follow directions on attached sign up form and pick-up request instructions. If you have any issues, questions or require additional information regarding Canadian Dealers - Do Not Contact XPO shipping, contact the following Takata/Menlo USA representative directly: Doreen Daigle, Campaign Specialist Tel number: (905) 428-4601 Miguel Prigadaa Tel number: 210-250-5078 E-mail: Email: MLGTakataRestraints_International@menloworldwide.com NOTE: For reference purposes only, see steps 1-8 below. **1. Shipping Documents** 5. Shipping Instructions – Prepare the Pallet a) Over-pack Label a) Accumulate and palletize Kits To be supplied b) Arrange Kits on Pallet as pictured here by carrier 20 boxes per row/layer (5x4) To be affixed to the 10 rows/layers per pallet (200 boxes max) outside of each c) Shrink-wrap Kits to Pallet pallet d) Affix Over-pack Label on (1) side of Pallet (Not on Top) e) Kits cannot be shipped in a master carton. If not enough b) Bill of Lading (BOL) to palletize, kits can be returned in their individual To be supplied Boxes with dangerous goods markings visible. Select "via by carrier Print 2 copies: 1 for small package" when shipping individually Dealer Records, 1 for truck Driver 6. Shipping Instructions – Schedule LTL Pickup c) ERG Document To be supplied by carrier a) Upon Accumulating 200 kits (1 Over-pack/Pallet) or 30 days since last To be provided by shipment: the Dealer to the Follow request instructions on pick-up truck Driver for each shipment b) Have the following Information Available Dealer Number Quantity of Over-pack Pallets(200) or individual boxes Quantity of Passenger Inflator Kits on each Over-Pack Pallet 2. Packing Instructions Email Address where shipping Documentation can be received a) Confirm box is in acceptable condition. b) Place the un-deployed air bag inflator in 7. Shipping Instructions - Ship the "cradle" of the box insert. a) Give 1 Copy of BOL and ERG to driver b) Retain 1 Copy of BOL for Dealership records and archive for 2 Years 8. Requesting a New Box / Shipping Labels If a new box or replacement shipping labels are needed, please email to request replacement materials. 3. Closure Instructions E-Mail: MLGTakataRestraints_International@menloworldwide.com To help expedite your request, provide the following information: a) Close the top box flap, per box closure instructions located on front panel of box. a) Serial number on the original box b) What Type of shipping material needed Replacement Box 2" min. Two Part Return Label -* if included This picture may appear different on the box 2" min. c) Dealer Shipping Information Contact name Dealer Address Phone Number 4. Shipping Instructions - Label each Box a) This step is only necessary if label is included in box. CANADIAN DEALER DO NOT CONTACT XPO el off 'Ship To VW/Audi Inflator Kit will co this two-part label: Affix Label to Box. Do not cover up Class 9 Markin Do not ship with label inside the box Label on the box will vary as per country of origin Please file all tracking documents Canadian Dealers - Do not contact XPO as noted on label Contact your Campaign Specialist

NOTE