



Revised June 2016

Dealer Service Instructions for:

Safety Recall S38 / NHTSA 16V-287

Left Front Halfshaft

NOTE: Revised callout locations on Figure 6. Revised NOTE on page 6.

Models

2016 (KL) Jeep® Cherokee

NOTE: This recall applies only to the above vehicles equipped with a 3.2L gas engine (sales code EHK), a 2.0L diesel engine (sales code EBS) or a 2.2L diesel engine (sales code EBV) built from September 30, 2015 through October 02, 2015 (MDH 093019 through 100214).

IMPORTANT: Some of the involved vehicles may be in dealer new vehicle inventory. Federal law requires you to complete this recall service on these vehicles before retail delivery. Dealers should also consider this requirement to apply to used vehicle inventory and should perform this recall on vehicles in for service. Involved vehicles can be determined by using the VIP inquiry process.

Subject

The left front halfshaft on about 50 of the above vehicles may not have been heat treated properly during the manufacturing process. An improperly heat treated left halfshaft could fracture without warning. A fractured left halfshaft could damage underbody components and cause a crash without warning.

Repair

The left front halfshaft must be replaced.

Parts Information

<u>Part Number</u>	<u>Description</u>
68238842AB	Halfshaft, Left
06507676AA	Nut, Lower Ball Joint
06509898AA	Nut, Hub Nut

Due to the small number of involved vehicles, no parts will be distributed initially. Dealers should order the halfshaft for each vehicle at the time appointments are scheduled to assure that the part is available when the customer arrives.

Parts Return

No parts return required for this campaign.

Special Tools

The following special tool is required to perform this repair:

- C-4150A Press, Ball Joint
- 10287 Front Hub Staking

Service Procedure**Replace Left Front Halfshaft**

NOTE: Never handle the halfshaft assembly by the inner or outer boots. This can cause damage to the boot, which will allow contaminants to enter the Constant Velocity (CV) joint.

NOTE: The inner tripod joint is designed with a retention feature that prevents the tripod rollers from coming out of the inner joint housing up to a specific load. If this feature is overcome and the rollers are pulled past the retention feature the joint will lock up and no longer function properly. The entire halfshaft assembly must be replaced if this occurs.

1. Raise and support the vehicle.

2. Remove the left front tire and wheel assembly.

3. Using a suitable punch, lift the two staked areas in the hub nut to avoid damaging the halfshaft (Figure 1).

4. While a helper applies the brakes to keep the hub from rotating, remove and **discard** the hub nut from the halfshaft. **The original hub nut is not reusable (Figure 1).**

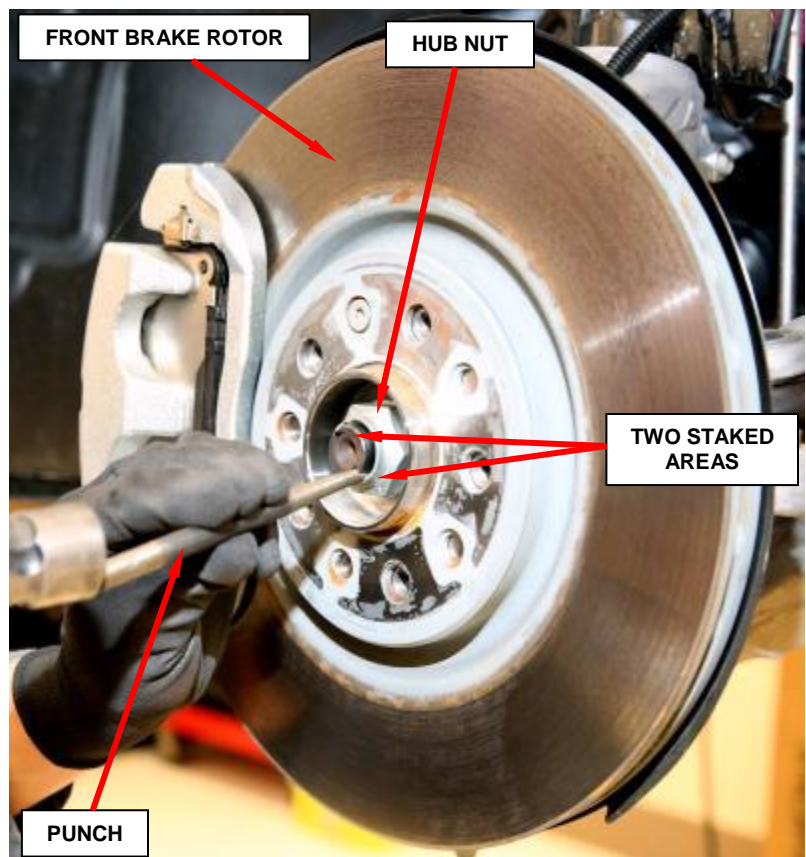


Figure 1 – Hub Nut

Service Procedure (Continued)

5. Remove and save the nine engine belly pan fasteners and remove the belly pan, if equipped (Figure 2).

NOTE: Use care when separating the ball joint stud from the knuckle so the ball joint boot does not get cut.

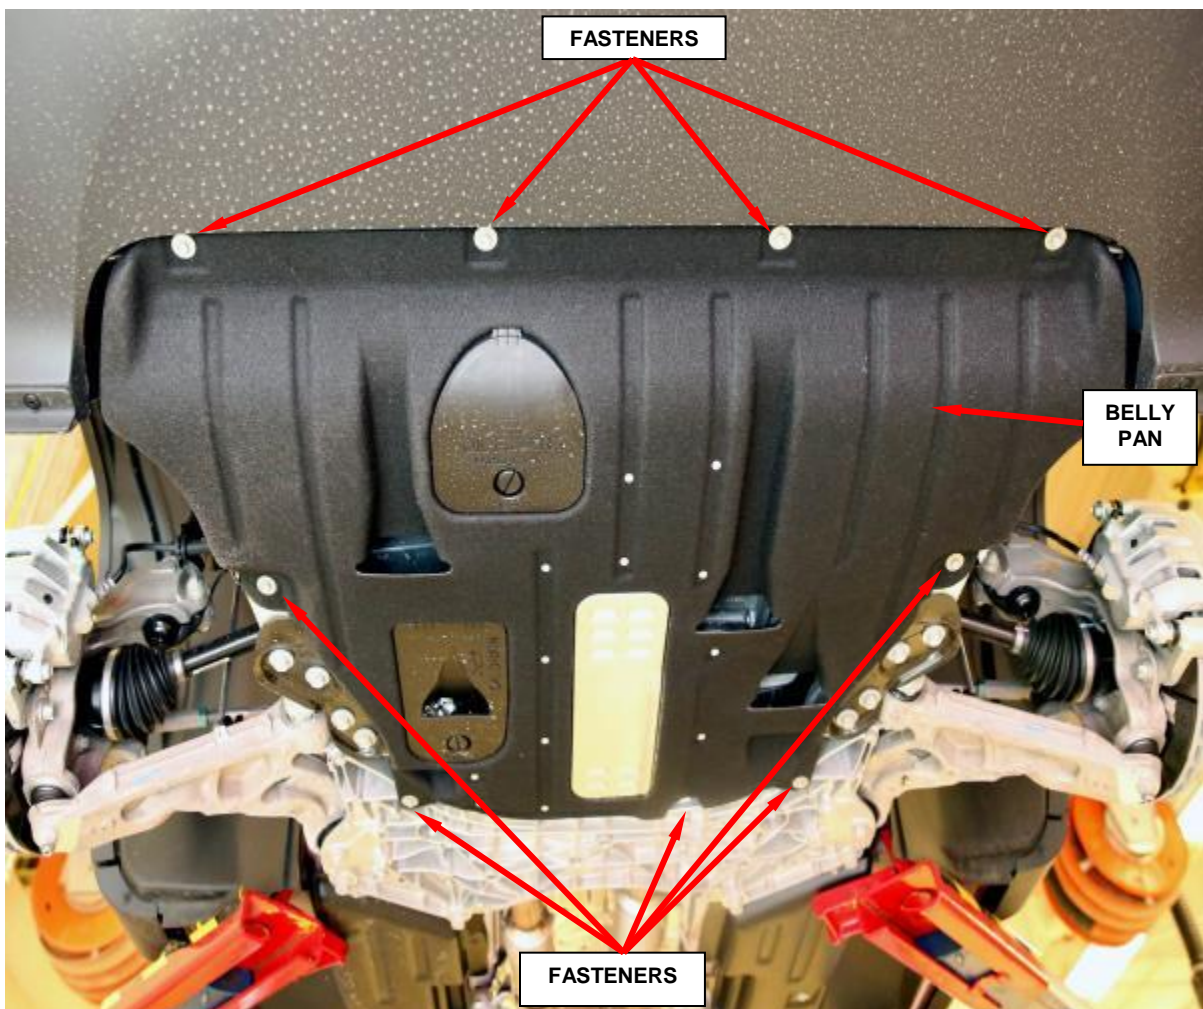


Figure 2 – Belly Pan

Service Procedure (Continued)

6. Remove and **discard** the lower ball joint nut (Figure 3).

NOTE: Hand start the lower ball joint nut to help protect the lower ball joint thread while using the Ball Joint Press.

7. Using the Ball Joint Press C-4150A separate the ball joint stud from the lower control arm (Figure 3).

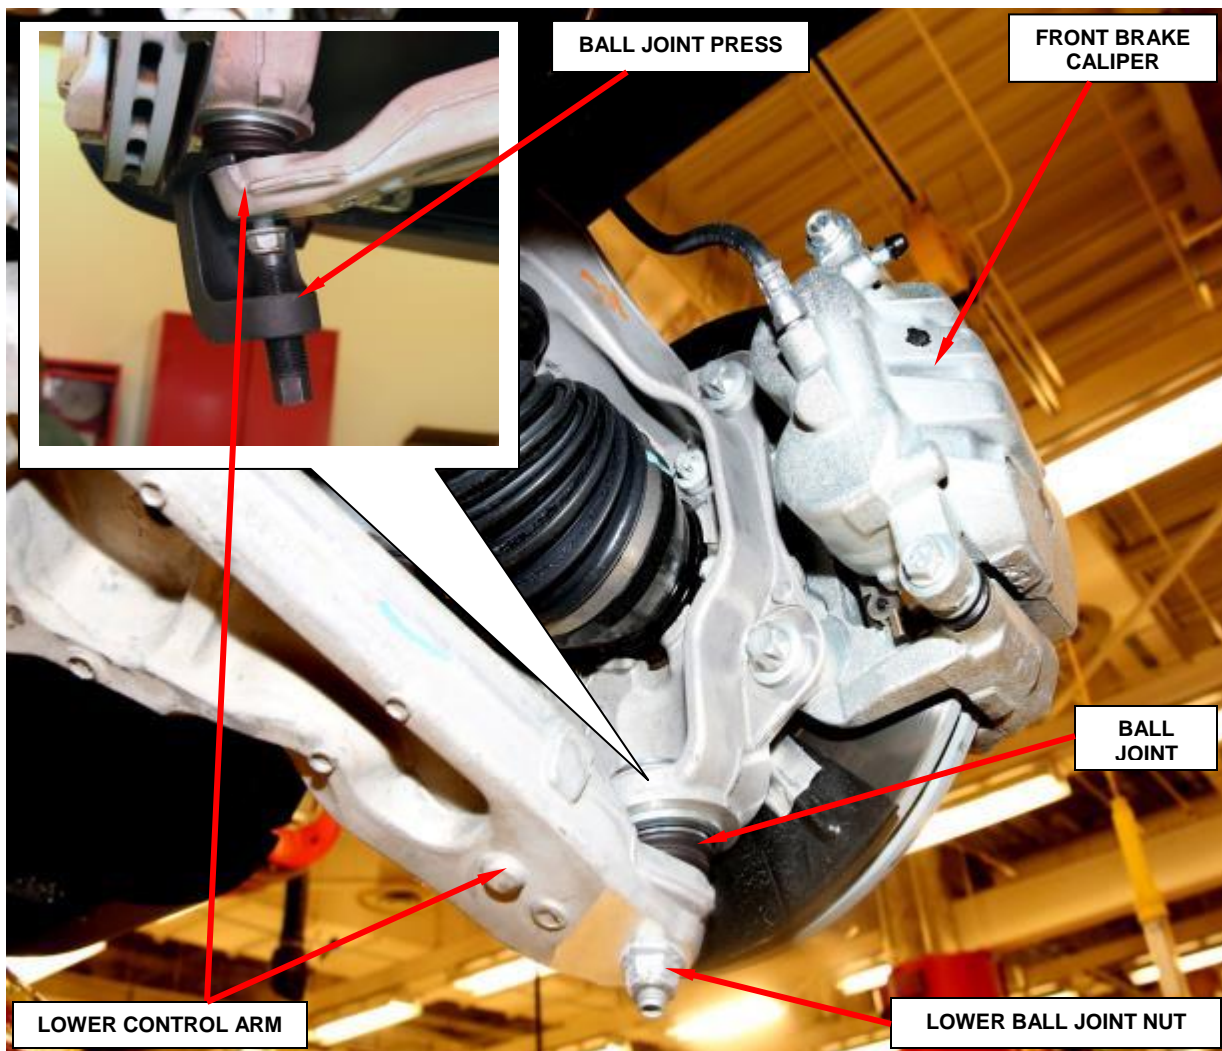


Figure 3 – Lower Ball Joint

Service Procedure (Continued)

NOTE: After separating the control arm from the knuckle, **do not allow it to swing rapidly back up.** This can tear the ball joint dust boot.

8. Insert a pry bar in the opening between the control arm front mounting bolt and the front fascia support beam (Figure 4).

NOTE: The halfshaft may stick in the hub bearing during removal. A dead-blow or plastic hammer can be used to tap the halfshaft inward and out of the hub bearing.

9. Pry down on the control arm until the ball joint stud is clear of the control arm. Position the knuckle assembly to the side until it is clear of the ball joint stud. Slowly release the control arm.
10. Swing the steering knuckle outward and off the halfshaft end (Figure 4).

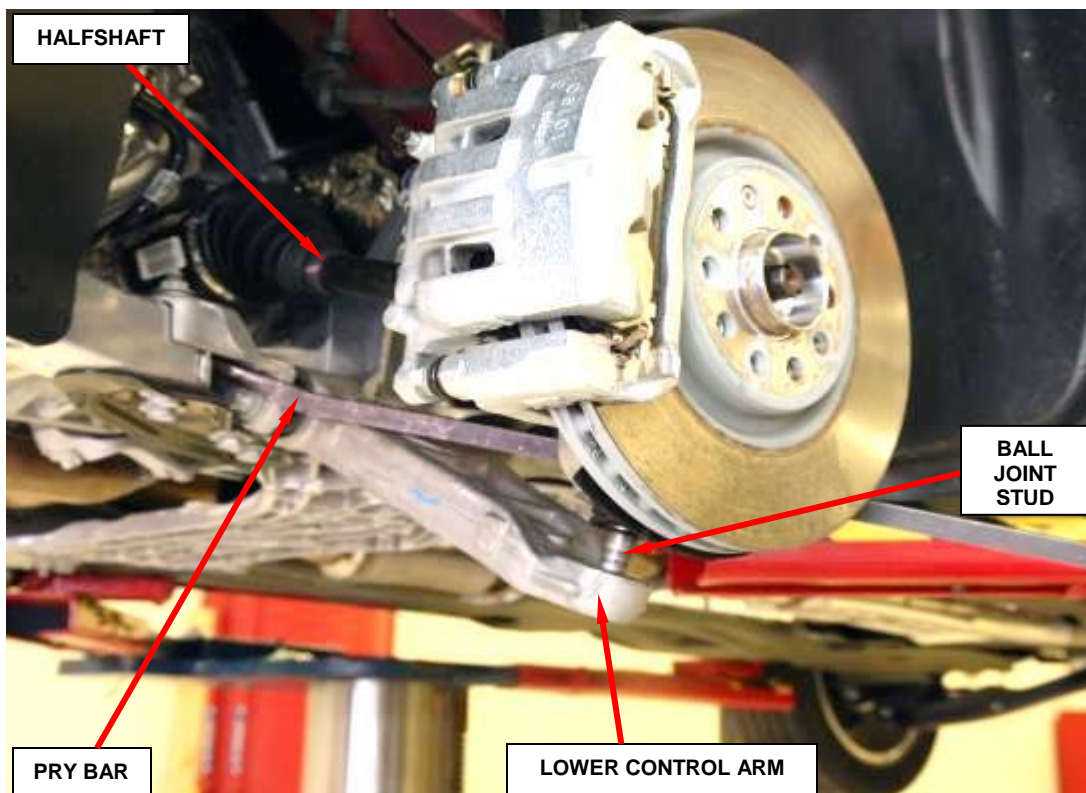


Figure 4 – Lower Control Arm

Service Procedure (Continued)

- Using a pry bar or equivalent tool release the halfshaft from the transaxle and remove the halfshaft from the vehicle (Figure 5).

NOTE: Lightly apply grease to the splines prior to installation.

NOTE: When installing the right halfshaft on All Wheel Drive (AWD) vehicles with a single speed Power Transfer Unit (PTU) and manual transmission, use care when installing the halfshaft as the shaft must pass through multiple oil seals.

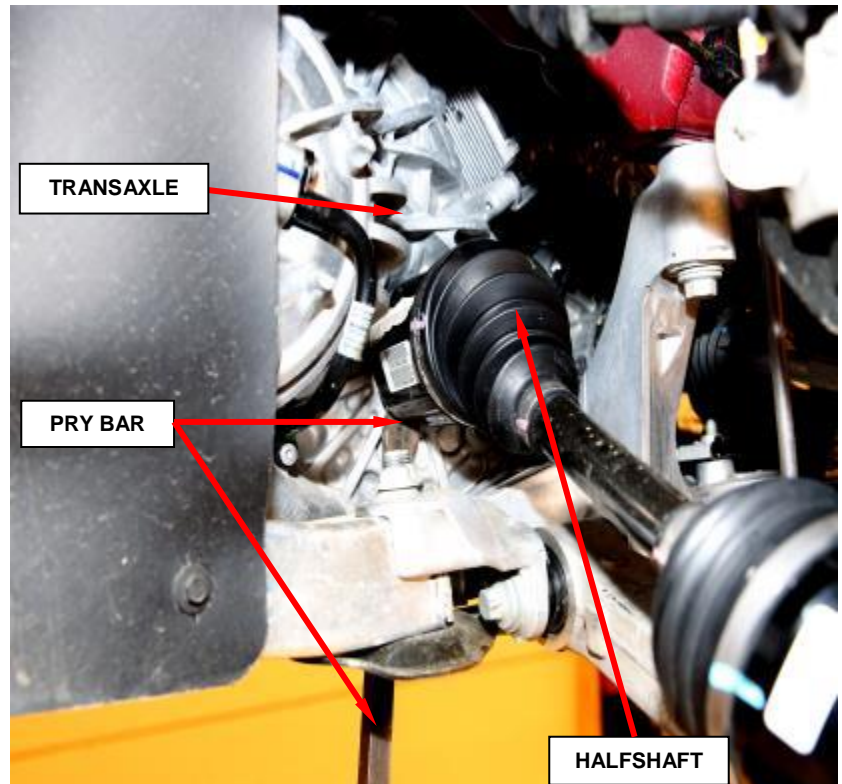


Figure 5 - Halfshaft to Transaxle

- Install the halfshaft into the transaxle and lightly twist until halfshaft spline slides all the way into the transmission.

NOTE: If circlip is fully engaged, tripod joint will not be removable from transaxle by hand.

- Swing the steering knuckle outward and engage the halfshaft end into the hub bearing spline.
- Push the lower control arm downward until ball joint stud can enter the bottom of the knuckle.
- Insert the ball joint stud into the lower control arm.
- Install a **NEW** lower ball joint to control arm nut and tighten to 18 ft. lbs. Plus 175° (25 N•m Plus 175°) (Figure 3).

Service Procedure (Continued)

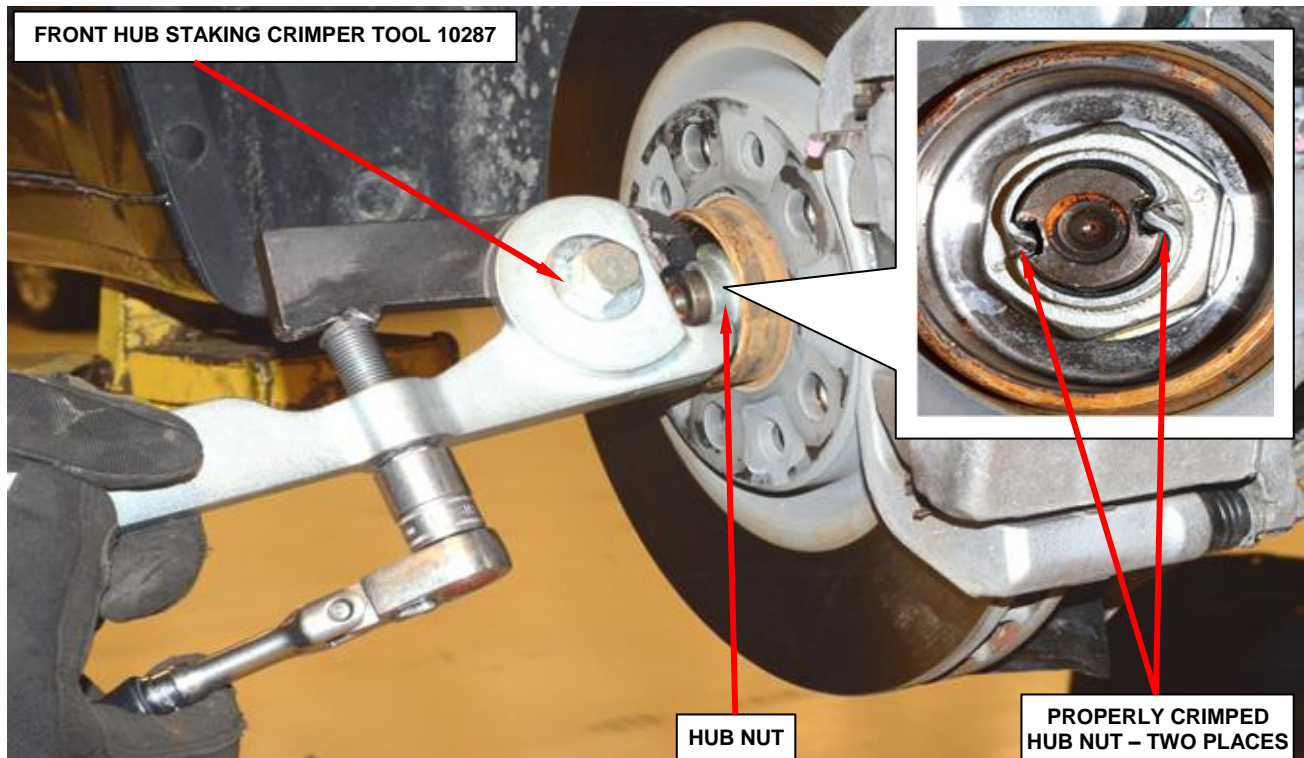


Figure 6 - Crimp Halfshaft Hub Nut with Special Tool 10287

NOTE: Always install a NEW hub nut. The original hub nut is one time use only and must be discarded when removed.

17. Install a **NEW** hub nut and while a helper applies the brakes, tighten the nut to 148 ft. lbs. (200 N•m).

NOTE: Do not use air tools on staking tool while staking hub nut.

18. Using the Tool, Front Hub Staking 10287, align the leading cutting edge of Tool, Front Hub Staking 10287 with the top left side channel on axle as shown. Tighten fastener on Tool, Front Hub Staking 10287 with hand tools until the threads bottom out completely (Figure 6).

NOTE: The hub nut must be staked so that it looks similar to Figure 6. Both edges must be split and bent into the shape shown. The staking must be opposite of the direction to tighten the nut.

Service Procedure (Continued)

19. If equipped, install the engine belly pan and tighten the fasteners securely (Figure 2).

20. Install the tire and wheel assembly and tighten the lugs to 96 ft. lbs. (130 N•m).

21. Lower the vehicle from the hoist.

22. Return the vehicle to the customer.

Completion Reporting and Reimbursement

Claims for vehicles that have been serviced must be submitted on the DealerCONNECT Claim Entry Screen located on the Service tab. Claims submitted will be used by FCA to record recall service completions and provide dealer payments.

Use the following labor operation number and time allowance:

	Labor Operation Number	Time Allowance
Replace left front halfshaft	02-S3-81-82	0.5 hours

NOTE: See the Warranty Administration Manual, Recall Claim Processing Section, for complete recall claim processing instructions.

Dealer Notification

To view this notification on DealerCONNECT, select “Global Recall System” on the Service tab, then click on the description of this notification.

Owner Notification and Service Scheduling

All involved vehicle owners known to FCA are being notified of the service requirement by first class mail. They are requested to schedule appointments for this service with their dealers. A generic copy of the owner letter is attached.

Enclosed with each owner letter is an Owner Notification postcard to allow owners to update our records if applicable.

Vehicle Lists, Global Recall System, VIP and Dealer Follow Up

All involved vehicles have been entered into the DealerCONNECT Global Recall System (GRS) and Vehicle Information Plus (VIP) for dealer inquiry as needed.

GRS provides involved dealers with an updated VIN list of their incomplete vehicles. The owner's name, address and phone number are listed if known. Completed vehicles are removed from GRS within several days of repair claim submission.

To use this system, click on the “**Service**” tab and then click on “**Global Recall System.**” Your dealer's VIN list for each recall displayed can be sorted by: those vehicles that were unsold at recall launch, those with a phone number, city, zip code, or VIN sequence.

Dealers must perform this repair on all unsold vehicles before retail delivery. Dealers should also use the VIN list to follow up with all owners to schedule appointments for this repair.

Recall VIN lists may contain confidential, restricted owner name and address information that was obtained from the Department of Motor Vehicles of various states. Use of this information is permitted for this recall only and is strictly prohibited from all other use.

Additional Information

If you have any questions or need assistance in completing this action, please contact your Service and Parts District Manager.

Customer Services / Field Operations
FCA US LLC

IMPORTANT SAFETY RECALL

S38 / NHTSA 16V-287

This notice applies to your vehicle (VIN: xxxxxxxxxxxxxxxxx).

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

Dear: (Name)

FCA has decided that a defect, which relates to motor vehicle safety, exists in certain **2016 model year Jeep® Cherokee vehicles.**

The problem is... **The left front halfshaft on your vehicle may not have been heat treated properly during the manufacturing process. An improperly heat treated left halfshaft could fracture without warning. A fractured left halfshaft could damage underbody components and cause a crash without warning.**

What your dealer will do... **FCA will repair your vehicle free of charge.** To do this, your dealer will replace the left front halfshaft. The work will take about one hour to complete. However, additional time may be necessary depending on service schedules.

What you must do to ensure your safety... Simply **contact your Chrysler, Jeep, Dodge or RAM dealer** right away to schedule a service appointment. Ask the dealer to hold the parts for your vehicle or to order them before your appointment. **Please bring this letter with you to your dealer.**

If you need help... If you have questions or concerns which your dealer is unable to resolve, please contact the FCA Group Recall Assistance Center at either **fcarecalls.com** or 1-800-853-1403.

Please help us update our records by filling out the attached prepaid postcard if any of the conditions listed on the card apply to you or your vehicle. If you have further questions go to **fcarecalls.com**.

If you have already experienced this specific condition and have paid to have it repaired, you may visit **www.fcarecallreimbursement.com** to submit your reimbursement request online or you can mail your original receipts and proof of payment to the following address for reimbursement consideration: **FCA Customer Assistance, P.O. Box 21-8004, Auburn Hills, MI 48321-8007, Attention: Recall Reimbursement.** Once we receive and verify the required documents, reimbursement will be sent to you within 60 days. If you've had previous repairs and/or reimbursement you may still need to have the recall repair performed on your vehicle.

If your dealer fails or is unable to remedy this defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., S.E., Washington, DC 20590, or you can call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to **safercar.gov**.

We're sorry for any inconvenience, but we are sincerely concerned about your safety. Thank you for your attention to this important matter.

Customer Services / Field Operations
FCA US LLC

Note to lessors receiving this recall: Federal regulation requires that you forward this recall notice to the lessee within 10 days.