
TIS Service Bulletin Page 1 of 7



July 2018 **Technical Service**

RECALL 17V-683: POSITIVE CRANKCASE VENTILATION (PCV) VALVE HEATER

New information provided by this revision is preceded by this symbol



Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

This Service Information bulletin replaces SI B11 16 17 dated June 2018

What's New:

- Part numbers updated.
- · Situation updated

MODEL

E82 (1 Series Coupe)	E88 (1 Series Convertible)	E90 (3 Series Sedan)	E91 (3 Series Wagon)
E92 (3 Series Coupe)	E93 (3 Series Convertible)	E60 (5 Series Sedan)	E61 (5 Series Wagon)
F10 (5 Series Sedan)	E83 (X3)	F25 (X3)	E70 (X5)
E85 (Z4 Roadster)	E89 (Z4 Roadster)	E86 (Z4 Coupe)	

With the N51, N52, N52K, or N52T engines.

UPDATE! SITUATION

The blow-by-heater which is designed to prevent the engine's Positive Crankcase Ventilation (PCV) system from freezing can internally short circuit. Irregularities in the manufacturing process could allow moisture to occur near the blow-by-heater and lead to the short circuit.

AFFECTED VEHICLES

This Recall Campaign involves E82, E88, E90, E91, E92, E93, E60, E61, F10, E83, F25, E70, E85, E89 and E86 vehicles produced from February 2006 to December 2011.

Vehicles which require this Recall Campaign to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

Customer letters are mailing throughout December 2017 notifying them that they are affected by this recall. 2nd letter will be mailed once we start receiving parts to let customers know they can come in for repair.

CORRECTION

Replace the blow-by-heater (positive crankcase ventilation heater elbow).

PROCEDURE

TIS Service Bulletin Page 2 of 7

Refer to the attached procedure to replace the blow-by-heater (positive crankcase ventilation heater elbow).

The E70 vehicles require an additional step. The labor allowance now includes additional time for this added repair step.

PARTS INFORMATION

Note: Request and invoice the part numbers specified and listed below in this Service Information bulletin only. Performing a part number look-up for these parts in ETK by VIN or model will result with the wrong parts being invoiced.

Please monitor the Parts Matrix for important updates to the parts ordering procedure.

Part Number	Description	Quantity
11 61 2 458 830	PCV Blow-by-heater (Elbow/Angle Connector)	1
12 31 2 458 831	Set of aluminum screws for alternator	1
11 61 7 535 849	Screw for blow-by-heater	2

And, if required as a result of the issue being addressed by this bulletin:

E60, E61, E70, E82, E85, E86, E88, and E89 only

Part Number	Description	Quantity
11 61 9 487 259	Intake Manifold	1
11 61 7 547 242	Set of profile gaskets	1

E83 only

Part Number	Description	Quantity
11 61 9 487 260	Intake Manifold	1
11 61 7 547 242	Set of profile gaskets	1

F10 and F25 only

Part Number	Description	Quantity
11 61 9 487 262	Intake Manifold	1
11 61 7 547 242	Set of profile gaskets	1

Repair harness for engine electrical harness:

Do not replace the entire engine electrical harness if only the PCV Blow-by-heater (Elbow/Angle Connector) electrical connector is damaged.

Part Number	Description	Quantity
12 52 9 489 752	Repair harness	1


TIS Service Bulletin Page 3 of 7

61 13 8 353 748	Cable connector 1.5 - 2.5 mm	2
61 13 1 379 833	Shrinking hose	2

For additional items that are not listed above, refer to ETK (EPC) and the repair instructions for information about one-time use fasteners, ventilation hoses, intake manifold, screws/bolts and gaskets that may also be needed or must be replaced to perform this repair.

EMISSIONS CERTIFICATE INSTRUCTIONS

For California centers only: This Safety Recall involves an emissions compliant component. It is required by the California Code of Regulations that an executed orange "Vehicle Emission Recall - Proof of Correction" certificate (SD92-084, see illustration) be provided to each customer (for vehicles registered in the state of California), once this Recall on his or her vehicle has been completed.

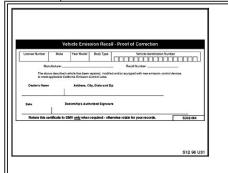

WARRANTY INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the following information:

Defect Code:	0011640400	

The vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 65 790	I RATAL TO K SI 17/AIR	Replace the blow-by-heater (positive crankcase ventilation heater elbow) (Plus work)

Or:

The vehicle is in the workshop for this recall repair only.

Labor Operation:	Labor Allowance:	Description:
00 65 194	I RATAL TO K SI 17/AIR	Replace the blow-by-heater (positive crankcase ventilation heater elbow) (Main work)

The vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 65 790		Replace the blow-by-heater (positive crankcase ventilation heater elbow) (Plus work)

TIS Service Bulletin Page 4 of 7

Or:

The vehicle is in the workshop for this recall repair only.

Labor Operation:	Labor Allowance:	Description:
00 65 194	I RATAL TO K SI 1 // AIR	Replace the blow-by-heater (positive crankcase ventilation heater elbow) (Main work)

And, as applicable:

When additional work and/or parts are required as a "direct result of and/or in conjunction with" replacing PVC heater elbow, claim these items under the defect code listed above together the corresponding labor operations listed in KSD2 as applicable and as necessary.

And, also as applicable:

Alternative Mobility Solution (AMS)

This Recall repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Defect Code noted above as follows:

Sublet Code 2 - Itemize the AMS sublet amount on the repair order and in the claim comment section.

Please refer to SI B01 29 16 for additional information.

Overlapping Labor Procedure

If invoicing the KSD2/AIR flat rate labor operation codes for other repair work results in overlapping labor, for those flat rate labor operations that are affected, you can:

• Replace the stated KSD2 "FRU allowance" with a "reduced FRU value" to eliminate the overlapping labor.

For help in identifying the overlapping labor, please refer to the AIR FRU Plausibility Check (Overlapping Labor Tool) that is located in the AIR Client.

Eligible other repair work being claimed under a different defect code will require separate punch times.

On the repair order and in the claim comment section, please identify and itemize those labor operations being claimed with a "reduced FRU value."

TREAD Act - Previous Customer-Pay Repairs

If your center is presented with a reimbursement request for a "qualifying customer-pay repair" that was performed on an "affected vehicle" **prior** to the release of this Recall Service Information bulletin, BMW of North America, LLC ("BMW NA") will reimburse this previous repair.

Customer-pay Invoice Review and Reimbursement Procedure

- 1. Review and verify that the previous customer-pay invoice (BMW center or independent repair shop) contains a repair that was performed to "address the issue" described in this "Recall" Service Information bulletin.
- 2. If this prior repair qualifies, reimburse the customer (labor and parts).
- 3. Submit for this customer-paid repair expense under Defect Code 85 99 00 12 NA, as follows:

TIS Service Bulletin Page 5 of 7

- · Sublet Code "3"
- Dollar amount (with no markup)
- Comment: Recall 17V-683: Positive Crankcase Ventilation (PCV) System Heater Reimbursement for allowable expenses that relate to performing a prior qualifying customer-pay repair.
- Itemize the sublet amount on the repair order and in the claim comments
- 4. Retain the "original" customer pay invoice in your files; this documentation may be requested by BMW during the claim review process).

Note: A previously reimbursed repair, a repair performed on a non-affected vehicle, and/or, the diagnosis and repair of other "unrelated issues" on an affected or non-affected vehicles does not qualify for reimbursement.

This claim submission for the "prior customer-pay reimbursement," when it is submitted as outlined under Defect Code "85 99 00 12 NA," **will not close** the "Open" Safety Recall on the vehicle.

The following supplemental alternate transportation measure is specific to this recall only, it does not supersede the existing Aftersales Mobility Program's (AMP) policy, procedures and guidelines.

SI B11 16 17: ALTERNATE TRANSPORTATION MEASURES (ATM)

For this recall, please use the following alternate transportation measures for those customers who have concerns about driving their affected BMW vehicle while they wait to have this safety-recall completed.

Enhanced Car Rental Procedure

For those customers with eligible Affected Vehicles needing mid to long-term alternate transportation car rentals, please refer to the Enhanced Car Rental Procedure option attachment for important information about:

- 1. The rental car allowance; and the
- 2. Safety-Recalled BMW_Vehicle Condition_Assessment Form

AMP Vehicles

Subject to availability and at the discretion of your center, provide the owner/operator of an Affected Vehicle in a comparable AMP Vehicle Loaner.

Owner/Operator Self-Storage Vehicle Agreement Form

With the customer's agreement and consent, you may allow the customer to retain and self-store their affected vehicle until the parts and/or repair procedure become available for this safety-recall.

Please print out the attached **Owner/Operator Self-Storage Agreement Form** and fill in the recall and customer's information. Please have the customer read and sign this agreement.

Required Documentation

A copy of the customer's completed and signed vehicle storage agreement form must be maintained in your center's Vehicle History File and if necessary, be provided to BMW NA upon request.

Please, also keep copies of all the corresponding safety recall parts and/or SIB-related information and documentation, vehicle's condition/assessment form and rental car invoices in the customer's Vehicle History

TIS Service Bulletin Page 6 of 7

File as applicable.

Customer Escalations

If you have an escalated customer situation concerning this safety-recall, please send an e-mail to recall.customerescalations@bmwna.com for review.

Please include the customer's name, their 17-character Vehicle Identification Number (VIN) and a brief explanation of their Safety Recall-related issue.

Safety Recall Repair Completion

As with any repair, once the corresponding safety recall-related parts and/or repair procedure become available from BMW NA, every effort must be made to immediately schedule service appointments at your center so this safety-recall repair can be performed on these vehicles.



Note: The client will have five (5) days after the safety-related recall repair (completion) date to

pick up their vehicle.

After five days, any additional time he/she remains in the rental car vehicle will be at the owner's/operator's expense.

ATM CLAIM SUBMISSION INFORMATION

Reimbursement for this specific safety-recall related car rental expenses is via normal claim entry, as a separate line item, utilizing the following information:

ir i		
Defect Code:	11009999RV	Rental Reimbursement – Safety-Recall Parts Supply/Repair Procedure Issues

And:

Sublet Code 3 Sublet at cost	Reimbursement for an alternate transportation vehicle through one of our preferred third-party rental car providers
------------------------------	---

Mid to Long-Term Car Rentals

Due to the current part supply situation, BMW NA anticipates that some customers may require alternate transportation for thirty (30) days or more. As a result, you may have to submit more than one claim for rental car reimbursement, before your center has the parts necessary to fix an Affected Vehicle.

For these cases, BMW NA recommends that your center submit a claim for the rental car reimbursement at 30-day or monthly intervals (invoice after each 30 day or month of rental car usage); explain the situation in the claim comments; and reference the email you sent by date.

Thank you for your continued cooperation and support.

Posted: Friday, July 20, 2018

ATTACHMENTS

View PDF attachment B111617 Dealer Script.

TIS Service Bulletin Page 7 of 7

View PDF attachment **B111617 Recall Notice**.

View PDF attachment 2017-BMW-MY2007-2011-Exx-Fxx-PCV-Valve-Heater-QA-(30Oct2017)-FINAL.

View PDF attachment **B111617_Enhanced Car Rental Procedure**.

View PDF attachment B111617_Safety-Recalled BMW_Vehicle Condition_Assessment Form.

View PDF attachment B111617_Vehicle Owner_Operator Self-Storage Agreement.

View PDF attachment **B111617_Procedure**.

[Copyright ©2018 BMW of North America, Inc.]

SAFETY RECALL NOTICE

To: All Center Operators, Sales Managers, Service Manager, Parts Manager and Warranty Processor

RE: Recall 17V-683: Positive Crankcase Ventilation (PCV) Valve Heater B11 16 17

BMW AG is conducting a Voluntary Safety Recall (effective November 2, 2017) on certain Model Year 2007-2011 BMW vehicles involving the positive crankcase ventilation (PCV) valve heater.

Owners will be notified by First Class mail about the Recall and will be instructed to bring their vehicles in for a free repair when parts are available.

Please be reminded that it is a violation of federal law (The Safety Act) for you to sell, lease or deliver any new motor vehicle covered by this notification until the recall repair has been performed. This means that centers may not legally deliver new motor vehicles to consumers until they are fixed or use/sell replacement equipment/parts subject to this recall. Note also that substantial civil penalties apply to violations of the Safety Act.

Also, you should not sell, lease or deliver any Certified Pre-Owned or used vehicles subject to a safety recall until the repair is completed.


Please follow any special instructions that we provide to you for the return or disposition of recall parts.

We appreciate all your assistance with this Recall.


Recall 17V-683: Positive Crankcase Ventilation (PCV) System Heater

1. Remove the ignition coil cover as per Repair Instruction 11 00 ... Removing and installing/replacing the ignition coil cover".

2. Remove the alternator as per Repair Instruction 12 31 020 "Removing and installing or replacing the alternator".

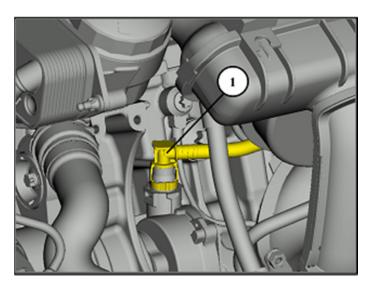

Unlock and pull off the vacuum line (1).
 Secure the vacuum line (1) off to one side.

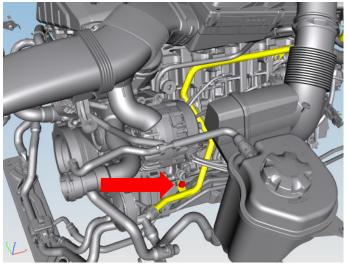


4. E70 (X5) vehicles only: UPDATE!

A coolant pipe will be blocking the access to one of crankcase ventilation heater screws.

Remove the M10 x 18 screw to allow the coolant pipe to be moved away from the crankcase ventilation heater screws.

See the red arrow in the illustration.

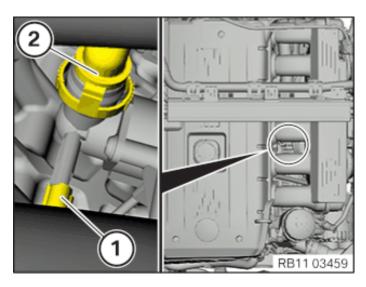


Unlock and disconnect the plug connection (1).
 Unlock and pull off the ventilation line (2).



6. Use a suitable tool with T25 Torx bit to release the screws.



7. Reach under the intake with your left hand/arm to access the crankcase ventilation heater.

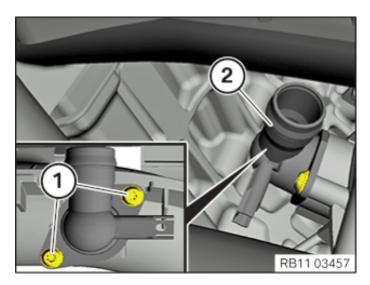


8. Remove both T25 screws (1).

Remove the crankcase ventilation heater (elbow fitting) (2).

Other components such as the ventilation line or the intake manifold may have to be replaced.


Inspect all surrounding components for thermal damage.

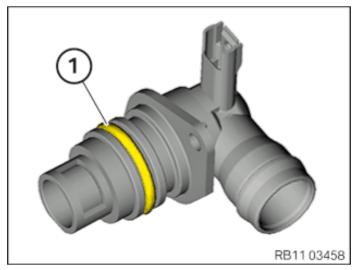

Important! Installation risk of damage.


9. Use only distilled water for lubrication when installing the new crankcase ventilation heater.

No grease or lubricating oils should be used.

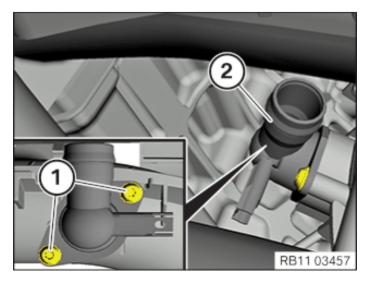


10. Install the crankcase ventilation heater (2).

Tighten the T25 screws (1) to 6 Nm.

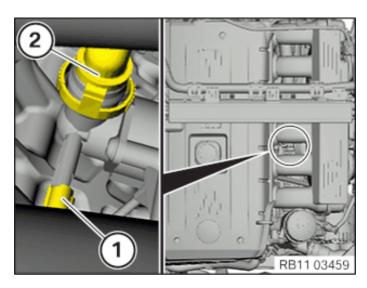

11. Connect the ventilation line (2).


Connect and lock the connector (1).

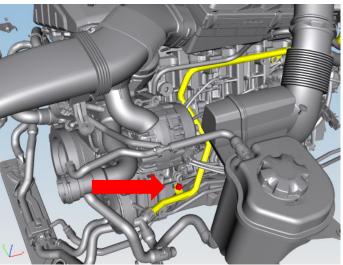

12. E70 (X5) vehicles only: UPDATE!

Reposition the coolant pipe and reinstall the M10 x 18 screw. See arrow.

Tighten the M10 x 18 screw to 38 Nm.

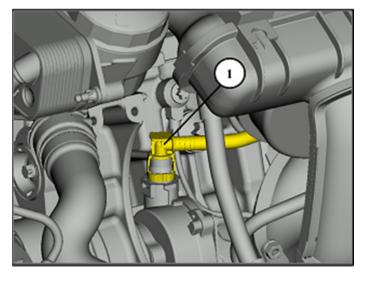

13. Connect the vacuum line (1).

14. Install the alternator as per Repair Instruction 12 31 020 "Removing and installing or replacing the alternator".

15. Install **the ignition coil cover as per** Repair Instruction 11 00 ... Removing and installing/replacing the ignition coil cover".

Safety Recall 17V-683 Positive Crankcase Ventilation (PCV) Valve Heater – ("Blow-By-Heater") Model Year 2007-2011 N51, N52, N52K, N52T

BMW 1 Series, 3 Series, 5 Series, X3 SAV, X5 SAV, Z4 Last Update: 10/30/2017

Q1. Which BMW models in the US are potentially affected by this Safety Recall?

Approximately 740,561 BMW vehicles in the US, as noted below, are potentially affected.

Series	Model Year	Model	Approx. Volume	Production Dates
E82	2008-2011	1 Series Coupe	12,401	Nov 2007 – Feb 2011
E88	2008-2011	1 Series Convertible	13,021	Nov 2007 – Feb 2011
E90	2007-2011	3 Series Sedan	305,352	Jul 2006 - Dec 2011
E91	2007-2011	3 Series Wagon	10,221	Jul 2006 – Aug 2011
E92	2007-2011	3 Series Coupe	54,544	May 2006 – Aug 2011
E93	2007-2011	3 Series Convertible	40,227	Nov 2006 – Aug 2011
E60	2007-2010	5 Series	114,750	Feb 2006 – Dec 2009
F10	2011	5 Series	19,656	May 2010 - Aug 2011
E61	2007	5 Series Wagon	1,442	Feb 2006 – Feb 2007
E83	2007-2010	X3 SAV	64,417	Aug 2006 – Aug 2010
F25	2011	X3 SAV	15,649	Nov 2010 – Sep 2011
E70	2007-2010	X5 SAV	68,770	May 2006 – Mar 2010
E85	2007-2008	Z4 Roadster	12,496	Jun 2006 - Aug 2008
E89	2009-2011	Z4 Roadster	5,868	Feb 2009 - Aug 2011
E86	2007-2008	Z4 Coupe	1,747	Sep 2006 – Aug 2008

Q2. What is the specific issue?

This issue involves the Positive Crankcase Ventilation (PCV) valve heater ("blow-by-heater") which is designed to prevent the engine's PCV valve from freezing. The electrical contacts of the PCV valve heater are coated with a plastic material. Irregularities in the manufacturing process could allow moisture to occur near the PCV valve heater and lead to a short circuit.

Q3. What can happen as a result of this issue?

In rare cases, the plastic material could overheat, lead to smoldering, and possibly melting. In extremely rare cases, this could increase the risk of a fire.

Q4. Why are other vehicles not included in this Safety Recall?

Other models have different designs for the PCV valve heater.

Q5. Do I need to stop driving my vehicle?

No. The possibility of this issue occurring is extremely rare.

However, you should stop driving your vehicle if any of the following warning signs occur:

- You see smoke from the area near the engine compartment.
- You smell smoke, or a plastic burning odor.

If any of these warning signs occur, then as soon as possible, carefully move away from traffic, pull over to a safe location, and shut off the engine. All occupants should carefully exit the vehicle and move to a safe location away from traffic. Do not continue to drive your vehicle.

ī

Safety Recall 17V-683 Positive Crankcase Ventilation (PCV) Valve Heater – ("Blow-By-Heater") Model Year 2007-2011 N51, N52, N52K, N52T BMW 1 Series, 3 Series, 5 Series, X3 SAV, X5 SAV, Z4

Last Update: 10/30/2017

<u>Dial 911 in the event of an emergency</u> or contact an authorized BMW center immediately to have your vehicle brought to the nearest authorized BMW center for inspection and, if necessary, repair.

If an authorized BMW center is not available, then contact BMW Roadside Assistance at 1-800-332-4269. Please note that if you no longer have roadside coverage, you may be required to pay in advance for the towing service. However, BMW will reimburse you for the towing service after validation of the recall repair claim.

Q6. I am nervous about continuing to drive my vehicle. Can I get a loaner vehicle? Is alternate transportation available?

If you request a loaner vehicle and replacement parts are not available, we have directed our authorized BMW centers to assist customers with alternate transportation needs.

Q7. Can I determine if this issue exists in my vehicle?

No. This can only be determined through proper inspection at an authorized BMW center.

Q8. How did BMW become aware of the problem?

BMW became aware of the problem through our quality control procedures.

Q9. How will I be informed of this Safety Recall?

All affected owners will receive an <u>initial letter in December</u> via First Class mail advising them of this recall. Due to the large vehicle population, sufficient parts may not be immediately available to repair all vehicles. Therefore, affected owners will receive a <u>second letter</u> on a rolling basis as parts become available. When owners receive the <u>second letter</u>, they should promptly schedule an appointment with an authorized BMW center to have this recall performed. The nearest authorized BMW center can be located at <u>www.bmwusa.com/dealers</u>.

To ensure BMW has the most recent contact and vehicle information, owners should register their vehicle at www.bmwusa.com/myBMW. Registration is free, and will give them access to factory initiated campaigns and other information specific to their BMW.

Q10. How will my vehicle be repaired?

The PCV valve heater will be inspected and a new part will be installed. In some cases, additional components may need to be replaced which will be determined at the time of repair.

Q11. How long will the repair take?

This repair should take approximately one to two hours, depending upon the specific repair necessary; however, additional time may be required depending upon your BMW center's schedule. The repair will be performed **free of charge** by your authorized BMW center.

Safety Recall 17V-683
Positive Crankcase Ventilation (PCV) Valve Heater – ("Blow-By-Heater")
Model Year 2007-2011
N51, N52, N52K, N52T
BMW 1 Series, 3 Series, 5 Series, X3 SAV, X5 SAV, Z4
Last Update: 10/30/2017

Q12. Do I have to wait for my letter to have my vehicle serviced?

Yes. Due to the large vehicle volume, a sufficient quantity of parts may not be immediately available for all potentially affected vehicles. Therefore, potentially affected owners will receive a second letter on a rolling basis. When you receive the <u>second letter</u>, you should promptly schedule an appointment with an authorized BMW center to have this recall performed. You can locate your nearest authorized BMW center at www.bmwusa.com/dealers.

Q13. I see the "TREAD Act Customer Reimbursement Plan" attached to my letter. Can you explain what that is about? Am I eligible for reimbursement?

If you have already had this repair performed at your own expense, you may be eligible for reimbursement of certain expenses that you incurred.

Dealer Script:

Thank you for your call / inquiry regarding the current blower motor wiring (and or PCV Valve Heater) recall. I want to personally assure you that BMW of North America takes your safety and this situation very seriously. BMW has notified the National Highway Traffic Safety Administration, known as NHTSA, of our intent to recall approximately 1 million cars and SUV's.

Currently, we do not have a fixed date for the replacement parts.

Here's what I can tell you: If you own a potentially affected BMW vehicle, you will be sent a first-class letter in the mail within the next few weeks with more information on what you can do prior to availability of the replacements parts. Once the parts are available, owners will receive another letter with instructions on what to do to have the parts replaced.

While I certainly understand that this may not answer all your questions, I hope it helps a little to know what to expect in light of this recall. BMW is working as quickly as possible to address this situation and we very much appreciate your patience. In the meantime, more information can be found on our website: https://www.bmwusa.com/ scroll to the bottom left side of the page and click: Safety Recalls, enter the last 7 digits of your VIN and click enter. This will provide you with the current Q&A document.

Thank you for calling us and we will be happy to help you as soon as parts become available.

Recall 17V - 683: SI B11 16 17 - Alternate Transportation Measures

Enhanced Car Rental Procedure (Mid to Long-Term Alternate Transportation)

Customer requests alternate transportation while they wait for their affected vehicle to be repaired, prior to providing the customer with alternate transportation:

- Fully complete the attached **Safety Recalled BMW Vehicle Condition/Assessment Form** (Save either as pdf or print and scan to attach to the email)
- Create an email with the Subject: Safety Recall Rental Request VIN: ###### (Customer's VIN- last seven)
- In the body of the email, please include the start date of the rental, the part number(s) and or repair procedures that are not available and any other information that is relevant to the situation
- Provide a center contact person's name, phone number and email address.
- Please send this VIN-specific email to <u>Recall.rentalrequest@bmwna.com</u> with the completed <u>Safety</u> Recalled <u>BMW Vehicle Condition</u>/<u>Assessment Form</u> attached for review.
- A BMW NA representative will respond to your e-mail with instructions on how to proceed.

Alternate Transportation is Approved

Please provide the customer with a vehicle through one of our preferred third-party rental car providers (Hertz or Enterprise), BMW will reimburse the following:

BMW Rental Vehicles	 Up to \$64.00 a day; plus any Market surcharge (if applicable); plus the CDW* (Collision Damage Waiver) protection - when the rental vehicle agreement "signee" accepts this "optional" coverage; plus Taxes
Non-BMW Rental Vehicles	 Up to \$44.00 a day; plus any Market surcharge (if applicable); plus the CDW* (Collision Damage Waiver) protection - when the rental vehicle agreement "signee" accepts this "optional" coverage; plus Taxes

Invoice these allowable rental car expenses (Excluding fuel) as a separate line item on the repair order as outlined below.

Note: Aftersales Area Manager (AAM) "Field Authorization" (FAS) is not required.

Rental Vehicle Invoice - Required Information for Claim Submission

In order to be reimbursed for the above, your center must itemize the rental car invoice in the claim comments, please ensure that you always include the following information:

Rental Vehicle Invoice - Line items	Required Information to be provided
Brand of rental vehicle in use	BMW or Non-BMW Vehicle - Model year and description
Rental period	Total number of days
Market surcharge (If applicable)	Cost per day and the total amount
CDW* (Collision Damage Waiver)	Cost per day and the total amount
Taxes	Total amount

Version: 12/2017

Recall 17V - 683: SI B11 16 17 - Alternate Transportation Measures

Other Optional Protection/Insurance Coverage

BMW will only reimburse the cost of the applicable Collision Damage Waiver (CDW)* protection that the rental vehicle agreement "signee" accepted.

*Note: The Collision Damage Waiver (CDW), this may also be referred to as the Loss Damage Waiver (LDW) or the Physical Damage Waiver (PDW).

If your customer wants to obtain other optional protection or insurance coverage, for example:

- SLP/SLI/LIS (Supplemental Liability Protection or Insurance/Liability Insurance Supplement); and/or
- PAI (Personal Accident Insurance); and/or
- PEC (Personal Effects Coverage);

The cost of this optional coverage would be at the owner's/operator's expense.

Important Note

If the customer believes they have access to optional protection/insurance coverage that will apply to their loaner car or rental vehicle either through their credit card company and/or personal car insurance (including other drivers and/or total loss), please encourage them to verify if and what additional coverage is available to him or her.

Version: 12/2017

SI B11 16 17: Safety-Recalled BMW - Vehicle Condition/Assessment Form

Please provide the following information:				on:	Date:	
Center Number: BMW Center Name:						
Center Contact – Name:						
Center Contact – Phone number:						
Center Contac	Center Contact – email:					
BMW Client's Name:						
Client's BMW	VIN (Last	Seven):			Model Year:	
BMW Model:					Current Mileage:	
Safety Recall	- Service I	nformat	ion bul	letin nu	ımber SIB 11 16 17 (17V - 683)	
Type of Alternate Transportation provided to the Customer						
Select the one	that applie	es:		AMP	Rental (BMW) Rental (Non-BMW)	
			of the	Recalle	ed BMW Vehicle	
Select the overall condition below that applies:				plies:	11 12 13 14	
Very Good/Clean					10 0 15	
Good/Clean					1 7 7 2 8 8 8 9 9	
	Avera	ge				
Fair/Poor and below					17 18 19 20	
Item	V. Good	Good	Avg.	Poor	Comments (with the reference number as needed)	
Paint						
Body Interior						
Carpeting						
Engine						
Transmission						
Axles						
Suspension						
				Comn	nents (as applicable)	
BMW Approved Accessories						
Vehicle Modifications						
Aftermarket Equipment/Accessories						
CARFAX™ or other noted issues						

Please attach or scan/attach this form with the email being sent to Recall.rentalrequest@bmwna.com

Version: 12/2017

SI B11 16 17 - Recalled BMW Vehicle: Owner/Operator Self-Storage Agreement Form

You,			are the owner/lessee of a mod	lel year
	(Name Print)			
BMW		VIN:	("Vehicle")	("Mileage")
		(Last Seven)		
		d that your BMW Vehicle (ref h America, LLC ("BMW NA")	ferenced above) is subject to the follow:	ving Safety Recall
Red	call 17V - 683	Positive Crankcase \	/entilation (PCV) Valve Heate	r
The retime.	eplacement part(s) and/or repair procedure to p	perform this Safety Recall repair are n	ot available at this
that th	ne recall-related pa	arts and/or repair procedure	loaner/rental vehicle to drive until BMV are available to be performed on your to return the loaner/rental vehicle, wh	Vehicle, or until
			our Vehicle (referenced above) home a ving the loaner/rental vehicle.	and store it (outside
You r	must therefore ag	ree to the following:		
to Ri Yi Yi Yi Yi Yi Yi Yi pr	return it to the BN ecall repair ou will store your vou will ensure that ou will maintain you hicle, which you replacement parts a ou understand that ior to the performatics.	Wehicle at your home, or another the vehicle's keys are secur our Vehicle and will not alter, may return at the expiration of and/or repair procedure to pent you will be responsible for a cance of the Recall repair, oth	(as noted above) outside and not drive ad/or repair procedure becomes available ther safe location of your choice, at your ed and inaccessible to others modify or sell the Vehicle (except in the form the Recall) any and all damages caused to the Vehicle than directly to or from the BMW cether than directly the form than the form that the form the form the form that the form that the form the form the form the	ble to perform the our own risk he case of a leased availability of the chicle if it is driven enter
Nam	e (Print)			
Nam	e (Signature)		Today's Date	
Addı	ress (Print)			
0:1/	(O /Zi (D.i)			
City/	State/Zip (Print)			
Tele	phone Number (Ok	(to text message: Y / N) (Circ	cle one)	
Ema	il(s)			

Version 12/2017

Status: i.e., owner, lessor, lessee, operator, etc. (Print)