



Revised August 2018

Dealer Service Instructions for:

# Safety Recall T79 / NHTSA 17V-821

## Brake Transmission Shift Interlock

---

*NOTE: Remedy now available for additional model years. Parts section updated. New steps added to page 5 and page 16 of Service Procedure. New LOP added for 2009 – 2012 model year vehicles.*

### Remedy Available

- 2009 - 2017 (DS) RAM 1500 Pickup**
- 2010 - 2017 (DJ) RAM 2500 Pickup**
- 2010 - 2017 (D2) RAM 3500 Pickup**
- 2011 - 2017 (DD) RAM 3500 Chassis Cab**
- 2016 - 2017 (DF) RAM 3500 10K GVWR Chassis Cab**
- 2011 - 2017 (DP) RAM 4500/5500 Chassis Cab**

---

*NOTE: This recall applies only to the above vehicles equipped with a column shift automatic transmission. This safety recall does not affect vehicles equipped with a rotary or floor shifter or manual transmission.*

**IMPORTANT:** Some of the involved vehicles may be in dealer new vehicle inventory. Federal law requires you to complete this recall service on these vehicles before retail delivery. Dealers should also consider this requirement to apply to used vehicle inventory and should perform this recall on vehicles in for service. Involved vehicles can be determined by using the VIP inquiry process.

**Subject**

The Brake Transmission Shift Interlock (BTSI) locking pin on about 1,482,400 of the above vehicles may become stuck in the open position. A BTSI locking pin stuck in the open position may allow the transmission to be shifted out of PARK and to any gear position without depression of the brake pedal and/or without the key in the ignition, if a key is applicable. The ability to shift the transmission out of the PARK position without a key in the ignition or a brake pedal application, increases the risk for an unintended vehicle rollaway that may result in a vehicle crash or injury without prior warning.

**WARNING: Never use the PARK position as a substitute for the parking brake. Always apply the parking brake fully when parked to guard against vehicle movement and possible injury or damage. Refer to your owner's manual for additional information regarding proper parking brake usage.**

**Repair****2013 – 2017 Model Years**

Test the BTSI operation and replace if necessary. Reprogram the Body Control Module (BCM) with new software and place an addendum card in the owner manual. Instruct the vehicle owner to read the addendum card in order to become familiar with the revised BTSI operation.

**2009 – 2012 Model Years**

**BTISI must be replaced. Software update and addendum card is not included for 2009-2012 model years only.**

**Parts Information**

**2013 – 2017 Model Years**

Perform the **Service Procedure Section A. BTSI Inspection** before ordering part.

---

**Models**

**DS** - All  
**DJ** - All  
**DD** - DGQ or DFP  
**D2** - DFP or DG7  
**DF** - DFP

**Sales Codes**

**DGQ** - 5-SPD Automatic 545RFE Transmission  
**DFP** - 6-SPD Automatic 66RFE Transmission  
**DG7** - 6-SPD Automatic 68RFE Transmission  
**DG1** - 6-SPD Automatic 65RFE Transmission  
**DGV** - 4-SPD Automatic 42RLE Transmission

**Part Number**

**CSZHT791AB**

**Description**

**Bracket, Gearshift (Includes BTSI)**

---

**Models**

**DP** - All  
**DD** - DG3 or DF2 or DF3  
**D2** - DF2  
**DF** - DF2 or DF3

**Sales Codes**

**DF2** - 6-SPD Automatic Aisin AS69RC  
 Transmission  
**DF3** - 6-SPD Automatic Aisin AS66RC  
 Transmission  
**DG3** - 6-SPD Automatic Aisin AS68RC  
 Transmission

**Part Number**

**CSZHT792AB**

**Description**

**Bracket, Gearshift (Includes BTSI)**

---

**2013 – 2017 Model Years**

Due to the small number of involved vehicles expected to require gearshift bracket / BTSI replacement, no parts will be distributed initially. **The gearshift bracket / BTSI should be ordered only after inspection determines that replacement is required. Very few vehicles are expected to require gearshift bracket / BTSI replacement.**

**2009 – 2012 Model Years**

**Gearshift Bracket / BTSI replacement is required for 2009-2012 model years. No inspection is required for 2009-2012 model years only.**



<b>Service Procedure</b>
--------------------------

- **2009 - 2012 model year vehicles.** Do not perform the BTSI inspection process. Proceed to **Section B. Gearshift Bracket / BTSI Assembly Replacement.**
  
- **2013 - 2017 model year vehicles.** Perform **Section A. BTSI Inspection** process to determine if the BTSI requires replacement.

### **A. BTSI Inspection**

**NOTE: This process is to determine if the BTSI needs to be replaced.**

1. While sitting in the driver's seat, apply the parking brake.
  
2. With the ignition switch in the “**OFF**” position, attempt to shift the transmission into any gear. Only minimal force is required, do not force the shift lever.
  - If the shifter is blocked then continue with **Step 3.**
  
  - If the shifter moves freely, then follow the repair procedure to replace the BTSI. Proceed to **Section B. Gearshift Bracket / BTSI Assembly Replacement.**
  
3. Place the ignition switch in the “**RUN**” position and leave the shift lever in the “**PARK**” position.
  
4. Turn off the radio, Heating, Ventilating, and Air Conditioning (HVAC), and any other accessories that are making noise. Also have all vehicle windows in the up and closed position to reduce outside noises.

**Service Procedure [Continued]**

**NOTE: Do not move the shift lever from the “PARK” position during Steps 5 through 9.**

5. Place your hand on the shift lever knob and push lightly on the shift lever toward the instrument panel. This will allow you to feel a click sensation from BTSI solenoid pin movement when the brake pedal is applied and released (Figure 1).



**Figure 1 – Push Lightly On Shift Lever Knob Toward Instrument Panel To Feel BTSI Solenoid Pin Movement**

6. Listen for a click sound from the BTSI solenoid pin movement while also feeling for the corresponding click sensation in the shift lever when the brake is applied and released.
7. After you are familiar with both the sound and feel of the BTSI pin movement in **Steps 5 and 6**, continue with **Step 8**.
8. Place your hand on the shift lever knob as instructed in **Step 5** then apply and hold the brake pedal for a count of five seconds.
9. After five seconds of holding the brake pedal down, release the brake pedal while both listening and feeling for the click of the BTSI pin movement. The sound and feel of the BTSI pin movement should occur immediately within 0-2 seconds upon release of the brake pedal.
  - If the BTSI pin could be heard and felt moving within 0-2 seconds, then the BTSI inspection process is complete and the gearshift bracket / BTSI assembly does not need to be replaced. Place the ignition switch in the “OFF” position then proceed to **Section C. Reprogram Body Control Module (BCM)**.
  - If the BTSI pin could **not** be heard and felt moving within 0-2 seconds, then continue with **Step 10**.

<b>Service Procedure [Continued]</b>
--------------------------------------

**NOTE: For the BTSI test in steps 10 and 11, do not place your hand on the shift lever until instructed to do so.**


10. Do **not** place your hand on the shift lever. With the ignition switch in the “**RUN**” position, apply and hold the brake pedal for a count of five seconds.
  
11. After five seconds of holding the brake pedal down, release the brake pedal. Wait exactly 2 seconds then attempt to move the shift lever out of the “**PARK**” position. Only minimal force is required, do not force the shift lever.
  - If the shift lever **cannot** be moved from the “**PARK**” position 2 seconds after the brake pedal is released, the BTSI inspection process is complete and the gearshift bracket / BTSI assembly does not need to be replaced. Proceed to **Section C. Reprogram Body Control Module (BCM)**.
  
  - If the shift lever can be moved out of the “**PARK**” position 2 seconds after the brake pedal is released, then the gearshift bracket / BTSI assembly must be replaced. Proceed to **Section B. Gearshift Bracket / BTSI Assembly Replacement**.

**Service Procedure [Continued]****B. Gearshift Bracket / BTSI Assembly Replacement**

1. Open the vehicle hood
2. Disconnect the negative battery cable terminal from the battery(s).
3. Using a trim stick C-4755 or equivalent, disengage the retainer clip that secures the hood release handle to the steering column opening cover, and remove the hood release handle from the cover (Figure 2).


**Figure 2 – Hood Release Handle**

4. Remove and save the two screws that secure the bottom of the steering column opening cover to the instrument panel (Figure 3).
5. Using a trim stick C-4775 or equivalent, release the eight spring clips that attach the steering column opening cover to the instrument panel (Figure 3)

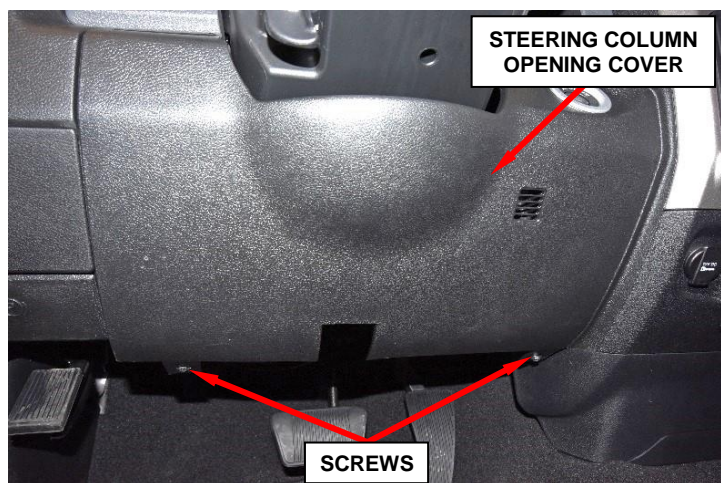**Figure 3 – Steering Column Opening Cover**

**Service Procedure [Continued]**


6. Remove the data link connector from the steering column opening cover by pressing in the tabs and pushing the connector through the opening on the back side of the cover (Figure 4).

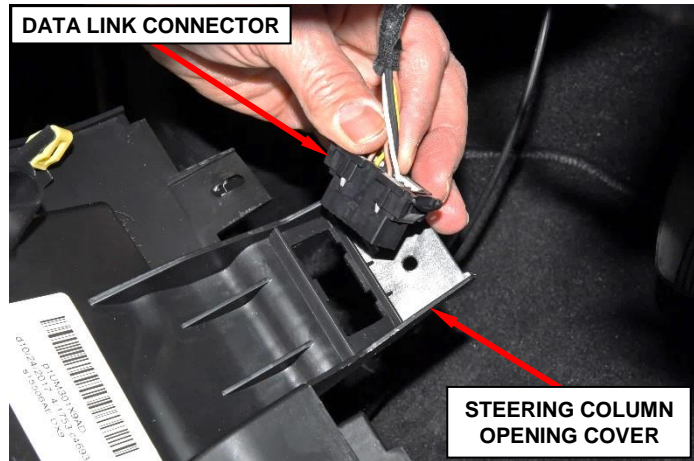

**Figure 4 – Data Link Connector**

7. **If equipped:** Disconnect the electrical connectors for any electrical devices from the steering column opening cover.

8. Remove and save the steering column opening cover.

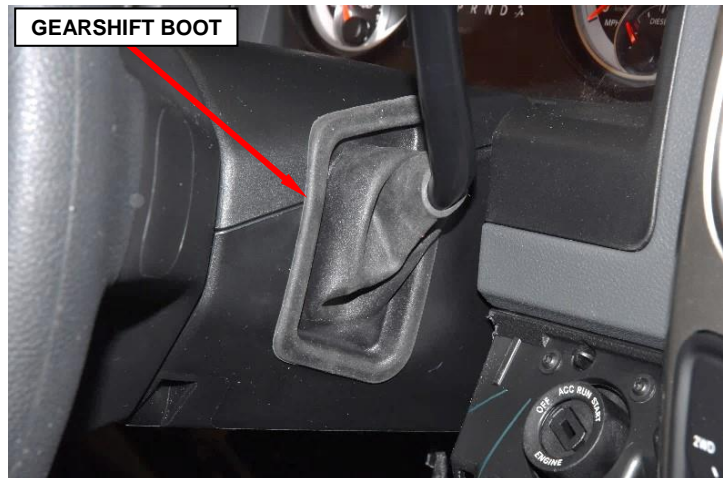


**Figure 5 – Gearshift Boot**

9. Using a trim stick, disengage the gearshift boot from the steering column shrouds (Figure 5).

**Service Procedure [Continued]**

10. Remove and save the two T20 star-head screws that attach the upper steering column shroud to the lower steering column shroud. The screws are located on the underside of the lower steering column shroud (Figure 6).

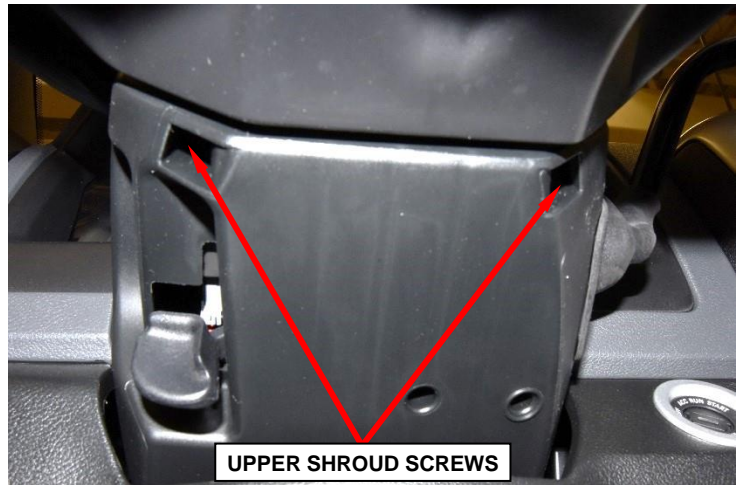**Figure 6 – Upper Shroud Screws**


**NOTE:** There are snap connections near the instrument cluster and between the shroud and the steering wheel that secure the upper and lower shroud.

11. Remove and save the upper steering column shroud by pushing gently inward and upward on both sides of the upper shroud just above the joint line to the lower shroud to release the snap features that secure the shrouds together (Figure 7).

**Figure 7 – Steering Column Upper Shroud**

**Service Procedure [Continued]**


12. Remove and save the T20 star-head screw that retains the lower shroud to the steering column (Figure 8).

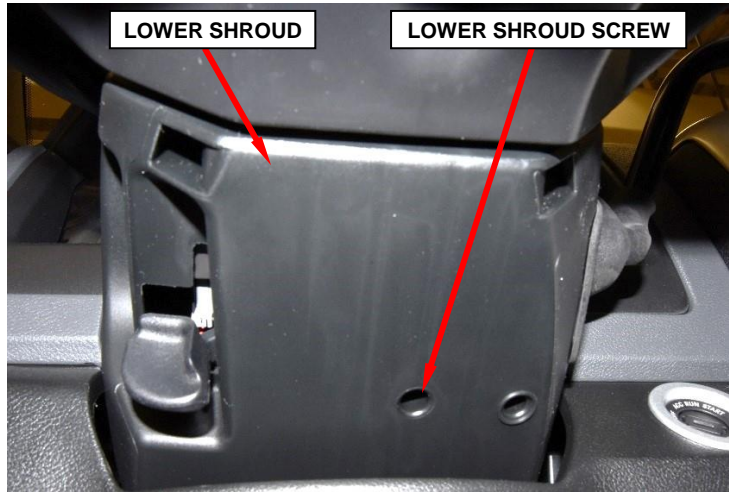

**Figure 8 – Steering Column Lower Shroud**

13. Carefully move the lower shroud to clear the steering column tilt lever then remove and save the lower shroud. (Figure 8).


14. Disconnect the shift cable from the gearshift bracket (Figure 9).

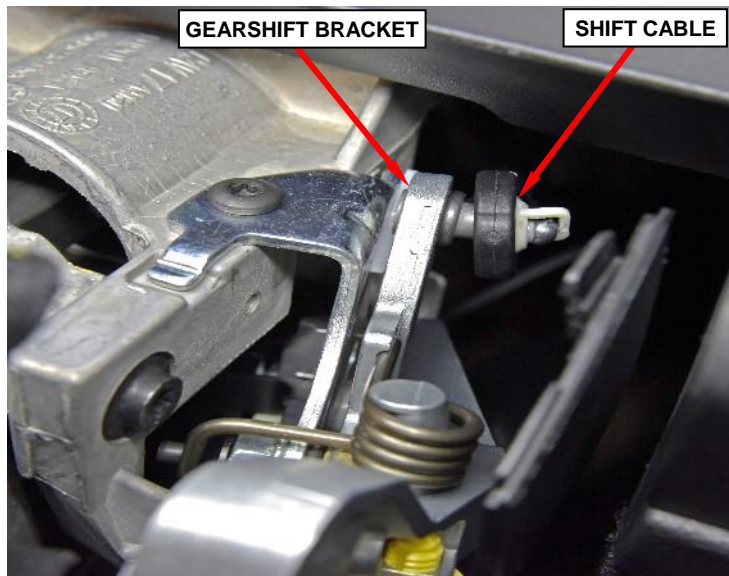

**Figure 9 – Shift Cable**

**Service Procedure [Continued]**


15. Disconnect the upshift/downshift electrical harness connector (Figure 10).

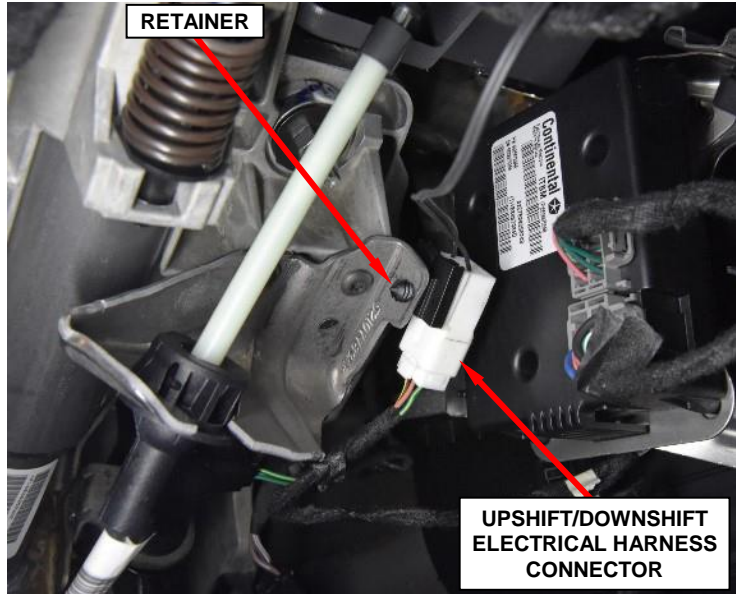

**Figure 10 – Upshift/Downshift Electrical Harness**

16. Release the upshift/downshift electrical harness connector retainer (Figure 10).


17. Disconnect the BTSI electrical harness connector (Figure 11).

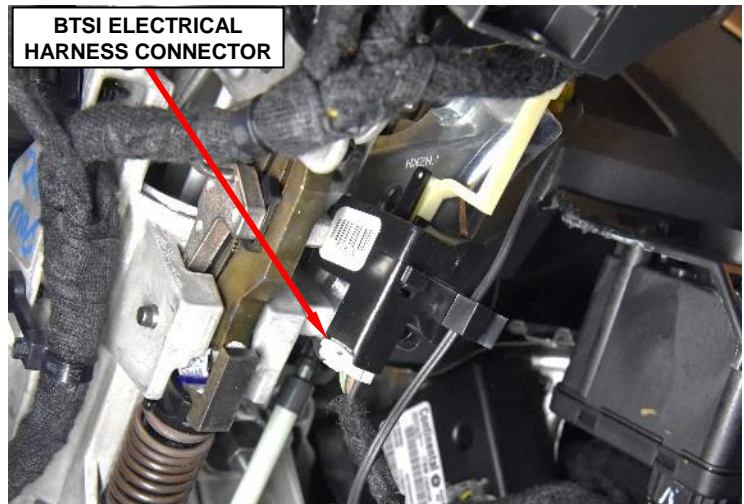

**Figure 11 – BTSI Electrical Harness**

**Service Procedure [Continued]**

18. Remove and save the three T27 star-head screws securing the gearshift bracket / BTSI assembly to the steering column (Figure 12).

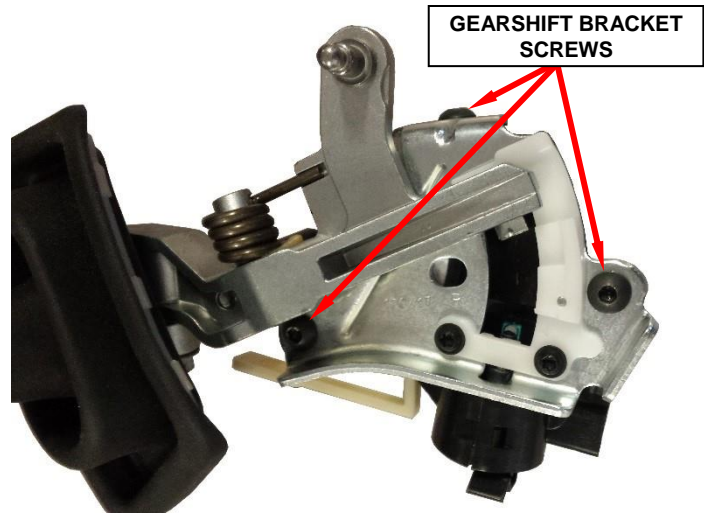


**Figure 12 – Gearshift Bracket / BTSI Assembly Screws**

19. Remove the gearshift bracket / BTSI assembly with shift lever from the steering column then transfer to bench (Figure 13).

20. Remove the upshift/downshift electrical harness from the retaining clip (Figure 13).

21. Release the upshift/downshift electrical harness retainer from the gearshift bracket / BTSI assembly (Figure 13).

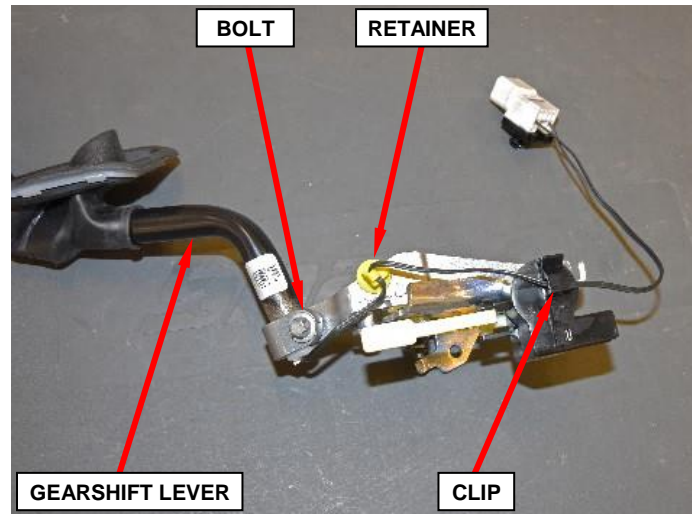


**Figure 13 – Gearshift Lever**

22. Remove and save the E10 star-head pinch bolt securing the shift lever to the gearshift bracket / BTSI assembly (Figure 13).

23. Remove and save the gearshift lever from the gearshift bracket / BTSI assembly (Figure 13).


**Service Procedure [Continued]**

24. Discard the old gearshift bracket / BTSI assembly.
25. Verify the **new** gearshift bracket / BTSI assembly to be used has a paint mark on the BTSI solenoid (Figure 14).
26. Install the gearshift lever to the **new** gearshift bracket / BTSI assembly and ensure the gearshift lever is fully inserted into the gearshift bracket (Figure 15).

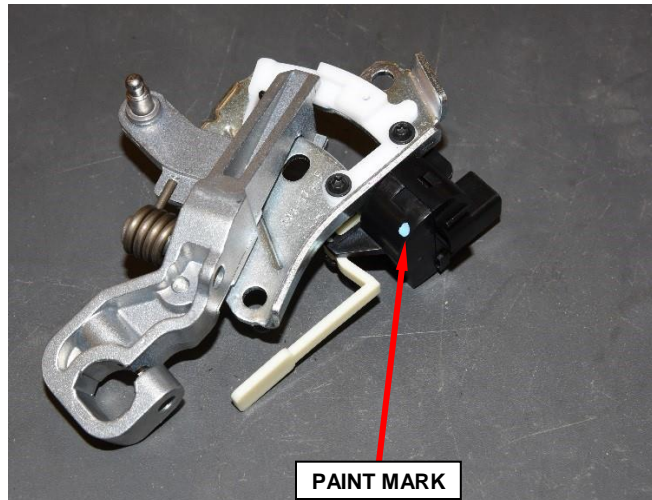

**Figure 14 – Gearshift Bracket / BTSI Assembly Paint Mark Verification**

27. Install the E10 star-head pinch bolt securing the shift lever to the gearshift bracket / BTSI assembly. Tighten the pinch bolt to 11 N·m (97 in. lbs.) (Figure 13). Ensure shift lever is properly seated and not loose after tightening.
28. Attach the upshift/downshift electrical harness retainer to the gearshift bracket / BTSI assembly (Figure 13).
29. Install the upshift/downshift electrical harness to the retaining clip (Figure 13).

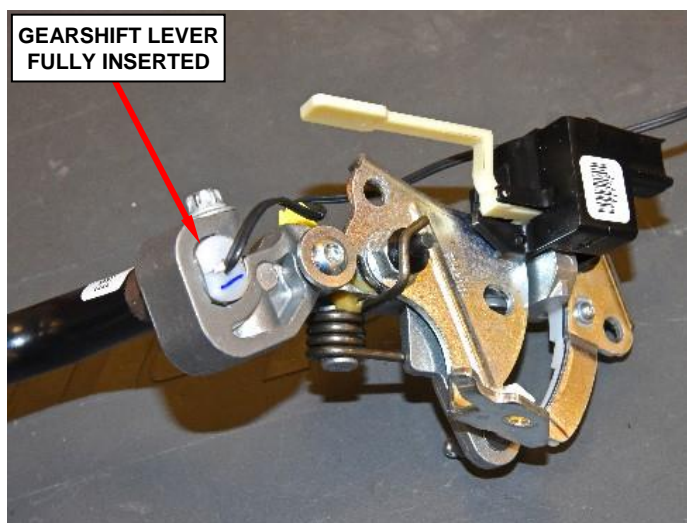

**Figure 15 – Gearshift Lever Insertion**

30. Install the gearshift bracket / BTSI assembly with shift lever to the steering column.

**Service Procedure [Continued]**

31. Install the three T27 star-head screws securing the gearshift bracket / BTSI assembly to the steering column. Tighten the screws to 10 N·m (89 in. lbs.) (Figure 12).
32. Connect the BTSI electrical harness connector (Figure 11).
33. Install the upshift/downshift electrical harness connector retainer (Figure 10).
34. Connect the upshift/downshift electrical harness connector (Figure 10).
35. Connect the shift cable to the gearshift bracket (Figure 9).
36. Carefully position the lower shroud over the steering column tilt lever and onto the steering column (Figure 8).
37. Install the T20 star-head screw that retains the lower shroud to the steering column. Tighten the screw to 2.3 N·m (20 in. lbs.) (Figure 8).
38. Attach the upper steering column shroud by pushing gently inward on both sides of the upper shroud just above the joint line to the lower shroud and attach to the lower shroud using the snap features (Figure 7).
39. Install the two T20 star-head screws that attach the lower steering column shroud to the upper shroud. Tighten the screws to 1.3 N·m (12 in. lbs.) (Figure 6).
40. Attach the shift boot to the upper and lower steering column shrouds (Figure 5).

**Service Procedure [Continued]**

41. **If equipped:** Connect the electrical connectors for any electrical devices to the steering column opening cover.
  42. Install the data link connector to the steering column opening cover by pushing the connector through the opening on the back side of the cover and fully engaging the lock tabs of the connector (Figure 4).
  43. Attach the steering column opening cover to the instrument panel with the eight spring clips (Figure 3).
  44. Install the two screws that secure the steering column opening cover to the instrument panel. Tighten the screws to 3.6 N·m (32 in. lbs.) (Figure 3).
  45. Position the hood release handle onto the steering column opening cover and fully engage the retainer clip that secures the hood release handle to the steering column opening cover (Figure 2).
  46. Connect the negative battery cable terminal to the battery(s).
- **2009 - 2012 model year vehicles.** Close the vehicle hood. The gearshift bracket / BTSI assembly replacement process is complete. Return the vehicle to the customer. Claim LOP 19-T7-91-85 and do not provide BTSI addendum card to customers with 2009 - 2012 model year vehicles.
- **2013 - 2017 model year vehicles.** Proceed to **Section C. Reprogram Body Control Module (BCM).**

**Service Procedure [Continued]****C. Reprogram Body Control Module (BCM)**

**NOTE:** If the vehicle is equipped with instrument panel mounted auxiliary switches located below the HVAC controls (AUX 1 through AUX 5 or PTO), the customer preferred switch settings may be erased during reprogramming of the BCM. It is advisable to record the customer preferred auxiliary switch settings prior to BCM reprogramming so that the customer preferred switch settings are not lost during the BCM reprogramming process.



**Figure 16 – Auxiliary Switches**

**NOTE:** The wiTECH scan tool must be used to perform this recall. The wiTECH software is required to be at the latest release level before performing this procedure. If the reprogramming flash for the BCM is aborted or interrupted, repeat the procedure. The BCM must be at the latest calibration level after completing this recall.

1. Open the hood. Install a battery charger and verify that the charging rate provides 13.0 to 13.5 volts. Do not allow the charger to time out during the flash process. Set the battery charger timer (if so equipped) to continuous charge.

**NOTE:** Use an accurate stand-alone voltmeter. The battery charger volt meter may not be sufficiently accurate. Voltages outside of the specified range will cause an unsuccessful flash. If voltage reading is too high, apply an electrical load by activating the park or headlamps and/or HVAC blower motor to lower the voltage.

**Service Procedure [Continued]**

2. Connect the wiTECH micro pod II to the vehicle data link connector.
  3. Place the ignition in the “**RUN**” position.
  4. Open the wiTECH 2.0 website.
  5. Enter your “**User id**” and “**Password**” and your “**Dealer Code**”, then select “**Finish**” at the bottom of the screen.
  6. From the “**Vehicle Selection**” screen, select the vehicle to be updated.
  7. From the “**Action Items**” screen, select the “**Topology**” tab.
  8. From the “**Topology**” tab, select the “**BCM**” icon for the module requiring updating.
  9. From the “**Flash**” tab, compare the “**Current Electronic Control Unit (ECU) Part Number**” with the “**New ECU Part Number**” listed.
    - If the “**Current ECU part Number**” is the same as the “**New Part Number**”, proceed to **Step 15**.
    - If the “**Current ECU part Number**” is NOT the same as the “**New Part Number**”, continue with **Step 10**.
- NOTE: If two BCM flash options are available, select the D-Truck software file.**
10. Read the flash special instructions page. Select “**OK**” to continue.
  11. From the flash ECU agreement page, agree to terms by checking the box.
  12. Select “**Flash ECU**” and then follow the wiTECH screen instructions to complete the flash.

**Service Procedure [Continued]**

13. Select “**Guided Diagnosis**” under the “**Activities**” column.
14. Select “**Restore Vehicle Configuration**” and click “**Continue**”, then follow the wiTECH screen instructions to complete the vehicle configuration.
15. From the “**Topology**” screen, select the “**All DTCs**” tab to view the DTCs.
16. Select “**Clear All DTCs**” and then select “**Close**”.
17. Place the ignition in the “**OFF**” position and then remove the wiTECH micro pod II device from the vehicle.
18. Remove the battery charger from the vehicle.
19. Close the vehicle hood.
20. Drive the vehicle until at least 10 MPH is achieved for 5 seconds.

**NOTE: Step 20 must be performed prior to returning the vehicle to the customer.**


21. Before returning the vehicle to the customer, confirm that the vehicle is in Customer Mode.

**NOTE: All vehicles that have software update performed will require an addendum card be provided to the vehicle owner.**

**Service Procedure [Continued]**

22. Process Steps to obtain the BTSI Addendum Card:
  - a. Access the “**DealerCONNECT**” website.
  - b. Select the “**Recall Central**” link.
  - c. Locate the “**Repair Information**” section.
  - d. Select the “**BTSI Addendum Card**” link in the Repair Information section.
  - e. Print a copy of the BTSI addendum card.
  - f. Give the addendum card to the vehicle owner and advise the vehicle owner to read the addendum card for information regarding how the new software changes the gear shift lever interlock operation for enhanced vehicle safety

**Sample: BTSI Addendum Card**



---

**2013MY-2018MY Owner Addendum Card**

The purpose of this addendum card is to explain the change in the vehicle functionality after receiving the software flash.

**Vehicle Remedy**

This vehicle received updated software that releases the Brake Transmission Interlock (BTSI) locking pin after 3 minutes of applying the brake while the vehicle is in Park.

**Impact to Owner**

When applying the brake for more than 3 minutes while the vehicle is on and in park, the vehicle will require the user to release the brake and then reapply the brake in order to shift the vehicle out of Park.

**Note: Please place this document in the Glove Box of the vehicle.**

**Completion Reporting and Reimbursement**

Claims for vehicles that have been serviced must be submitted on the DealerCONNECT Claim Entry Screen located on the Service tab. Claims paid will be used by FCA to record recall service completions and provide dealer payments.

Use one of the following labor operation numbers and time allowances:

	<b><u>Labor Operation Number</u></b>	<b><u>Time Allowance</u></b>
<b><u>2013 – 2017 ONLY</u></b> Inspect BTSI Functionality and Verify BCM Software Level	19-T7-91-81	0.2 hours
<b><u>2013 – 2017 ONLY</u></b> Inspect BTSI Functionality and Perform BCM Software Update	19-T7-91-82	0.4 hours
<b><u>2013 – 2017 ONLY</u></b> Inspect BTSI Functionality, Replace Gearshift Bracket and Verify BCM Software Level	19-T7-91-83	0.7 hours
<b><u>2013 – 2017 ONLY</u></b> Inspect BTSI Functionality, Replace Gearshift Bracket and Perform BCM Software Update	19-T7-91-84	0.9 hours
<b><u>2009 – 2012 ONLY</u></b> Replace Gearshift Bracket	19-T7-91-85	0.6 hours

Add the cost of the recall parts package plus applicable dealer allowance to your claim.

NOTE: See the Warranty Administration Manual, Recall Claim Processing Section, for complete recall claim processing instructions.

## **Dealer Notification**

To view this notification on DealerCONNECT, select “Global Recall System” on the Service tab, then click on the description of this notification.

## **Owner Notification and Service Scheduling**

All involved vehicle owners known to FCA are being notified of the service requirement by first class mail. They are requested to schedule appointments for this service with their dealers. A generic copy of the owner letter is attached.

## Vehicle Lists, Global Recall System, VIP and Dealer Follow Up

All involved vehicles have been entered into the DealerCONNECT Global Recall System (GRS) and Vehicle Information Plus (VIP) for dealer inquiry as needed.

GRS provides involved dealers with an updated VIN list of their incomplete vehicles. The owner's name, address and phone number are listed if known. Completed vehicles are removed from GRS within several days of repair claim submission.

To use this system, click on the “**Service**” tab and then click on “**Global Recall System.**” Your dealer's VIN list for each recall displayed can be sorted by: those vehicles that were unsold at recall launch, those with a phone number, city, zip code, or VIN sequence.

**Dealers must perform this repair on all unsold vehicles before retail delivery.** Dealers should also use the VIN list to follow up with all owners to schedule appointments for this repair.

*Recall VIN lists may contain confidential, restricted owner name and address information that was obtained from the Department of Motor Vehicles of various states. Use of this information is permitted for this recall only and is strictly prohibited from all other use.*

## Additional Information

If you have any questions or need assistance in completing this action, please contact your Service and Parts District Manager.

Customer Services / Field Operations  
FCA US LLC

This notice applies to your vehicle,

[Model Year and Model]

VIN XXXXXXXXXXXXXXXXXXXX

T79/NHTSA 17V-821

LOGO

VEHICLE PICTURE

#### YOUR SCHEDULING OPTIONS

**1. RECOMMENDED OPTION**

Call your authorized Chrysler / Dodge / Jeep® / RAM Dealership

**2. Call the FCA Recall Assistance Center at 1-866-220-6747. An agent can confirm part availability and help schedule an appointment**

**3. Visit recalls.mopar.com, scan the QR code below, or download the Mopar Owner's Companion App.**

QR Code

Get access to recall notifications, locate your nearest dealer, and more through this website or Mopar Owner's Companion App. You will be asked to provide your Vehicle Identification Number (VIN) to protect and verify your identity. The last eight characters of your VIN are provided above.

#### DEALERSHIP INSTRUCTIONS

Please reference Safety Recall T79.

# IMPORTANT SAFETY RECALL

## Brake Transmission Shift Interlock

Dear [Name],

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

FCA has decided that a defect, which relates to motor vehicle safety, exists in certain [2013-2017 Model Year (DS) RAM 1500 Pickup, 2013-2017 Model Year (DJ) RAM 2500 Pickup, 2013-2017 Model Year (D2) RAM 3500 Pickup, 2013-2017 Model Year (DD) RAM 3500 Chassis Cab, 2016-2017 Model Year (DF) RAM 3500 10K GVWR Chassis Cab, 2013-2017 Model Year (DP) RAM 4500/5500 Chassis Cab] vehicles equipped with a column shift automatic transmission. This safety recall does not affect vehicles equipped with a rotary or floor shifter or manual transmission.

It is extremely important to take steps now to repair your vehicle to ensure the safety of you and your passengers.

#### WHY DOES MY VEHICLE NEED REPAIRS?

The Brake Transmission Shift Interlock (BTSI) locking pin on your vehicle <sup>[1]</sup> may become stuck in the open position. A BTSI locking pin stuck in the open position may allow the transmission to be shifted out of PARK and to any gear position without depression of the brake pedal and/or without the key in the ignition, if a key is applicable. **The ability to shift the transmission out of the PARK position without a key in the ignition or a brake pedal application, increases the risk for an unintended vehicle rollaway that may result in a vehicle crash or injury without prior warning.**

**WARNING: Never use the PARK position as a substitute for the parking brake. Always apply the parking brake fully when parked to guard against vehicle movement and possible injury or damage. Refer to your owner's manual for additional information regarding proper parking brake usage.**

#### HOW DO I RESOLVE THIS IMPORTANT SAFETY ISSUE?

FCA will repair your vehicle <sup>[2]</sup> free of charge (parts and labor). To do this, your dealer will inspect the BTSI operation and replace if necessary. The Body Control Module (BCM) software will also be updated. In addition, your dealer will require your vehicle for proper check-in, preparation, and check-out during your visit. Your time is important to us; please be aware that these steps may require more time. The estimated repair time is two hours. We recommend that you schedule a service appointment to minimize your inconvenience. Please bring this letter with you to your dealership.

#### VISIT RECALLS.MOPAR.COM/HELP FOR MORE INFORMATION AND ANSWERS TO FREQUENTLY ASKED QUESTIONS

#### WHAT IF I ALREADY PAID TO HAVE THIS REPAIR COMPLETED?

If you have already experienced this specific condition and have paid to have it repaired, you may visit [www.fcarecallreimbursement.com](http://www.fcarecallreimbursement.com) to submit your reimbursement request online. <sup>[3]</sup> Once we receive and verify the required documents, reimbursement will be sent to you within 60 days. If you have had previous repairs performed and/or already received reimbursement, you may still need to have the recall repair performed.

We apologize for any inconvenience, but are sincerely concerned about your safety. Thank you for your attention to this important matter.

Customer Assistance/Field Operations  
Fiat Chrysler Automobiles US LLC



**Mr. Mrs. Customer**  
**1234 Main Street**  
**Hometown, MI 48371**

[1] If you no longer own this vehicle, please help us update our records. Call the FCA Recall Assistance Center at 1-800-853-1403 to update your information.

[2] If your dealer fails or is unable to remedy this defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., S.E., Washington, DC 20590, or you can call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [safercar.gov](http://safercar.gov).

[3] You can also mail in your original receipts and proof of payment to the following address for reimbursement consideration: FCA Customer Assistance, P.O. Box 21-8004, Auburn Hills, MI 48321-8007, Attention: Recall Reimbursement.

Note to lessors receiving this recall notice: Federal regulation requires that you forward this recall notice to the lessee within 10 days.

This notice applies to your vehicle.

[Model Year and Model]

VIN XXXXXXXXXXXXXXXXXXXX

T79/NHTSA 17V-821

LOGO

VEHICLE PICTURE

#### YOUR SCHEDULING OPTIONS

**1. RECOMMENDED OPTION**

Call your authorized Chrysler / Dodge / Jeep® / RAM Dealership

**2. Call the FCA Recall Assistance**

Center at **1-866-220-6747**. An agent can confirm part availability and help schedule an appointment

**3. Visit recalls.mopar.com, scan the**

QR code below, or download the Mopar Owner's Companion App.

QR Code

Get access to recall notifications, locate your nearest dealer, and more through this website or Mopar Owner's Companion App. You will be asked to provide your Vehicle Identification Number (VIN) to protect and verify your identity. The last eight characters of your VIN are provided above.

#### DEALERSHIP INSTRUCTIONS

Please reference Safety Recall T79.

# IMPORTANT SAFETY RECALL

## Brake Transmission Shift Interlock

Dear [Name],

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

FCA has decided that a defect, which relates to motor vehicle safety, exists in certain [2009-2012 Model Year (DS) RAM 1500 Pickup, 2010-2012 Model Year (DJ) RAM 2500 Pickup, 2010-2012 Model Year (D2) RAM 3500 Pickup, 2011-2012 Model Year (DD) RAM 3500 Chassis Cab, 2011-2012 Model Year (DP) RAM 4500/5500 Chassis Cab] vehicles equipped with a column shift automatic transmission. This safety recall does not affect vehicles equipped with a rotary or floor shifter or manual transmission.

It is extremely important to take steps now to repair your vehicle to ensure the safety of you and your passengers.

#### WHY DOES MY VEHICLE NEED REPAIRS?

The Brake Transmission Shift Interlock (BTSI) locking pin on your vehicle <sup>[1]</sup> may become stuck in the open position. A BTSI locking pin stuck in the open position may allow the transmission to be shifted out of PARK and to any gear position without depression of the brake pedal and/or without the key in the ignition, if a key is applicable. **The ability to shift the transmission out of the PARK position without a key in the ignition or a brake pedal application, increases the risk for an unintended vehicle rollaway that may result in a vehicle crash or injury without prior warning.**

**WARNING: Never use the PARK position as a substitute for the parking brake. Always apply the parking brake fully when parked to guard against vehicle movement and possible injury or damage. Refer to your owner's manual for additional information regarding proper parking brake usage.**

#### HOW DO I RESOLVE THIS IMPORTANT SAFETY ISSUE?

FCA will repair your vehicle <sup>[2]</sup> free of charge (parts and labor). To do this, your dealer will replace the BTSI. In addition, your dealer will require your vehicle for proper check-in, preparation, and check-out during your visit. Your time is important to us; please be aware that these steps may require more time. The estimated repair time is one hour. We recommend that you schedule a service appointment to minimize your inconvenience. Please bring this letter with you to your dealership.

#### VISIT RECALLS.MOPAR.COM/HELP FOR MORE INFORMATION AND ANSWERS TO FREQUENTLY ASKED QUESTIONS

#### WHAT IF I ALREADY PAID TO HAVE THIS REPAIR COMPLETED?

If you have already experienced this specific condition and have paid to have it repaired, you may visit [www.fcarecallreimbursement.com](http://www.fcarecallreimbursement.com) to submit your reimbursement request online. <sup>[3]</sup> Once we receive and verify the required documents, reimbursement will be sent to you within 60 days. If you have had previous repairs performed and/or already received reimbursement, you may still need to have the recall repair performed.

We apologize for any inconvenience, but are sincerely concerned about your safety. Thank you for your attention to this important matter.

Customer Assistance/Field Operations  
Fiat Chrysler Automobiles US LLC



**Mr. Mrs. Customer**  
**1234 Main Street**  
**Hometown, MI 48371**

[1] If you no longer own this vehicle, please help us update our records. Call the FCA Recall Assistance Center at 1-800-853-1403 to update your information.

[2] If your dealer fails or is unable to remedy this defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., S.E., Washington, DC 20590, or you can call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [safercar.gov](http://safercar.gov).

[3] You can also mail in your original receipts and proof of payment to the following address for reimbursement consideration: FCA Customer Assistance, P.O. Box 21-8004, Auburn Hills, MI 48321-8007, Attention: Recall Reimbursement.

Note to lessors receiving this recall notice: Federal regulation requires that you forward this recall notice to the lessee within 10 days.