N212333380 Rear Passenger Seat Belt Retractor Bolt Not Installed



Release Date: August 2021 Revision: 00

Attention:

It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied.

All involved vehicles that are in dealer inventory must be held and not delivered to customers, dealer traded, or used for demonstration purposes until the repair contained in this bulletin has been performed on the vehicle.

		Mode	Model Year		Model Year		
Make	Model	From	То	RPO	Description		
Cadillac	XT4	2019	2021				
Chevrolet	Malibu	2016	2021				

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	General Motors has decided that a defect which relates to motor vehicle safety may exist in certain 2016 – 2021 Chevrolet Malibu and 2019 – 2021 Cadillac XT4 vehicles. In rare cases, plant technicians performing a repair during the assembly process may not have installed a fastener required to fully
	secure a rear seat belt retractor. This condition may exist on the right-hand side of affected Malibu vehicles or either side of affected XT4 vehicles. A seat belt retractor with a missing fastener may not properly restrain an occupant, increasing risk of occupant injury in a crash.
Correction	Dealers will check that the rear seat belt retractor fastener is present and properly torqued on the right- side of affected Chevrolet Malibu vehicles and both sides of affected Cadillac XT4 vehicles. Missing or improperly installed fasteners will be replaced and torqued to specification.

Parts

Quantity	Part Name	Part No.	
1 (Malibu) 2 (XT4)	Seat Belt Retractor Bolt	11611776	

It is estimated that there are only 438 involved vehicles that will require parts being replaced. **Due to the small number** of vehicles anticipated that will need this repair and the limited initial parts availability, dealers are encouraged not to order these parts for use as shelf stock.

Reminder: Parts may be removed from Retail Inventory Management (RIM). Dealers should review the affected parts to confirm RIM managed status. Parts may have quantity limiters in effect.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9105916	Check Seat Belt Retractor Bolt and Torque to Spec XT4 (Driver and Passenger side, includes fastener replacement if necessary) Malibu (Passenger side) Add: Replace Fastener (Malibu only)	1.5 0.5 0.1	ZFAT	N/A
9105917	Customer Reimbursement Approved - For USA and Canada dealers only - For Export dealers only	N/A 0.2		*
9105918	Customer Reimbursement Denied – For USA dealers only	N/A		**

Note: To avoid having to "H" route the customer reimbursement transaction for approval, it must be submitted prior to the repair transaction.

For Export: Submit the dollar amount reimbursed to the customer in Net/Reimbursement.

^{*} For USA and Canada: Submit the dollar amount reimbursed to the customer in Net/Reimbursement. Submit \$20.00 administrative allowance in Net/Admin Allowance.

^{**} Submit \$10.00 administrative allowance in Net/Admin Allowance.


N212333380 Rear Passenger Seat Belt Retractor Bolt Not Installed



Service Procedure

Malibu

1. Remove the Quarter Window Lower Trim Finish Panel on the passenger's side of the vehicle. Refer to *Quarter Window Lower Trim Finish Panel Replacement* in SI.

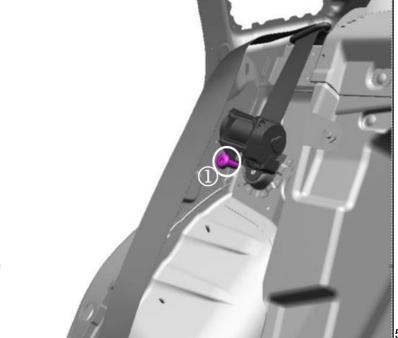

5893822


- 2. Check for the presence of a bolt at location (1), the seat belt retractor anchor.
 - If a bolt is present, using a torque wrench, ensure the bolt is torqued to 33 lb-ft (45 N-m).
 - If a bolt is **NOT** present, **OR** a bolt is present but not fully seated install a new bolt and run down the bolt until it is fully seated. These are self-tapping bolts, so it is normal for no threads to be present if the bolt is not installed.
 - Install the bolt, and then torque the bolt to 33 lb-ft (45 N-m).
- 3. Reinstall the Quarter Window Lower Trim Finish Panel. Refer to Quarter Window Lower Trim Finish Panel Replacement in SI.

XT4

1. Remove the Quarter Lower Rear Trim Panel on **both** sides of the vehicle. Refer to *Quarter Lower Rear Trim Panel Replacement* in SI.

N212333380 Rear Passenger Seat Belt Retractor Bolt Not Installed



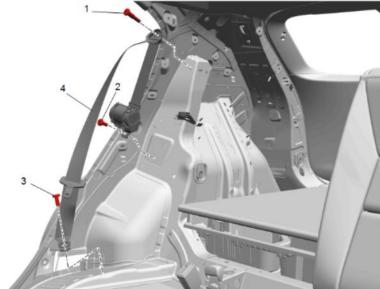

5081235

- 2. Check for the presence of a bolt at location (2), the seat belt retractor anchor, on **both** sides of the vehicle.
 - If a bolt is present, using a torque wrench, ensure the bolt is torqued to 33 lb-ft (45 N-m).
 - If a bolt is NOT present, OR a bolt is present but not fully seated, install a new bolt and run down the
 bolt until it is fully seated. These are self-tapping bolts, so it is normal for no threads to be present if the
 bolt is not installed.
 - Install the bolt, and then torque the bolt to 33 lb-ft (45 N-m).
- 3. Reinstall the Quarter Lower Rear Trim Panels. Refer to Quarter Lower Rear Trim Panel Replacement in SI.

Dealer Responsibility - For USA & Export (USA States, Territories, and Possessions)

It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied.

The US National Traffic and Motor Vehicle Safety Act provides that each vehicle that is subject to a recall of this type must be adequately repaired within a reasonable time after the customer has tendered it for repair. A failure to repair within sixty days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within a reasonable time, the customer may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation. To avoid having to provide these burdensome remedies, every effort must be made to promptly schedule an appointment with each customer and to repair their vehicle as soon as possible. In the recall notification letters, customers are told how to contact the US National Highway Traffic Safety Administration if the recall is not completed within a reasonable time.

Dealer Responsibility – All

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this recall <u>must</u> be held and inspected/repaired per the service procedure of this bulletin <u>before</u> customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Dealers are to service all vehicles subject to this recall at no charge to customers, regardless of mileage, age of vehicle, or ownership, from this time forward.

Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the dealer listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. Recall follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

N212333380 Rear Passenger Seat Belt Retractor Bolt Not Installed



In summary, whenever a vehicle subject to this field action enters your vehicle inventory you must take the steps necessary to ensure the program correction has been made before selling the vehicle. In addition, for vehicles entering your facility for service, you are required to ensure the customer is aware of the open field action and make every reasonable effort to implement the program correction as set forth in this bulletin prior to releasing the vehicle.

Dealer Reports

For dealers with involved vehicles, a listing has been prepared and will be available through GM GlobalConnect Maxis Field Action Reports or sent directly to export dealers. The Inventory tab of the dealer reports will contain VINs that apply to this recall. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will contain customer names and addresses from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than follow-up necessary to complete this recall may be a violation of law in several states.

Courtesy Transportation - For USA & Canada

Courtesy transportation is available for customers whose vehicles are involved in a product program and still within the warranty coverage period. See General Motors Service Policies and Procedures Manual for courtesy transportation program details.

Customer Notification

USA & Canada - General Motors will notify customers of this recall on their vehicle.

Export - Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act.

Customer Reimbursement

Customer requests for reimbursement of previously paid repairs to correct the condition described in the bulletin can be submitted at anytime to the dealer. See General Motors Service Policies and Procedures Manual, Product Field Action Customer Reimbursement Procedure (USA & Canada) or local Policies and Procedures, for details.