



SIB 32 04 23

2024-02-01

**RECALL 23V-770: REPLACE STEERING GEAR**

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop if the campaigns have a status of remedy available. Otherwise, please release the vehicle.

<input type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
--------------------------	--------------------------------

This Service Information Bulletin (Revision 1) replaces SI B32 04 23 **dated November 2023**.

**What's New:**

- Claim Information section updated

**MODEL**

E-Series	Model Description	Production Date
G01	X3 Sports Activity Vehicle	August 17, 2023 – September 27, 2023
G02	X4 Sports Activity Coupe	August 17, 2023 – September 27, 2023
G20	3 Series Sedan	September 20, 2023 – October 17, 2023
G42	2 Series Coupe	October 5, 2023

**AFFECTED VEHICLES**

- Vehicles which require this campaign to be completed will show it as “Open” when checked either in AIR, AWP, Campaign Summary, or Warranty Vehicle Inquiry.
- Please make sure you check your dealer inventory as soon as possible. You can see a list of affected vehicles in Inventory Campaign Details (ICD) under ROSS.

**SITUATION**

An internal component of the steering gear may not have been properly tightened during gear assembly by the supplier.

This can lead to excessive noise from within the steering gear, especially during tight corners such as when parking/maneuvering.


**CAUSE**

Manufacturing defect.

**CORRECTION**

Replace the steering gear as per AIR REP 32 13 572 Replace electrical steering box (EPS). Afterwards, initialize the steering using the latest ISTA (e.g., 4.44.3x, @ early Nov. 2023).

**PROCEDURE**

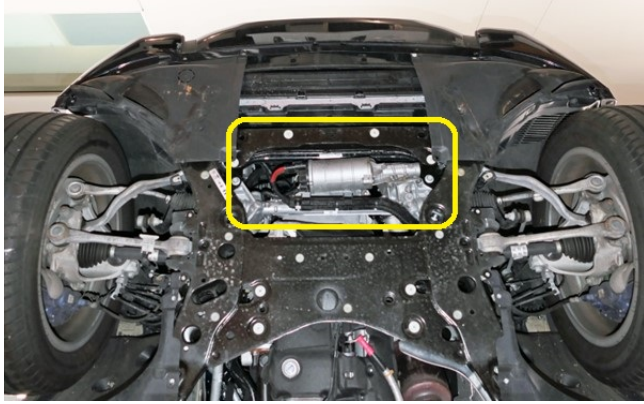

1. Raise vehicle on lift to access the steering gear (circled) beneath the vehicle.

G01 shown, G20 and G42 has a similar fitment.

2. Replace the steering gear as per AIR 32 13 572 Replace electrical steering box (EPS).

3. Perform initialization of the electromechanical steering per ISTA:

- Connect diagnostic system.
- Switch on ignition.
- Perform commissioning of the electromechanical steering.
- Service functions
- Chassis
- Electromechanical Power Steering
- EPS: Steering commissioning

## **PARTS INFORMATION**

At the start of this technical campaign, only a limited number of parts are available. Please refer to the weekly Parts Matrix for ordering information. If it's no longer on the Parts Matrix and there is no note in EPC, then the part is open for normal ordering.

**Use and invoice the part numbers below that apply.**

### **G01, G02**

Part Number	Description	Qty
32 10 5A50428	Steering gear electric ( <b>According to ETK or AIR*</b> )	1
Or		
32 10 5A50429	Steering gear electric ( <b>According to ETK or AIR*</b> )	1
07 11 9908587	Hex bolt	4
07 11 9904141	Hex bolt with flange	4
33 32 6760668	Self-cutting nut	6
31 10 6872063	Hex bolt with washer	2
07 14 7426660	Hex bolt	2
07 14 6885922	Combination bolt ASA	2
07 14 6875114	Hex bolt	2
37 10 6789678	Hex bolt with flange	2
32 30 6778609	Torx bolt	1

(\* ) To determine the "Steering gear electric" part number that applies to the specific vehicle being repaired, enter the VIN/chassis number into either ETK or AIR, this will consider the specific equipment and/or options that are fitted to the vehicle.

### **G20, G42**

Part Number	Description	Qty
32 10 5A504C7	Steering gear electric	1
Or		

Copyright ©2024 BMW of North America, Inc.

32 10 5A79679	Steering gear electric	1
07 14 6887201	Combination bolt ASA	4
07 14 6886209	Hex bolt with washer	2
07 14 6885922	Combination bolt ASA	4
33 30 6787062	Combination nut	2
33 32 6768884	Hex nut	2
32 30 6778609	Torx bolt	1

Additionally, other small parts that are not specified above, such as one-time use screws, nuts, and seals, which must be replaced according to the ISTA repair instructions/ETK, must be selected from the Electronic Parts Catalog according to the respective vehicle type and invoiced under the special Repair Code.

## CLAIM INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the work package information below that applies, and applicable part numbers listed above.

<b>Repair Code:</b>	<b>0032480300</b>	<b>G01 G02 G20 G42 Replace steering gear</b>
---------------------	-------------------	--

Below are the special flat rate labor operation code choices for this action.

### **Completion before the first vehicle delivery to a customer or the vehicle is already in the workshop**

Work Pkg	Labor Operation	Description (Plus work)	Labor Allowance
# 1	00 75 673**	Replace the steering gear, programming and encoding the vehicle control units, includes Carrying out vehicle test ( <b>00 00 556/61 21 528</b> )	As applicable
Or:			
# 2	00 75 674**	Replace the steering gear (Programming and encoding the vehicle control units was performed in conjunction with <b>another campaign/repair during the same workshop visit</b> )	As applicable

Or:

### **The vehicle arrives at your center and this Recall shows open (No other Main work will be performed or claimed during this workshop visit)**

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 3	00 75 144**	Replace the steering gear, programming and encoding the vehicle control units, includes Carrying out vehicle test ( <b>00 00 006/61 21 528</b> )	As applicable
Or:			
# 4	00 75 145**	Replace the steering gear (Programming and encoding the vehicle control units was performed in conjunction with <b>another campaign/repair during the same workshop visit</b> )	As applicable

(\*\*) Additionally, all the flat rate labor operation codes listed above also include commissioning of electromechanical steering gear (EPS) / initialization and checking and adjusting the wheel alignment  
Copyright ©2024 BMW of North America, Inc.

Only one of the flat rate labor operation codes listed above can be used for claim submission/reimbursement purposes. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

## Claim Repair Comments

Only reference the SIB number and the work package (Pkg) number performed in the RO technician notes and the claim comments (For example: B32 04 32 WP 1), unless otherwise required by State law.

## BMW Group's AIR Application Resource for Flat Rate Labor Operation Codes

To obtain the corresponding flat rate unit (FRU) allowance information from the BMW Group AIR application resource, start by entering the Chassis Number (the last seven (7) characters of the VIN, select the applicable Model if two or more vehicle choices show), or enter the full VIN (17 characters), click on the "Search" button. Next, click on the "Flat Rate Units" button and enter the flat rate labor operation code in the field to the right, click "Search" to display the Flat Rate Unit Group detail choices.

## Alternative Mobility Solution (AMS) for Vehicle Owners (RO and Claim Comments Required)

This Recall qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Repair Code in this bulletin as follows:

Sublet Code 2 - Itemize the claimed AMS sublet amount on the repair order and in the claim comment section.

Please refer to SI B01 29 16 for additional information.

## Reimbursement of Prior Customer-Pay Repairs (TREAD Act)

Based on the issue and age of the Affected Vehicles being addressed by this Safety Recall Campaign, a reimbursement request for a qualifying prior customer-pay repair is not likely.

However, if you should receive a reimbursement request from a customer for a repair that may qualify because it addressed the issue described in this bulletin, and it was performed **prior** to the notification of Recall, please contact the Warranty department (include a legible copy of the invoice) through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections. The Warranty department will respond to your inquiry accordingly.

## FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

## Supporting Materials

[picture\\_as\\_pdf B320423 23V-770-Steering Gear-FAQ-\(10Nov2023\).pdf](#)

[picture\\_as\\_pdf B320423 Recall Notice.pdf](#)



## **SAFETY RECALL NOTICE**

To: All Center Operators, Sales Managers, Service Managers, Parts Managers and Warranty Processors

RE: Recall 23V-770: Steering Gear – B32 04 23

BMW AG is conducting a Voluntary Safety Recall (effective November 10, 2023) on certain Model Year 2024 BMW vehicles that were produced between August 17, 2023, and October 17, 2023

**Please be reminded that it is a violation of federal law (The Safety Act) for you to sell, lease or deliver any new motor vehicle covered by this notification until the recall repair has been performed. This means that Centers may not legally deliver new motor vehicles to consumers until they are fixed or use/sell replacement equipment/parts subject to this recall. Note also that substantial civil penalties apply to violations of the Safety Act.**

**Also, you should not sell, lease or deliver any Certified Pre-Owned or used vehicles subject to a safety recall until the repair is completed.**

**Please follow any special instructions that we provide to you for the return or disposition of recall parts.**

We appreciate all your assistance with this Recall.

**Safety Recall**  
**23V-770**  
**Steering Gear**  
**Model Year 2024**  
**BMW X3 / X4 / 2 Series / 3 Series**  
**Issue Date: 11/10/2023**

- Q1. Which BMW Group models in the US are potentially affected by this Safety Recall?**  
Certain Model Year 2024 BMW 2 Series, 3 Series, X3, and X4 models in the US are potentially affected.
- Q2. What is the specific issue?**  
The steering gear may not have been produced according to specifications by the supplier, potentially resulting in improperly installed screws.
- Q3. Why are other models / vehicles not included in this Safety Recall?**  
Other models have a steering gear that was produced to specifications by the supplier.
- Q4. Can I continue to drive my vehicle?**  
Yes. However, when you are notified by BMW of this Safety Recall, please contact an authorized BMW center to schedule an appointment as soon as possible. For the latest updates to this Safety Recall, please visit [bmwusa.com/recall](https://bmwusa.com/recall). **If you are not the only driver of this vehicle, please advise all other drivers of this important information.**
- Q5. How did BMW Group become aware of the issue?**  
BMW Group became aware of the issue through its quality control procedures.
- Q6. How will I be informed of this Safety Recall?**  
Owners of potentially affected vehicles will be notified via First Class mail and requested to schedule an appointment with an authorized BMW center to have the remedy performed. Owners can locate their nearest authorized BMW center at [bmwusa.com/dealer](https://bmwusa.com/dealer).
- To ensure BMW has the most up-to-date contact and vehicle information, owners should register their vehicle at [bmwusa.com/myBMW](https://bmwusa.com/myBMW). Registration is free and will give them access to other information specific for their BMW vehicle. Alternatively, owners can visit [bmwusa.com/recall](https://bmwusa.com/recall) and click on “**Manage recall notices and contact information**”.
- Q7. How will my vehicle be remedied?**  
Potentially affected vehicles will have the steering gear replaced.
- Q8. Do I have to wait for BMW to contact me to have the remedy performed?**  
Yes. We are in the process of implementing this Safety Recall to ensure that the necessary parts, tools, and procedures are available. For the latest updates to this recall, please visit [bmwusa.com/recall](https://bmwusa.com/recall).