



Service Bulletin

File in Section: -

Bulletin No.: PIP5009D

Date: May, 2012

PRELIMINARY INFORMATION

Subject: Replace The Internal Transmission Wiring Harness And TCC Enable Solenoid Anytime The Transmission Is In For Service Malfunction Indicator Lamp (MIL) With DTC P0741 Set And Harsh 1-2 Shift Built between 10/01/11 And 4/30/12

Models: 2012 Chevrolet Colorado, Express, Silverado
2012 GMC Canyon, Savana, SierraAll
Equipped with Automatic Transmission 4L60E (RPO M30)
Built between 10/01/2011 and 04/30/2012

This PI was superseded to update recommended field. Please discard PIP5009C.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern:

Some customers may comment that the malfunction indicator lamp (MIL) is illuminated and the vehicle has a harsh 1-2 shift. Upon further investigation technicians may find DTC P0741 set as a current or history code in the transmission control module (TCM). This PI applies to vehicles manufactured between 10/01/11 and 4/30/12.


Recommendation/Instructions:

Important: Replace the TCC Enable Solenoid and Wire Harness part number 24237980 anytime repairs are being performed on the transmission on vehicles manufactured between 10/01/11 and 4/30/12.

Note: To prevent multiple TCC Enable Solenoid and Wire Harness replacements check the five digit date code on the TCC Enable Solenoid body to see if it has been replaced.

The first digit (month of build) should be a 4 or higher or an alpha character. The fourth digit should be a 2 (calendar year 2012). Example: 42024 shown in the picture below.

If the first digit is a 4 or higher or an alpha character (month of build) and the fourth digit is a 2 or greater (calendar year 2012) it does not need to be replaced.

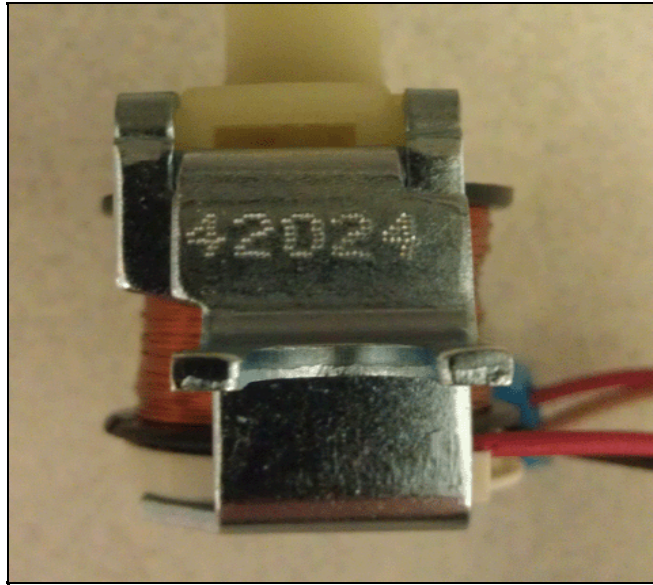

2854421

For vehicles with DTC P0741 follow the following 5 steps. For all other transmission repairs follow published diagnostics and replace the TCC Enable Solenoid and Internal Wiring Harness part number 24237980.

1. With a scan tool verify the presence of DTC P0741 and clear the DTC.
2. Remove the oil pan.
3. Remove the TCC Enable Solenoid and the internal wiring harness from the transmission.
4. Stroke the Converter Clutch Valve (224) in the pump cover the valve should freely stroke at least 3/8 of an inch. If the valve strokes at least 3/8 of an inch move to step 5. If the valve does not stroke or move freely remove Retaining Ring (222) and Valve Stop (223) to gain access to the Converter Clutch Valve. Remove the Converter Clutch Valve from the Pump Cover and inspect the valve and bore for debris and or damage.
5. Install a new TCC Enable Solenoid and Internal Wiring Harness part number 24237980.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.