

Front seat backrest trim protrudes

Topic number	LI91.10-P-055704
Version	1
Design group	91.10 Front seats
Date	03-05-2013
Validity	Model series 207 and 204.3
Reason for change	
Reason for block	

Complaint:

Gap forming between backrest cover frame and backrest padding in area of side bolster, trim protrudes (for area see Pic0).

Attachments	
File	Designation
Pic0.jpg	Area of gap formation Picture shows OK condition

Cause:

Mounting clip loosening under load.

Remedy:

Increase clip forces by gluing in a piece of felt (see Pic1).

To do this, detach seat-back lining as per instructions in WIS document AR91.10-P-1910CW and remove lower mounting bolts of cover frame.

The trim can now be pulled back at the bottom.

Cut felt to size 19mm x 30mm and glue around the catch hook (see Pic2).

Attachments	
File	Designation
Pic1.jpg	Area of clip
Pic2.jpg	Gluing felt

Symptoms
Body / Seat / Seat cover / Detaches

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A1689830092			Felt	1	25x60x4		X

Work units				
Op. no.	Operation text	Time	Damage code	Note
			91A12 38	Left front seat backrest trim loose
			91N12 38	Right front seat backrest trim loose

WIS-References			
Document number	Title	Note	Allocation
ar91.10-p-1910cw	Remove/install seat-back lining on front seat backrest		Remedy


Validity		
Vehicle	Engine	Transmission
204.302	*	*
204.303	*	*
204.331	*	*
204.347	*	*
204.349	*	*
204.357	*	*
204.377	*	*
204.388	*	*
207.302	*	*
207.303	*	*
207.322	*	*
207.323	*	*
207.347	*	*
207.348	*	*
207.355	*	*
207.356	*	*
207.357	*	*
207.359	*	*
207.372	*	*
207.373	*	*
207.388	*	*
207.402	*	*
207.403	*	*
207.422	*	*
207.423	*	*
207.447	*	*
207.448	*	*
207.455	*	*

XENTRY

207.456	*	*
207.457	*	*
207.459	*	*
207.472	*	*
207.473	*	*

Attachments

Pic0.jpg:

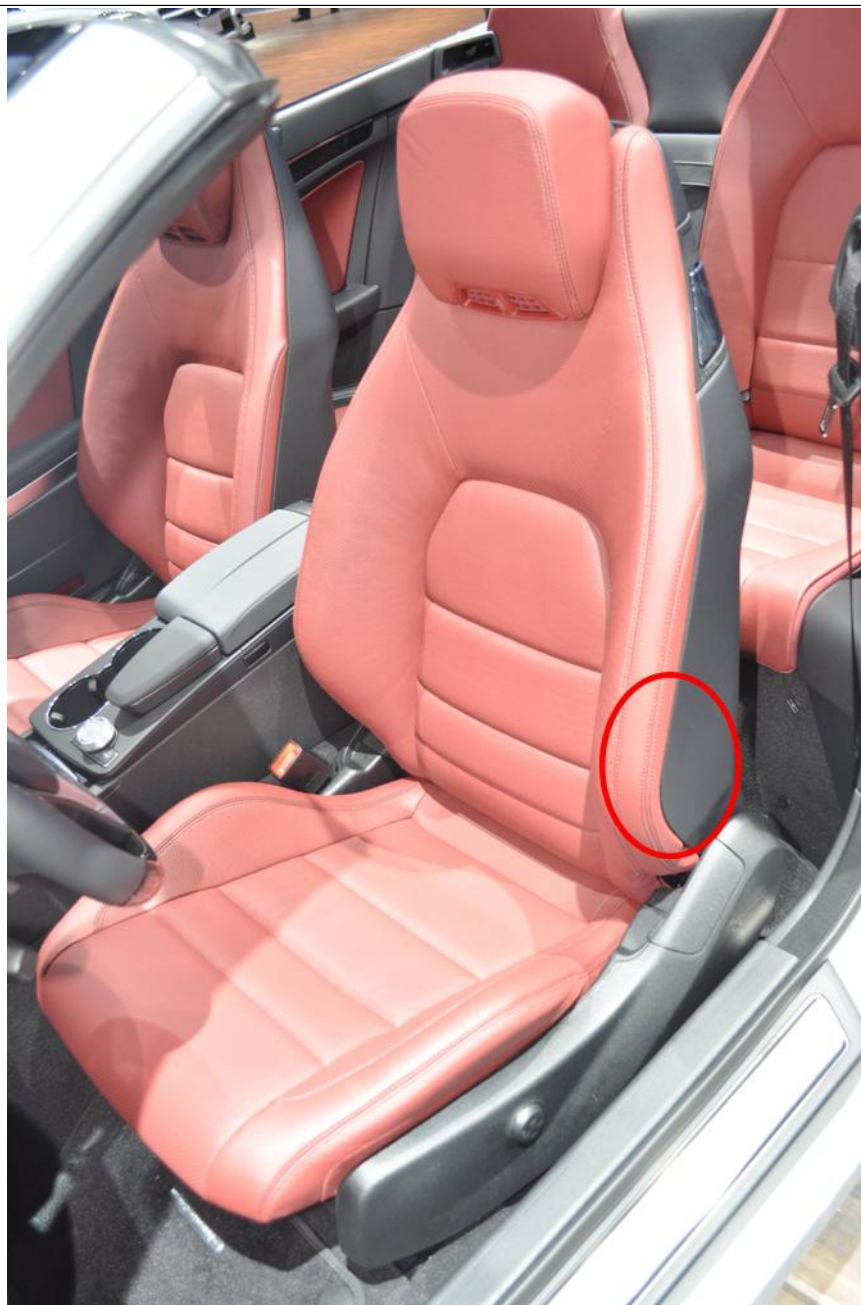

Pic1.jpg:



Pic2.jpg:

