



## VOLKSWAGEN DEALERSHIP COMMUNICATION

Date: January 2011

To: Dealer Principal, Service Manager, Parts Manager and Warranty Administrator

From: Service & Quality

Subject: Service Action 97U3 – Mailing Wave 1 of 3

2006-2007 Rabbit/R32/ GTI, 2005-2007 Jetta/Jetta Wagon, 2007-2008 Eos and 2006-2007  
Passat/Passat Wagon

Inspect Front Seat Side Impact Airbag Connectors & Install Wiring Harness Kit(s) if Necessary

**IMPORTANT NOTICE TO DEALERS - FOR IMMEDIATE DISTRIBUTION**  
**Service Action 97U3 – Mailing Wave 1 of 3**  
**Inspect Front Seat Side Impact Airbag Connectors &**  
**Install Wiring Harness Kit(s) if Necessary**

- **Problem Description:** Resistance variance within a front seat side impact airbag connector can cause the airbag indicator light on the instrument panel to come on and stay on, even though the side impact airbag system is functioning normally.
- **Repair Solution:** Inspect the driver's and right front passenger's side impact airbag connectors and, if necessary, replace one or both side impact airbag connectors with a wiring harness kit.
- **Parts Allocation:** Parts allocation will take place prior to customer notification.
- **Electronic Allocation Lists** will be posted under My Dealership Reports on the VW Hub on or about January 14, 2011. These allocation lists will include all vehicles affected by this service action, even though we will only be mailing the first wave this month.
- **Customer Notification:** The first mailing wave will take place on or about January 14, 2011, and will contain approximately 124,500 U.S. customers, and approximately 19,700 Canadian customers. There will be a total of three mailing waves, with the second in February 2011 and the third in March 2011.
- **Campaign Code Visibility** will be turned on in ElsaWeb on or about January 14, 2011 for all affected vehicles.
- **Customer Satisfaction Campaign Expiration Date:** January 14, 2013.

Dealers with additional questions about this or any other campaign should contact Warranty for assistance.

**Volkswagen Service & Quality**

**IMPORTANT!**

To ensure that ALL of your personnel are aware of this action before receiving questions from any customer, please share this information with ALL personnel who have campaign-related responsibilities, including service writers, technicians, parts employees, warranty administrators, etc.



## Frequently Asked Questions (FAQ) Customer Satisfaction Campaign 97U3

### SUMMARY

- **Campaign Code:** 97U3
- **Launch Date:** January 14, 2010
- **Code Visibility Date:** January 14, 2010
- **Customer Notification Date:** January 14, 2010
- **Circular Release Date:** January 14, 2010
- **Allocation List Release Date:** January 14, 2010
- **Affected Vehicles:** 2006-2007 Rabbit/R32/ GTI, 2005-2007 Jetta/Jetta Wagon, 2007-2008 Eos and 2006-2007 Passat/Passat Wagon
- **Number of Vehicles Affected:**  
USA: approximately 368,902  
Canada: approximately 50,664
- **Problem Description:** Over time, resistance variance within a front seat side impact airbag connector can cause the airbag indicator light on the instrument panel to come on and stay on, even though the side impact airbag system is functioning normally.
- **Corrective Action:** Inspect the driver's and right front passenger's side impact airbag connectors and, if necessary, replace one or both side impact airbag connectors with a wiring harness kit.

### Can the vehicle be driven until it is repaired?

Yes, affected vehicles can continue to be driven as usual. Customers should remember to have the airbag system inspected immediately by an authorized Volkswagen dealer if the airbag indicator light comes on. There may be something wrong with the system other than the connector issue described above.

### Is a loaner vehicle being covered under this action?

No, a loaner vehicle cannot be charged to this action. Customers requiring a loaner vehicle should be covered under the existing alternative transportation program.

### Is towing being covered under this action?

No, towing cannot be charged to this action. If towing is necessary, contact Volkswagen Roadside Assistance at 800-411-6688.

### What is the customer notification plan?

Customer notification will take place on or about January 14, 2010. The first mailing wave will take place on or about January 14, 2011, and will contain approximately 124,500 U.S. customers, and approximately 19,700 Canadian customers. There will be a total of three mailing waves, with the second in February 2011 and the third in March 2011.

### If a customer paid out-of-pocket repairs directly related, can they apply for reimbursement under this campaign?

In the event that a customer incurred out-of-pocket expenses for repairs directly related to this campaign on their vehicle, they can apply for reimbursement. Customers should refer to the reimbursement instructions enclosed with their campaign notification letter, or they can contact Volkswagen Customer CARE directly for reimbursement instructions. Very few reimbursement requests are expected, as the vehicles affected by this action are, in most cases, covered by warranty.

### Who should dealers contact if they have additional questions?

Dealers with additional questions about this or any other campaign should contact Warranty. Press inquiries should be directed to Volkswagen Public Relations.

#### IMPORTANT!

This FAQ is intended to provide supplementary information regarding this action. For additional information, please refer to the campaign circular posted on ElsaWeb and ServiceNEt. To ensure that ALL of your personnel are aware of this action before receiving questions from any customer, please share this information with ALL personnel who have campaign-related responsibilities, including service writers, technicians, parts employees, warranty administrators, etc.

## IMPORTANT INFORMATION

Please inform and provide a copy of this document to every person in your dealership with campaign-related responsibilities, including Service, Parts and Accounting personnel. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety. If you have questions regarding this or any other campaign, please contact Warranty.



# Service Action

Code: 97U3

**Subject: 2006-2007 Rabbit/R32/ GTI, 2005-2007 Jetta/Jetta Wagon,  
2007-2008 Eos and 2006-2007 Passat/Passat Wagon  
Inspect Front Seat Side Impact Airbag Connectors & Install Wiring  
Harness Kit(s), if Necessary**

January 2011

### Problem Description

Resistance variance within a front seat side impact airbag connector can cause the airbag indicator light on the instrument panel to come on and stay on, even though the side impact airbag system is functioning normally.

### Corrective Action

Inspect the driver's and passenger's side impact airbag connectors and, if necessary, replace one or both side impact airbag connectors with a wiring harness kit.

### VIN Ranges & Production Dates

**NOTE:** Check ElsaWeb on the day of repair to verify vehicle eligibility for this repair. This is the only valid campaign inquiry and verification source. Some vehicles may be involved in an additional action(s); any additional work can be done while the vehicle is in for this action.

### **U.S.A.**

#### Jetta/Jetta Wagon

3VW\_ \_ \_1K\_5M600049 - 3VW\_ \_ \_1K\_7M124448

Production date: Sept. 8, 2004 - February 12, 2007

#### GTI/Rabbit/R32

WVW\_ \_ \_1K\_6W018238 - WVW\_ \_ \_1K\_7W189959

Production date: July 1, 2005 - February 12, 2007

#### EOS

WVW\_ \_ \_1F\_7V000073 - WVW\_ \_ \_1F\_8V000386

Production date: June 7, 2006 - May 29, 2007

#### Passat/Passat Wagon (Emden)

WVW\_ \_ \_3C\_6E002717 - WVW\_ \_ \_3C\_7E169683

Production date: March 5, 2005 - February 8, 2007

#### Passat/Passat Wagon (Mosel)

WVW\_ \_ \_3C\_6P005115 - WVW\_ \_ \_3C\_7P123758

Production date: June 1, 2005 - January 26, 2007

### **CANADA**

#### Jetta/Jetta Wagon

3VW\_ \_ \_1K\_6M000660 - 3VW\_ \_ \_1K\_7M124395

Production date: June 28, 2006 - February 12, 2007

#### GTI/Rabbit/R32

WVW\_ \_ \_1K\_6W017326 - WVW\_ \_ \_1K\_7W190024

Production date: July 1, 2005 - February 12, 2007

#### EOS

WVW\_ \_ \_1F\_7V000103 - WVW\_ \_ \_1F\_7V053172

Production date: July 23, 2008 - December 2, 2008

#### Passat/Passat Wagon (Emden)

WVW\_ \_ \_3C\_6E023581 - WVW\_ \_ \_3C\_7E169664

Production date: May 20, 2005 - February 6, 2007

### Passat/Passat Wagon (Mosel)

WVW\_ \_ \_3C\_6P011801 - WVW\_ \_ \_3C\_7P121984

Production date: May 23, 2005 - January 23, 2007

**NOTE:** The VIN range is a general range of vehicles that may be included in the Campaign. Not every vehicle within the VIN range may be included since it may depend on the production date, transmission or engine build date. Always verify ElsaWeb for campaign eligibility on a vehicle.

### Allocation Report of Affected Vehicles

Electronic allocation lists will be posted under My Dealership Reports on the VW Hub on or about January 14, 2011. A list will not be posted for dealers who have no affected vehicles.

### Parts Information and Allocation

Parts allocation will take place prior to customer notification.

If you have exhausted your allocated parts but have exceeded your weekly Upper Order Limit, please submit your requests for additional parts via email to [upperorderlimits@vw.com](mailto:upperorderlimits@vw.com). If you have questions regarding parts, please contact the Parts Helpline at 800-767-6552.

### Owner Notification Mailing

On or about January 14, 2011 the customer mailing will take place. A sample copy of the owner letter is enclosed.

### Service Action Expiration Date

This action expires on January 14, 2013. Vehicles inspected/repairs under this action must have this service completed on or before January 14, 2013 to be eligible for payment. **Inspections/repairs performed after January 14, 2013 will not be eligible for payment.** Dealers should keep this expiration date in mind when scheduling customers for this action.

### Campaign Completion Labeling Guidelines

Vehicles repaired under this action must be identified with a campaign completion label (part number CAMP 010 000). Labels can be ordered at no cost online via the Compliance Label Ordering portal at [www.vwvhub.com](http://www.vwvhub.com).

### Claim Entry Procedure

Immediately upon completion of the repair work, enter the Applicable Criteria ID and Repair Operation from the following chart. **The Applicable Criteria ID is shown in ElsaWeb.** Claims will only be paid for vehicles that show this campaign open in ElsaWeb on the day of the repair. To help ensure prompt and proper payment, attach the screen print to the repair order.

## Saga Claim Entry Procedure

Check ELSAWeb to determine whether the “97U3” campaign is open.

**Service No.: 97U3**

**Damage Code: 0099**

**Parts Manufacturer – Removed part: WWO**

**Claim Type**

Sold vehicle = 710

Unsold vehicle = 7 90

**Accounting Instructions**

**Criteria I.D. 01** Check driver's and passenger's side impact airbag connectors – both seat wiring harnesses previously repaired; No further work required

**Repair operation: 0183 00 99 20 T.U.**

**OR**

**Criteria I.D. 01** Check driver's and passenger's side impact airbag connectors – one side seat wiring harness previously repaired; repair opposite side seat wiring harness

**Repair operation: 9766 23 99 100 T.U.**

<u>Qty</u>	<u>Part Number</u>	<u>Description</u>
1	5K0 998 582	Wiring harness repair kit (Includes both sides)

**OR**

**Criteria I.D. 01** Check driver's and passenger's side impact airbag connectors; repair both side seat wiring harnesses

**Repair operation: 9766 24 99 170 T.U.**

<u>Qty</u>	<u>Part Number</u>	<u>Description</u>
1	5K0 998 582	Wiring harness repair kit (Includes both sides)

***There is NO reimbursement for Vehicle Wash or loaner!***

**If Customer Refuses Repairs:**

Fax the Repair Order to the warranty team at (248) 754-6533 (U.S) and (905) 428-4811 (CAN). Provide the VIN, applicable Service Number, customer information, Dealer number, and date

## Customer Letter Example (United States)

<CUSTOMER NAME>  
<CUSTOMER ADDRESS>  
<CUSTOMER CITY STATE ZIPCODE>

Vehicle Identification Number (VIN): <VIN>

January 2011

**Subject: Service Action 97U3/T3  
Inspect Front Seat Side Impact Airbag Connectors & Install Wiring Harness Kit(s), if Necessary**

Dear Volkswagen Owner,

We are writing to inform you of a service action repair that is available for your vehicle free of charge. Our records show that your vehicle was built within the production date range of vehicles that may experience an issue with one or both front seat side impact airbag connectors.

### What is the problem?

Resistance variance within a front seat side impact airbag connector can cause the airbag indicator light on the instrument panel to come on and stay on, even though the side impact airbag system is functioning normally. Please remember to have the airbag system inspected immediately by an authorized Volkswagen dealer if the airbag indicator light comes on. There may be something wrong with the system other than the connector issue described above.

### What will Volkswagen do?

At no cost to you, we will inspect and, if necessary, install a wiring harness kit that will help prevent this issue from occurring in your vehicle. Both the inspection and repair (if needed) will take about two hours and will be free of charge. Your dealer can also address any other concerns you may have with your vehicle at this service visit.

This no-cost repair action will only be available until January 14, 2013, and we encourage you to contact your authorized Volkswagen dealer and arrange for an appointment at your earliest convenience. As stated in your Owner's Manual, please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule. Dealers will not be able to perform this work free of charge after January 14, 2013.

### Lease Vehicles

If you are the lessor and registered owner of the vehicle identified in this action, please forward this information immediately via first-class mail to the lessee within ten (10) days of receipt of this notification.

### Have you changed your address or sold the vehicle?

If you have, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

### Reimbursement of Expenses

If you have previously paid for repairs to the driver's or right front passenger's side impact airbag connectors due to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

### Service help from us

If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please call or write to:

*Volkswagen of America, Inc.*  
**Attn: Customer CARE Center – Hills East (97U3/T3)**  
3499 West Hamlin Road  
Rochester Hills, MI 48309  
1-800-893-5298

We also invite you to visit our website at [www.vw.com](http://www.vw.com), where you can check to see if this or any other action may be open on your vehicle.

We appreciate the opportunity to update your vehicle so that it will continue to meet your high expectations. Thank you for driving a Volkswagen!

Sincerely,

Volkswagen Service & Quality

The information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2011 Volkswagen Group of America, Inc. and Volkswagen Canada Inc. All Rights Reserved.

## Customer Letter Example (Canada)

<CUSTOMER NAME>  
<CUSTOMER ADDRESS>  
<CUSTOMER CITY STATE ZIPCODE>

**Vehicle Identification Number (VIN):** <VIN>

January 2011

**Subject: Service Action 97U3/T3  
Inspect Front Seat Side Impact Airbag Connectors & Install Wiring Harness Kit(s), if Necessary**

Dear Volkswagen Owner,

We are writing to inform you of a service action repair that is available for your vehicle free of charge. Our records show that your vehicle was built within the production date range of vehicles that may experience an issue with one or both front seat side impact airbag connectors.

### **What is the problem?**

Resistance variance within a front seat side impact airbag connector can cause the airbag indicator light on the instrument panel to come on and stay on, even though the side impact airbag system is functioning normally. As stated in your Owner's Manual, please remember to have the airbag system inspected immediately by an authorized Volkswagen dealer if the airbag indicator light comes on. There may be something wrong with the system other than the connector issue described above.

### **What will Volkswagen do?**

At no cost to you, we will inspect and, if necessary, install a wiring harness kit that will help prevent this issue from occurring in your vehicle. Both the inspection and repair (if needed) will take about two hours and will be free of charge. Your dealer can also address any other concerns you may have with your vehicle at this service visit.

This no-cost repair action will only be available until January 14, 2013, and we encourage you to contact your authorized Volkswagen dealer and arrange for an appointment at your earliest convenience. Please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule. Dealers will not be able to perform this work free of charge after January 14, 2013.

### **Lease Vehicles**

If you are the lessor and registered owner of the vehicle identified in this action, please forward this information immediately via first-class mail to the lessee within ten (10) days of receipt of this notification.

### **Have you changed your address or sold the vehicle?**

If you have, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

### **Reimbursement of Expenses**

If you have previously paid for repairs to the driver's or right front passenger's side impact airbag connectors due to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

### **Service help from us**

If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please call or write to:

*Volkswagen Canada*  
**Attn: Customer CARE Center (97U3/T3)**  
*P.O. Box 842, Stn. A*  
*Windsor, ON N9A 9Z9*  
*1-800-893-5298*

We also invite you to visit our website at [www.vw.ca](http://www.vw.ca), where you can check to see if this or any other action may be open on your vehicle.

We appreciate the opportunity to update your vehicle so that it will continue to meet your high expectations. Thank you for driving a Volkswagen!

Sincerely,

Volkswagen Service & Quality



## Campaign Work Procedure

## 97U3 Service Action

If there are questions regarding the work procedure, contact Warranty for U.S. and the Technical Assistance helpline for Canada

### Required Parts:

<u>Quantity</u>	<u>Part Number</u>	<u>Part Description</u>
1	5K0 998 582	Wiring harness repair kit
Up to 2	Shop supply	Zip tie(s)
1	CAMP 010 000	Campaign Completion Label

### Required Tools:

		⇐ VAS 1978B – Wiring Repair Kit
		⇐ VAS 1978/1-2 – Crimping Pliers (Base tool)  ( This tool is included in the –VAS 1978B-Wiring Repair Kit)
		⇐ VAS 1978/1-1 – Exchangeable Head, 0.35-2.5mm  ( This tool is included in the –VAS 1978B-Wiring Repair Kit)

	<p>⇐ UTI-100SI Ultratorch or equivalent</p> <p>(This tool is included in the –VAS 1978B-Wiring Repair Kit)</p>
	<p>⇐ VAS 6281 or VAS 6229 – Airbag Adapter</p>

## Work Sequence

### Section A – Check for Previous Repair



Tip: If Campaign Completion label is present, no further work is required



Tip: Perform procedure on both front seats

- Position seat into upper-most position via the height adjustment

⇐ Look under each seat to inspect for the Yazaki connector –arrow- contained in seat wiring

⇐ If connector –arrow- is contained in either one or both seat wiring, continue to Section B



Tip: The Yazaki connector –arrow- may or may not be contained in holder as pictured







⇐ If Yazaki connector (previous picture) has been removed and seat wiring harness repaired as pictured, Work Complete for that seat, reposition seat to customer original setting(s)



Tip: It is possible that one seat may have been previously repaired and no work required for that seat



Tip: The seat wiring harness repair may or may not be contained in holder as pictured

- If both sides have been completed continue to **section F**

## Section B – Remove Front Seat Bolts



Tip: For vehicles with electric seats, remove seat bolts prior to disconnecting the battery



Tip: Perform procedure on both front seats based on findings from Section A

- Position seat into front-most position via the fore/aft adjustment

⇐ Remove seat frame bolts -arrows-

- Position seat as far back as possible using fore/aft adjustment
- Move seat approximately 4 cm (1.5 in) forward to align frame with bolts

⇐ Remove seat frame bolts -arrows-



### **WARNING:**

Do not disconnect seat harness until battery Ground (GND) strap has been disconnected.

- Continue to **Section C**



## Section C – Disconnect Battery




Tip: Record all radio pre-sets and Comfort settings



### **WARNING:**

Negative battery cable must be disconnected first to prevent triggering the Pyrotechnic Battery Isolator

Triggering the Pyrotechnic Battery Isolator is not covered under this action

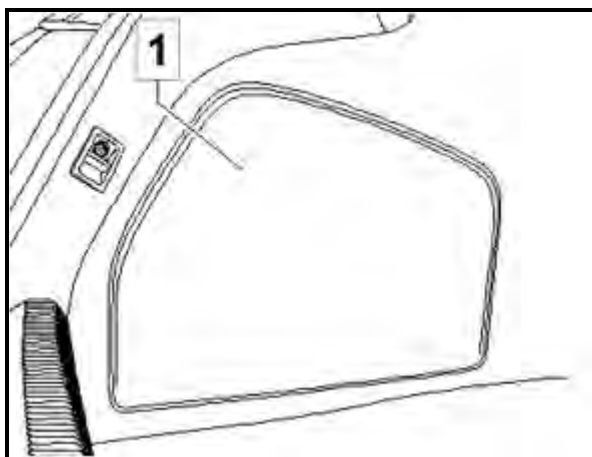

- Turn off all electrical consumers
- Switch ignition off and remove key




Tip: Before disconnecting battery, disable alarm


### For 3.6L Passat:

- Open trunk
- ⇐ Unclip and remove battery service cover -1-

### For all other vehicles:

- Open hood
- ⇐ If equipped, open locking mechanism -arrow- and remove battery box cover

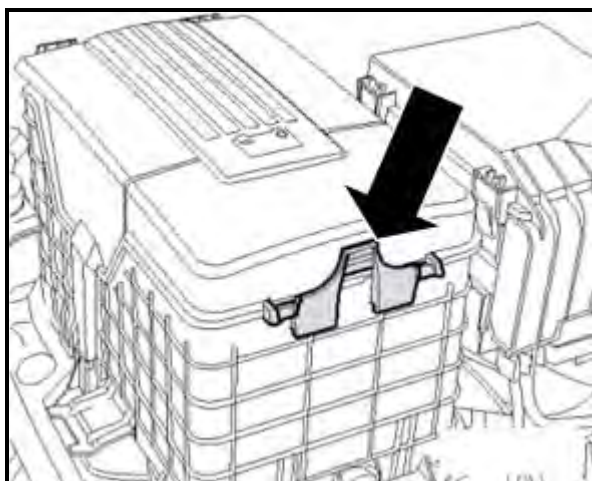

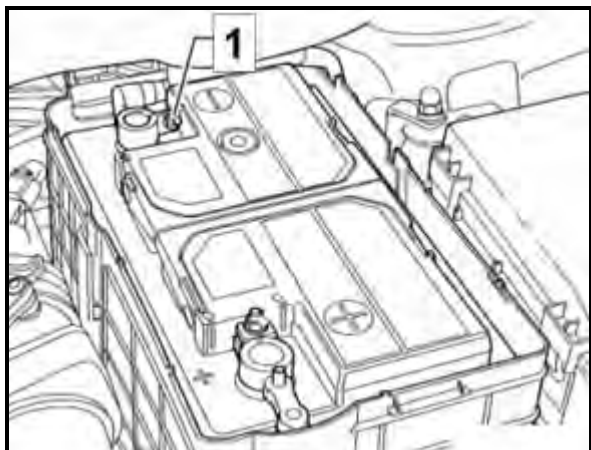

⇐ Disconnect battery terminal clamp of Ground (GND) wire -1- from battery Ground (GND) terminal

- Continue to **Section D**

## Section D – Wiring Repair




### WARNING:

Electrostatic discharges can lead to an unintended deployment of airbag. Therefore, technician must discharge static electricity from the body before separating ignition and ground wiring. This is done, e.g., by briefly touching the vehicles' body or the door striker or pin



Tip: Perform procedure on both front seats based on findings from Section A

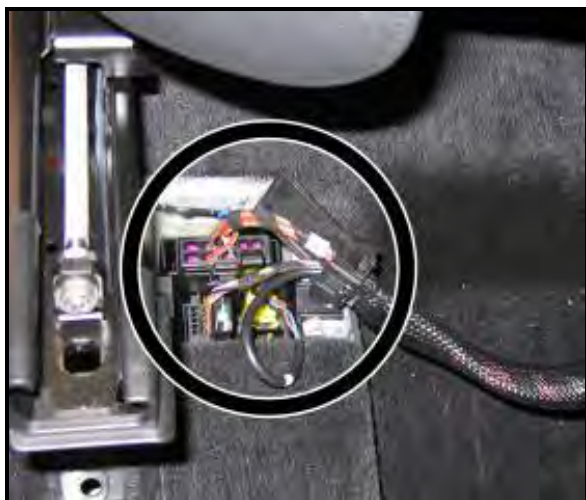

⇐ Carefully separate connectors –circle- from harness to side airbag igniter (-N199- driver seat) and (-N200- passenger seat)



⇐ Depending on vehicle equipment, connect –VAS 6281- or –VAS 6229- to side airbag wiring harness

- Carefully remove front seat(s) from vehicle, then place them on a clean surface



**Note:** Protect interior trim and seat from damage prior to removing or installing seat. Damage to seat or trim is not covered under this action




**Tip:** Pictures are used to illustrate connector location only, seat does not have to be disassembled for repair



#### **Rabbit / new GTI / Eos ONLY:**

⇐ Remove male and female side connectors –arrow- (T3K –N199- driver side), (T3L –N200- passenger side, as shown) by cutting one wire at a time and as close to the connector as possible, discard connector(s)

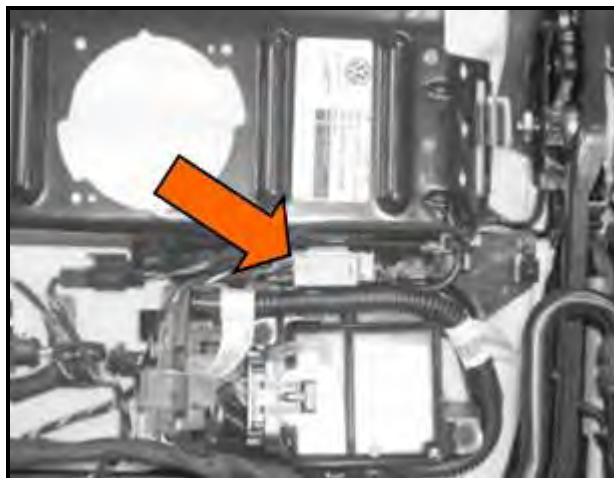

#### **Jetta ONLY:**

⇐ Remove male and female side connectors –arrow- (T3aa, T3ab, as shown) by cutting one wire at a time and as close to the connector as possible, discard connector(s)





#### Passat ONLY:

- ⇐ Remove male and female side connectors –arrow- (T3 –N199- driver side), (T3a –N200- passenger side, as shown) by cutting one wire at a time and as close to the connector as possible, discard connector(s)




- ⇐ Set –VAS 1978/3- wire stripper to 6mm and strip insulation from the end of each wire as shown



- ⇐ Insert each stripped wire into butt connector of corresponding repair wire and crimp butt connector as shown using –VAS 1978/1-2- crimping tool pliers with –VAS 1978/1-1- crimp head using 0.35mm-0.5mm (yellow dot) setting



Tip: The repair kit wiring matches the igniter side of the harness

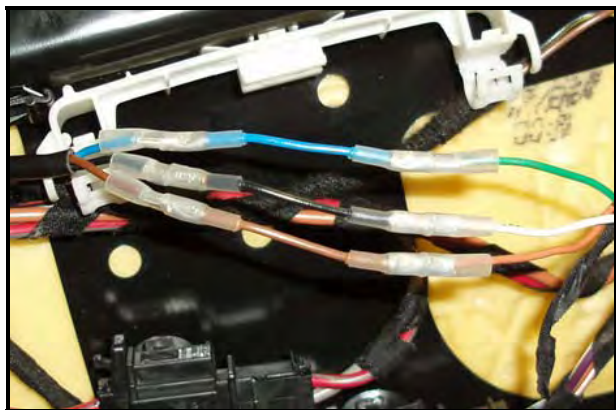

⇐ Continue to crimp each repair wire onto the correct seat wiring as shown in picture and as listed in table below:

Seat harness wire	Repair wire	Seat harness wire	Wire Size
Blue	Blue	Green	0.5mm
Black	Black	White	0.5mm
Brown	Brown	Brown	0.5mm



**WARNING:**


Incorrect wiring repair or routing may result in unintended airbag deployment



⇐ Set up the UTI-100SI Ultratorch tool or equivalent from the –VAS 1978B- wire harness repair kit as shown in picture



**Tip:** Follow manufacturer instructions provided with the UTI-100SI Ultratorch tool for proper set up, safety and use of the tool

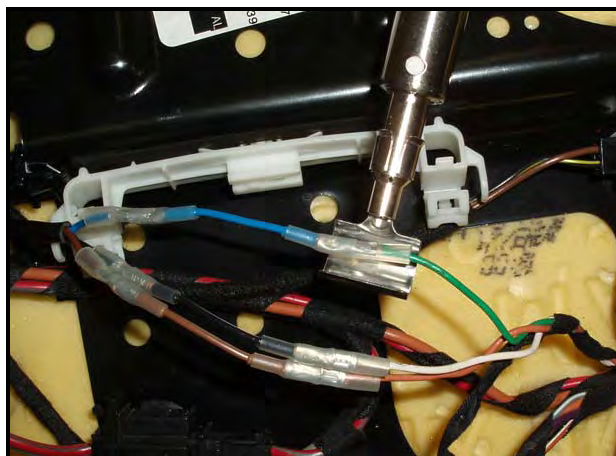

⇐ Using the UTI-100SI Ultratorch tool, heat the open end of each butt splice until tubing shrinks over the wire and the glue starts to protrude from the butt connector



**Note:** Do not overheat butt connector to a point where the glue no longer provide a water tight seal




**Tip:** To understand how a properly crimped and heated butt connector should look, utilize the inner side of the butt connector of the repair wire for visual reference





- ⇐ Wrap repaired area of harness with yellow tape and re-secure into holder (if equipped) as shown

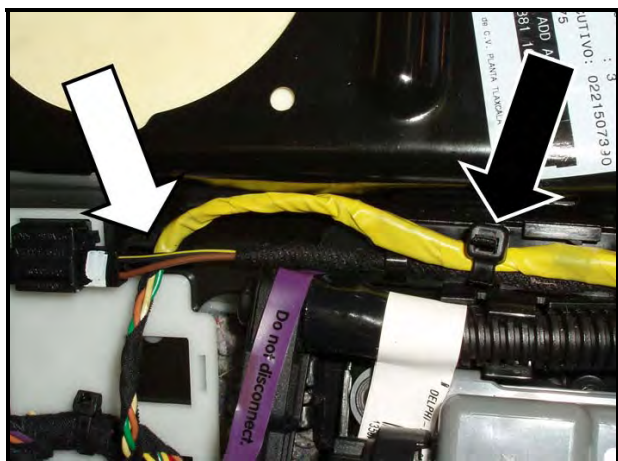

- ⇐ For seats without holder (previous illustration), it may be necessary to utilize a zip tie (shop supply) as shown –black arrow-, and/or route harness under existing wiring as shown –white arrow-


**Note:** Do not disconnect wiring connectors that are clearly labeled as such (e.g. purple tape)

- Continue to **Section E**

## Section E – Reinstall Front Seat(s) and Reconnect Battery Ground Strap

**Note:** Protect interior trim and seat from damage prior to removing or installing seat. Damage to seat or trim is not covered under this action


- Carefully lift seat into vehicle
- ⇐ Carefully reconnect connectors –circle- for harness to side airbag igniter (-N199- driver seat) and (-N200- passenger seat)

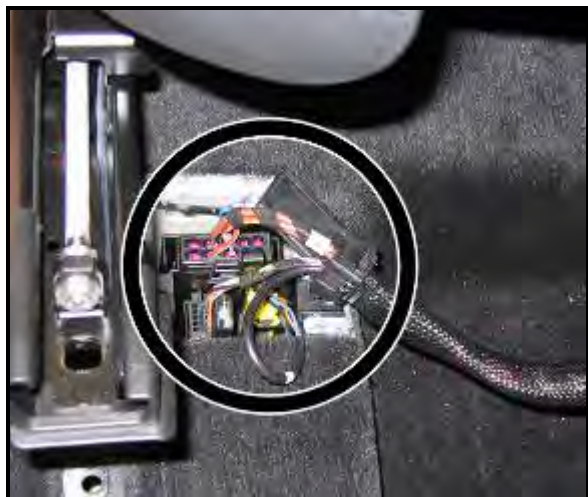



Tip: Centering pins on tunnel side must be located in corresponding holes in vehicle floor


⇐ Reinstall and tighten screws -arrows- to 40 Nm (30 lb-ft)

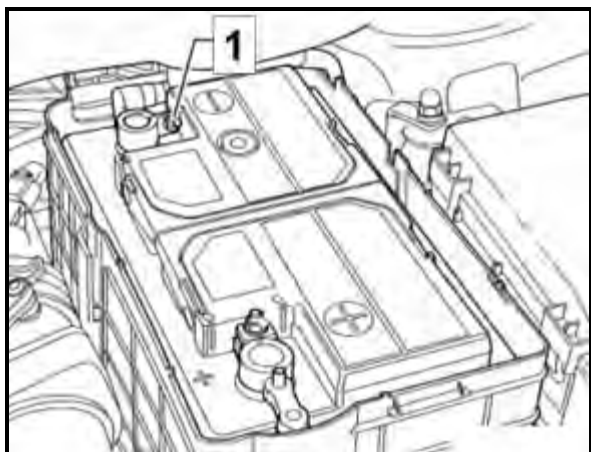

### **WARNING:**


Ignition must be on when connecting battery. If pyrotechnic components (e.g., airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting the battery. Make sure that no persons are in the vehicle.

- Switch on ignition
- ⇐ Connect battery terminal clamp of Ground (GND) wire -1- to battery Ground (GND) terminal

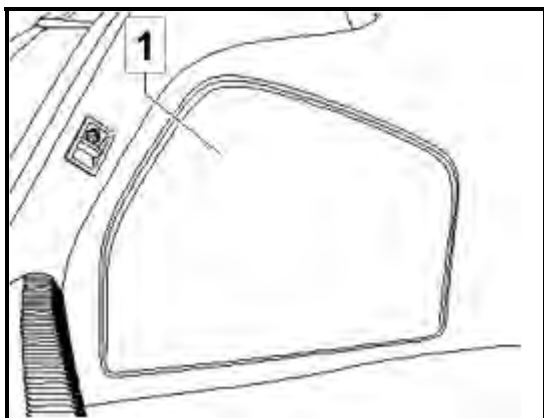

### For 3.6L

- ⇐ Reinstall battery service cover -1- and clip properly in place
- Close trunk

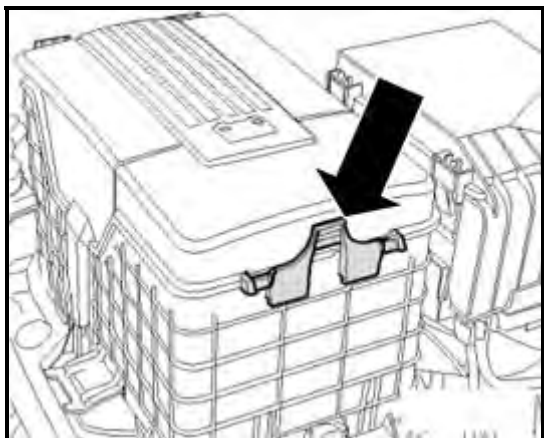

#### For all other vehicles

- ⇐ Reinstall battery box cover and close locking mechanism -arrow-



- ⇐ Position seat into front-most position via the fore/aft adjustment
- ⇐ Reinstall bolts -arrows- and torque to 40 Nm (30 lb-ft)



Tip: Reposition seat to normal position for customer and restore all radio pre-sets and comfort settings

- The following work steps after reconnecting battery may be necessary:



Note: After connecting battery and switching on ignition, ASR/ESP Control Lamp -K155- and Electro-mechanical Power Steering Indicator Lamp light up continuously.

Control lamps go out automatically when vehicle is driven a distance straight ahead at 15 to 20 km/h, which reactivates Steering Angle Sensor -G85

- Switch on ignition using ignition key or start button and switch off again
- Read DTC memory and clear faults
- Clock:
  - Check clock time setting, set anew, if necessary

- Electrical window regulators:
  - Open and close windows to each end stop respectively
  - With window closed, pull switch until relay switches audibly
  - Check comfort switching of power window; while comfort switching is operated, window must close without holding the switch
- Front windows “One touch feature.” With vehicle idling:
  - Fully open both front windows
  - Fully close both front windows
  - Fully open both rear windows (Jetta / Eos Only)
  - Fully close both rear windows (Jetta / Eos Only)
- Electronic front seat (if equipped) “Soft stop” function (Jetta / Eos Only). With vehicle idling:
  - Hold seat “forward/backward” switch in forward position until front seat moves fully forward and seat stops
  - Release switch
  - Hold seat “forward/backward” switch in forward position to ensure front seat is in fully forward position
  - Release switch to confirm forward soft stop position is learned
  - Hold seat “forward/backward” switch in backward position until front seat moves fully backward and seat stops
  - Release switch
  - Hold seat “forward/backward” switch in backward position to ensure front seat is in fully backward position
  - Release switch to confirm backward soft stop position is learned
  - Hold seat “upward/downward” switch in upward position until front seat moves to the full upward position
  - Release switch to confirm upward soft stop position is learned
  - Hold seat “upward/downward” switch in downward position until front seat moves to

full downward position

- Release switch to confirm downward soft stop position is learned
- Repeat for other front seat

- Check function:
  - All electrical consumers

## Section F – Install Campaign Completion Label

- ⇐ Fill out and affix Campaign Completion label, part number CAMP 010 000, next to the vehicle emission control information label

- Close hood



Tip: Ensure Campaign Completion label does not cover any existing label(s)

Campaign Completion	
SAGA CODE:	
DLR #:	
REPAIR DATE:	
CAMP 010 000	

## SECTION G – Parts Return/Disposal

Properly destroy and dispose of removed parts in accordance with all state/local/provincial requirements

## ALL WORK IS COMPLETE