



Service Bulletin

File in Section: -

Bulletin No.: PI0916A

Date: April, 2013

PRELIMINARY INFORMATION

Subject: Floor/Carpet Wet at Front Passenger Side Under Dash, or at Any Front/Rear Footwell Area


Models: 2012-2013 Chevrolet Caprice PPV

Attention: Corporate Bulletin Number 09-01-39-007A addresses the same front floor/carpet wet condition, but the cause is specific to air conditioning usage and may be unrelated to the cause and repair shown in this PI.

This PI is being revised to update the Condition/Concern and Recommendation/Instructions and add Condition/Concern and Recommendation/Instructions #2. Please discard PI0916.

Condition/Concern #1

Some customers may comment on finding the floor/carpet wet at the front passenger side under the dash. The cause of this condition may be one or both of the following causes:

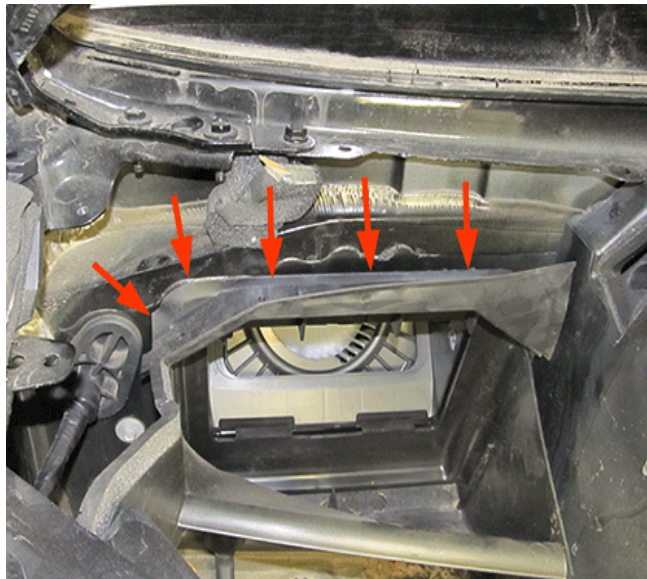

3291073

- Water intrusion in the seam (1) between the HVAC case and the cowl.



3291074

- For some police equipped vehicles, water may run on the wire harness exiting the HVAC case, then follow along the conduit into a grommet/hole (shown circled in the graphic above) in the cowl, and finally run into the vehicle interior.

Recommendation/Instructions #1

Note: If the leak path is verified specific to a side door water leak, move ahead to Recommendation/Instructions # 2 to repair the door water leak.

First verify the customer condition, then seal the leak area(s) following the steps below.



3291075

1. Remove the upper and lower air inlet grille panel. Refer to Air Inlet Grille Panel Replacement (Lower Panel) in SI.




3291076

2. Inspect the seam at the top of the HVAC case, where the case sits against the cowl. The seam is commonly not sealed in this area and water coming off the windshield may find a path behind the case and leak into several places in the interior under the dash.



3291077


3. Apply windshield urethane, such as *Kent Industries Speed Set Windshield Sealant P/N P10545, or equivalent, to the seam to seal the top of the HVAC case to the cowl.

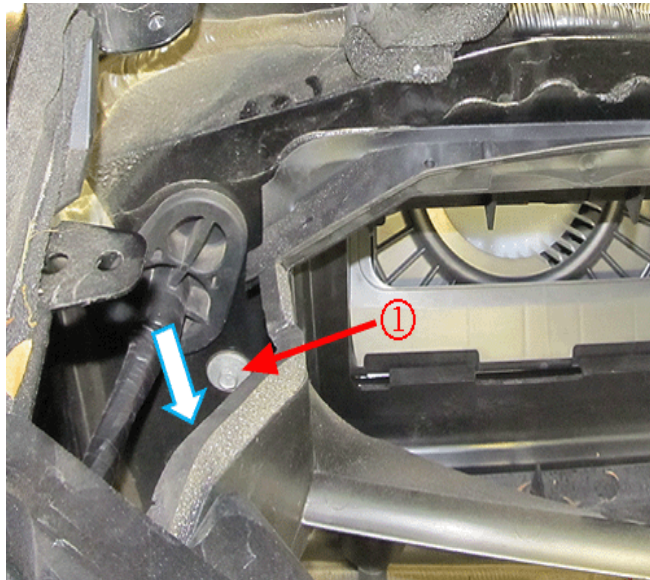

3291078


Note: Due to varying content on some police equipped vehicles, the wiring harness size and routing may vary slightly from that shown in the following graphics.

4. Inspect the cowl area outside the HVAC case for the possible existence of a wiring harness associated with certain police equipped vehicles. If equipped, the grommet/hole location for the harness will be just below the bolt (1) shown in the graphic above.

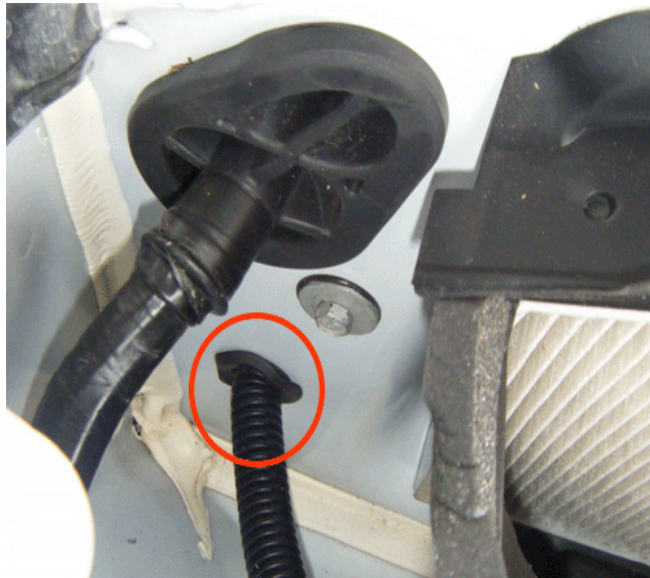

3291074

5. If equipped with the additional harness, complete the following repair steps:

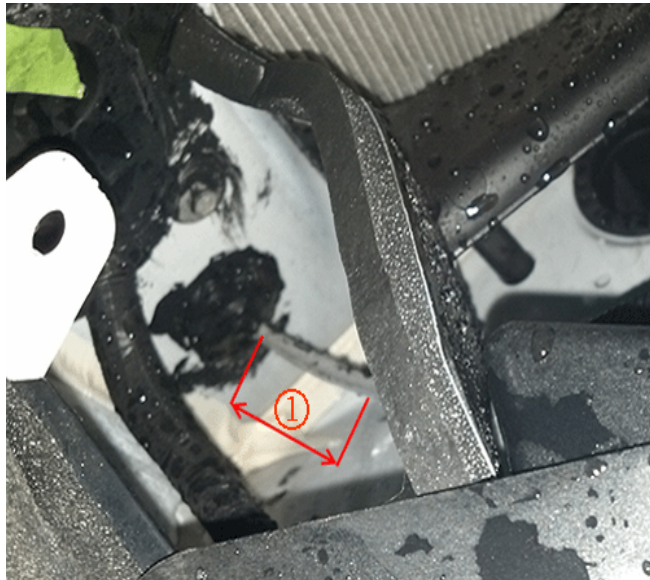

3291079

- 5.1. Remove an approximate 50-76 mm (2.0-3.0 in) length (1) of the conduit from the lower end of the wire harness.
- 5.2. Fully seat the grommet holding the wire harness in place at the cowl.



3291082

- 5.3. Apply windshield urethane to the cowl and grommet to seal the wire harness to the hole through the cowl.
6. Reinstall the upper and lower air inlet grille panels. Refer to Air Inlet Grille Panel Replacement (Lower Panel) in SI.

*We believe this source and their products to be reliable. There may be additional manufacturers of such products/ materials. General Motors does not endorse, indicate any preference for, or assume any responsibility for the products or material from this firm or for any such items that may be available from other sources.

Parts Information

Speed Set™ Windshield Sealant is available from Kent Automotive at 1-888-YES-KENT or online at www.kent-automotive.com.

Part Number	Description
P10545	Speed Set™ Windshield Sealant

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B6844*	Seal HVAC Case Seam to Cowl	0.4 hr
Add	Seal Wiring Harness Grommet to Cowl	0.1 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.

Condition/Concern #2

Some customers may comment on finding the floor/carpet wet at any front or rear footwell area.



3392287

The cause of this condition may be that water, normally being channeled through a side door, may bypass an improperly sealed water deflector and create a leak path into the vehicle. Because of the increased mirror/window switch wiring harness content, this condition most commonly occurs at the driver door, but may occur at any front or rear side door.


Recommendation/Instructions #2

Note: Due to varying content added to some police equipped vehicles at different times, the side door trim panel(s) and water deflector(s) may be removed and reinstalled several times. Any time the trim panel is removed for any reason, the water deflector should be inspected for proper sealing.



3392290

1. If a side door leak is verified, remove the trim panel on the affected door. Refer to Front or Rear Side Door Trim Panel Replacement in SI.

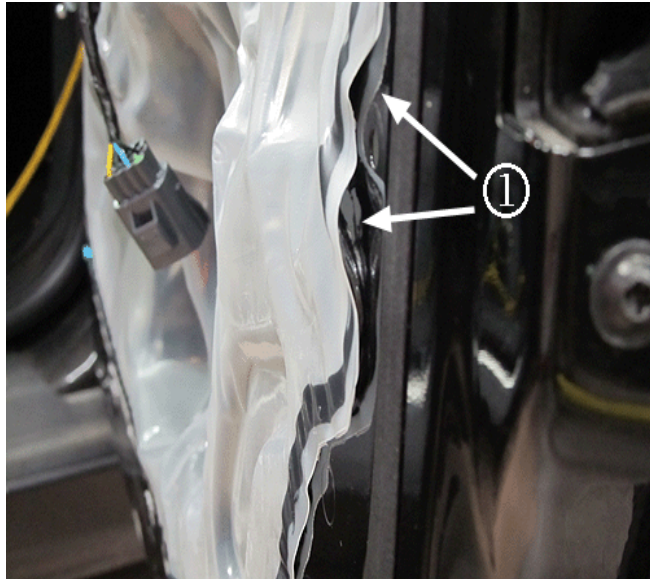

3392291

2. Inspect the door water deflector for any puckers/gaps (1) where the butyl adhesive may have pulled away from the inner door surface.



3392292

3. If puckers or gaps are evident, pull the water deflector away from the sheet metal to release the butyl adhesive along the bottom and lower corners.
4. Apply a bead of *Kent Automotive Windshield Butyl Tape P/N P20230. or equivalent, above the existing butyl on the water deflector.




3392294

5. Reposition the water deflector to the sheet metal, pressing the butyl adhesive to eliminate any puckers or gaps in the water deflector.



3392297

6. For a higher level of assurance of a complete seal of the deflector to the door surface, using a hand held roller or similar tool, "wet-out" the butyl adhesive around the complete perimeter of the water deflector.

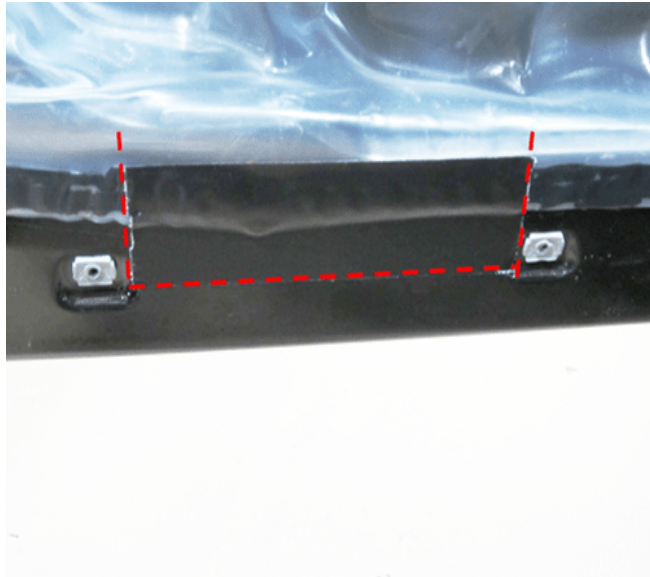

3392300

7. As shown in the graphic above, add a piece of duct tape over the bottom edge of the water deflector. Position the tape between the trim panel retainer holes in the sheet metal and ensure it is not visible below the trim panel, once installed.



3392841

8. If repairing a leak at the driver door, inspect the routing of the mirror and window switch harnesses before installing the trim panel:




3392307



3392311

Important: The correct harness routing is shown in the first graphic above. An example of an incorrect routing is shown in the second graphic.

- 8.1. Ensure the harnesses are routed as shown in the first graphic above. It may be necessary to unclip the grey connector and reroute the one harness underneath the other to achieve this.

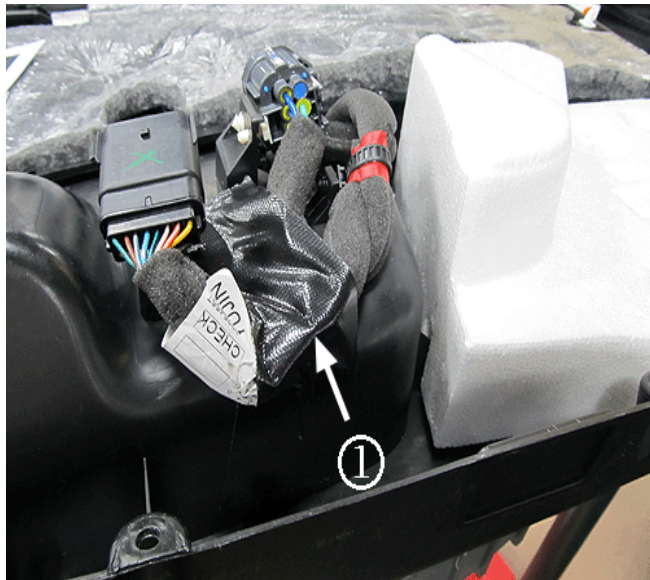

3392315

- 8.2. Add a piece of duct tape (1) to the harness/trim panel to ensure the harnesses and connectors are positioned as close as possible to the door trim.



3392321

8.3. After reconnecting the door side harnesses, position the trim panel to the door ensuring the connectors nest into the pocket formed by the water deflector without causing any undue tension on the deflector adhesive. Also, the window regulator cable should be positioned along side and NOT on top of the door switch harness.

9. Reinstall the trim panel on the affected door. Refer to Front or Rear Side Door Trim Panel Replacement in SI.

*We believe this source and their products to be reliable. There may be additional manufacturers of such products/materials. General Motors does not endorse, indicate any preference for, or assume any responsibility for the products or material from this firm or for any such items that may be available from other sources.

Parts Information

Butyl Windshield Tape is available from Kent Automotive at 1-888-YES-KENT or online at www.kent-automotive.com.

Part Number	Description
P20230	Butyl Windshield Tape (1/8" x 1/4" x 15' roll)

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C0450	Body Side Window Resealing	Use Published Labor Operation Time