



# Service Bulletin

File in Section: -

Bulletin No.: PI0341B

Date: January, 2013

## PRELIMINARY INFORMATION

**Subject:** Front Sunroof Sunshade Will Not Latch in Closed Position

**Models:** 2010-2011 Buick Enclave  
2010-2011 Chevrolet Traverse  
2010-2011 GMC Acadia  
2010 Saturn OUTLOOK  
Equipped with Sunroof RPO C3U  
and Built After August 1, 2009


This PI is being revised to update the Parts Information. Please discard PI0341A.

### Condition/Concern

Some customers may comment that the front sunroof sunshade will not latch in the closed position. The molded-in sunroof sunshade striker on the sunroof module may be broken.

### Recommendation/Instructions

Replace the front sunroof sunshade striker with the service replacement striker by riveting the new striker into the sunroof module assembly.

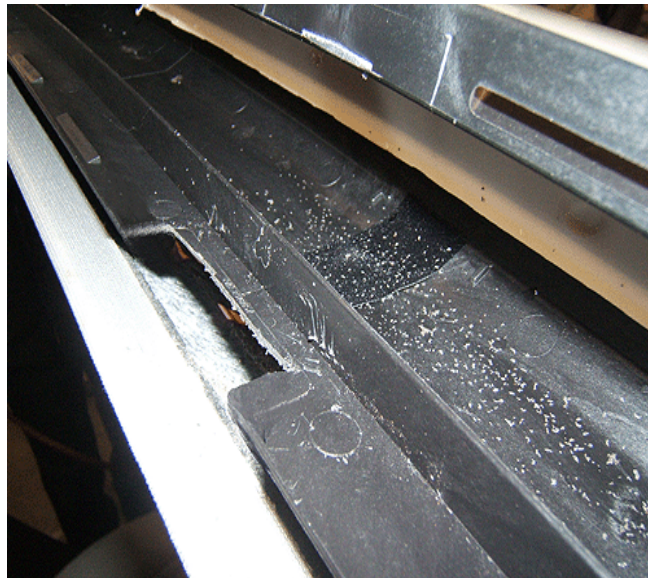

2552962

1. Check that the sunroof sunshade striker fits into where the broken striker was by placing the sunroof sunshade striker under the bottom of the front rail. File to fit if necessary.
2. Place the sunroof sunshade striker on the top surface of the front rail to locate the holes.



2552965

**Important:** When drilling holes, be careful not to drill through the headliner.

3. Drill two 4.5 mm holes.
4. Place the sunroof sunshade striker on the bottom surface of the front rail.



2552964

5. Install rivets from the top side to secure the sunroof sunshade striker in place.
6. Verify striker operation.

## Parts Information

Part Number	Description	Qty
Kent Automotive Part # 1980 or Equivalent	4 mm (5/32 inch) Aluminum Blind Rivet with Grip Range between 1.19–6.35 mm (3/64–1/4 inch)	2
22791456	Sunroof Sunshade Striker	1

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B9962*	Sunroof Sunshade Striker Replacement	0.3 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		