

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

# VW Elsa Newsletter




Das Auto.

Edition 88: June 2, 2014

## Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)

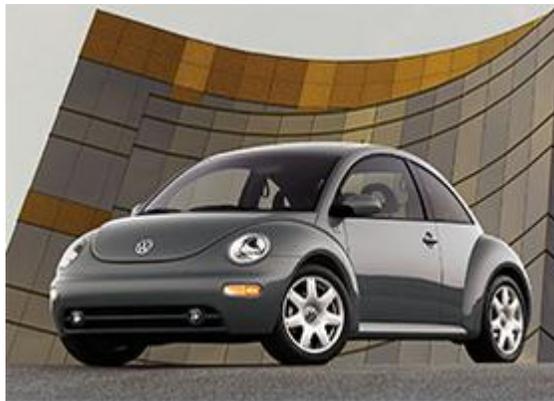

## Technical Bulletins

**17 14 01 - 2020354 Supersedes T.B. V171301 dated March 27 2013 to insert note specific to 2013 and 2014 Carefree Maintenance program. Engine Change Oil Indicator Message ON Prematurely (U.S. Only)**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Routan	2009–2014	All (except 2009-2010 3.8L CGUA)	All	All	All

Based on engine operating conditions, some Routan vehicles may display the “change oil” indicator message more frequently than the every 6,000 miles (MY2009-2010), 8,000 miles (MY2011-2012) and 10,000 miles (MY2013-2014) scheduled maintenance intervals. In some instances, the “change oil” indicator may illuminate as early as 2,500 miles (MY2009-2010) or 3,500 miles (MY 2011-

2014) from the vehicle in-service date or from the last oil change.

**Note:**

MY 2009-2010 with the 3.8L CGUA engine are not applicable. These vehicles have corrected software (Update 17D4/Y7) that prevents oil change indicator illumination before 5500 miles.

**Note:**

MY 2013–2014 Routan are excluded from the Carefree Maintenance program.

**Production Solution:** Not applicable.

**92 14 02 - 2037322 Washer Level Sensor**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All except Routan	2011–2014	All	All	All	All

The issue is caused by the outside influence of non-approved formulated washer fluids. Non-approved washer fluids leave a clear film coating on the sensor probes, insulating the probes so they cannot read the fluid level.

**Production Solution:** Not applicable.

## Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

## Tech Tips

**15-12-03 MIL ON, Fault P0300, P0301, P0302, P0303, P0304, P0305, and/or P0306 Stored In PCM**

Model(s)	Year	Eng.Code	Trans.Code
Routan	2011–2014	All	All

When diagnosing faults P0300, P0301, P0302, P0303, P0304, P0305, and/or P0306 for cylinder misfires, perform a Cylinder Combustion Pressure Leakage Test before replacing any components.

Test procedure can be found in Elsa Repair Manual under Diagnostic Information – Non-DTC Based>Non-DTC Based Diagnostics>00 General, Technical

data>Engine Mechanical, Fuel Injection and Ignition.

If it becomes necessary to open a Technical Helpline VTA case, have results of pressure leakage test available when calling.

Additionally, obtain information on customer drive cycles (city/highway, towing) and what type of fuel the customer is using (Gas or E85).

Replacement cylinder heads do not come equipped with oil galley plugs. Technicians will need to swap galley plugs from original cylinder head to the service replacement. See Tech Tip 15-12-01 for more information. Be aware that replacement oil galley plugs can also be ordered in a separate kit, part number 7B0198057.

**24-13-03 Engine Control Module Fault P130A "Hide Cylinder"  
Update to information: May 23, 2014.**

Model(s)	Year	Eng.Code	Trans.Code
Beetle, Eos, Golf/GTI, Jetta, Passat, Tiguan, Touareg	2008–2014	All	All

DTC P130A "Hide Cylinder" indicates that excessive misfiring has occurred. As a result, the ECM has turned off a fuel injector to prevent catalyst damage. To address this fault, diagnose and repair all misfire concerns that are present. Repairing the other faults will resolve the P130A.

**26-14-01 Ad Blue® Reset Procedure  
Update to information: May 23, 2014.**

Model(s)	Year	Eng.Code	Trans.Code
Touareg	2011–2014	3.0L	All

To reset the Ad Blue level light after the tank has been filled:

**Go to Guided Fault Finding:**

From the control module list view: Right click on the ECM.  
Select Guided Functions > SCR system functions > Ad Blue level to full"

If the light is still present after the reset procedure:

1. ECM control module OBD
2. DTC memory
3. Erase DTC all OBD system (even if there are no faults)
4. Cycle the key off and on

5. Light in the cluster should go off
6. If the light still does not go off, then follow the procedures in GFF.

If light still will not reset, remove fuse S17 from ECM cowling panel and start engine to set system faults.

Reinstall fuse, clear codes, start engine and verify light has reset.

[Back to top](#)

## Campaigns

No new campaigns this week.

## Updates

No new updates this week.

## Suggestions

Please send comments or suggestions to: [woa.workshopinformation@vw.com](mailto:woa.workshopinformation@vw.com)

[Back to top](#)

© 2014 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.