

# Technical Service Bulletin




## 19 Dried coolant or small leak around coolant pump

19 14 53 2039018/1 November 18, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
All	2010 - 2014	All	V6 engine

## Condition

- A small amount of dry or crusted coolant is seen on the coolant pump housing (Figure 1, Figure 2, and Figure 3).
- The coolant level warning is not on.

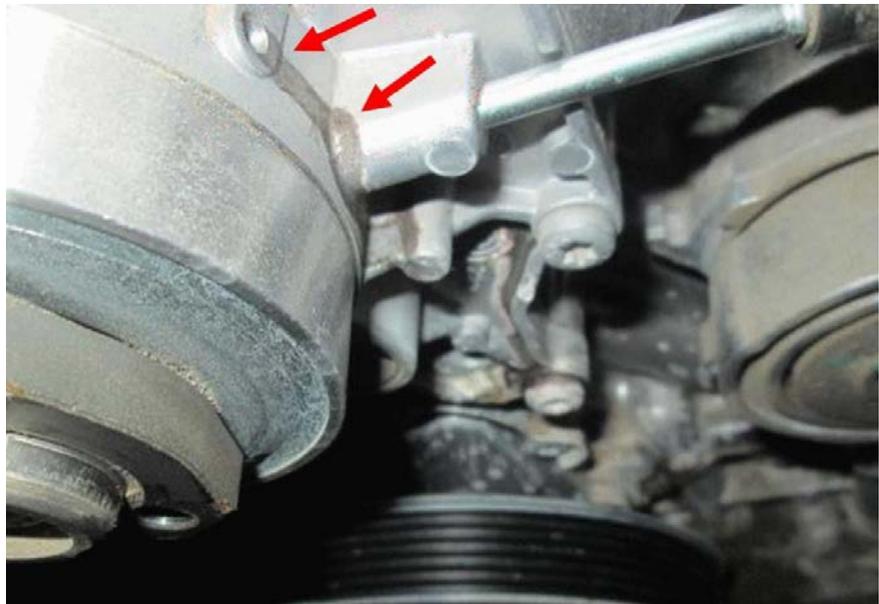

*Figure 1. Dried coolant.*



*Figure 2. Dried coolant.*



*Figure 3. Dried coolant.*

## Technical Background

A minor coolant leak is possible during the break-in phase of the coolant seal on the coolant pump. The dry coolant marks are normal.

# Technical Service Bulletin

---



## Production Solution

Not applicable.

## Service

If dried coolant is found on the coolant pump housing and there is no customer complaint, no repair is necessary. Replacement of the coolant pump is not necessary; a new coolant pump would also show dried coolant during break-in.

## Warranty

This TSB is informational only and is not applicable to any Audi warranty.

## Additional Information

All parts and service references provided in this TSB (2039018) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.