



Countries: CANADA, UNITED STATES, MEXICO  
 Availability: ISIS  
 Major System: ENGINES  
 Current Language: English  
 Other Languages: [Español](#),  
 Viewed: 85

Document ID: IK1201201  
 Revision: 0  
 Created: 8/27/2014  
 Last Modified: 10/10/2014  
 Author: Andrew Miles

[Less Info](#)

Hide Details

Coding Information

|               |                        |   |                      |           |                      |                  |                      |
|---------------|------------------------|---|----------------------|-----------|----------------------|------------------|----------------------|
| Copy Link<br> | Copy Relative Link<br> | Bookmark<br><br><a href="#">View My Bookmarks</a> | Add to Favorites<br> | Print<br> | Provide Feedback<br> | Helpful<br><br>0 | Not Helpful<br><br>1 |
|---------------|------------------------|---|----------------------|-----------|----------------------|------------------|----------------------|

Title: 783 EOP Connector Interference

Applies To: Service Managers, Technician

## CHANGE LOG

Dealers: Please refer to the change log text box below for recent changes to this article:

9/18/2014 - Initial Article Release

## DESCRIPTION

This document will guide the user through providing a corrective action to prevent the Engine Oil Pressure (EOP) harness contacting the A/C lines on 13L equipped LoneStar® and WorkStar® models.

## SYMPTOM(s)

Certain models (through mid 2011) could experience an issue of the Engine Oil Pressure (EOP) harness from contacting or rubbing on the A/C lines.

Diagnostic Trouble Code(s) & Dashboard Indicator Light(s):

| DTC/Light      | Description    |
|----------------|----------------|
| Not Applicable | Not Applicable |


Customer Observations or Concerns:

See SYMPTOM(s).

## SPECIAL TOOL(s) / SOFTWARE

| Tool Description | Tool Number    | Comments       | Instructions   |
|------------------|----------------|----------------|----------------|
| Not Applicable   | Not Applicable | Not Applicable | Not Applicable |



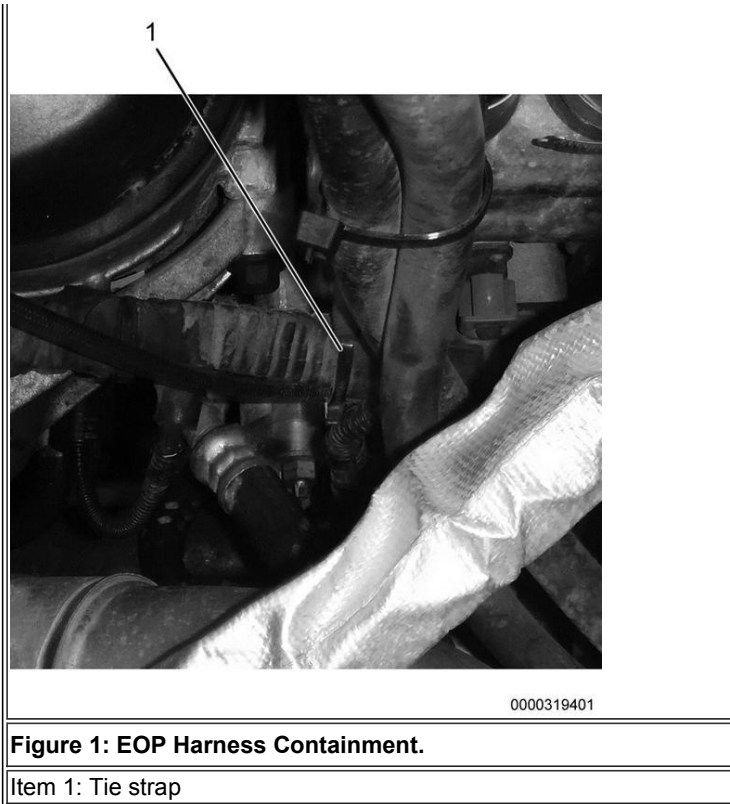

**Figure 1: EOP Harness Containment.**

Item 1: Tie strap

1. Bring vehicle into shop and park on flat surface.
2. Shift transmission to Park or Neutral, set parking brake, and install wheel chocks.
3. Unlatch and open hood.
4. Using tie strap (Figure 1, Item 1), secure the EOP harness to the engine harness.
5. Close and latch hood.
6. Remove wheel chocks.

## **WARRANTY INFORMATION**

Warranty Claim Coding:

|        |                |
|--------|----------------|
| Group: | Not Applicable |
| Noun:  | Not Applicable |

Standard Repair Time(s):

| Step           | Description    | Chassis        | Engine         | SRT            | Hours          |
|----------------|----------------|----------------|----------------|----------------|----------------|
| Not Applicable | Not Applicable | Not Applicable | Not Applicable | Not Applicable | Not Applicable |

Claim SRT Example:

Not Applicable

Claim Comment Suggestion:

Not Applicable

Special Requirement(s):

Not Applicable

---

## **OTHER RESOURCES**

[Master Service Information Site](#)

 Hide Details

### Feedback Information

Viewed: 84  
Helpful: 0  
Not Helpful: 1

No Feedback Found

Copyright © 2014 Navistar, Inc.