

Date	Expiration	Release	Page
04.2014	04.2016	1	1(3)

Revision: A THIS BULLETIN SUPERSEDES ALL PREVIOUS VERSIONS
May. 2014 Fig. 2, change per comments.

DISCONNECT WINDOW OPEN SIGNAL FROM MUX Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, to cancel the DID pop-up message "windows ajar" disconnect wire 260 from MUX module A42.


MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS <i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
X3-45 Commuter Model Year : 2012	From 2PCG33495 <u>CC735053</u> up to 2PCG33495 <u>CC735232</u> incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	


MATERIAL NEEDED

No material is needed for this bulletin.

REQUIRED TOOLS

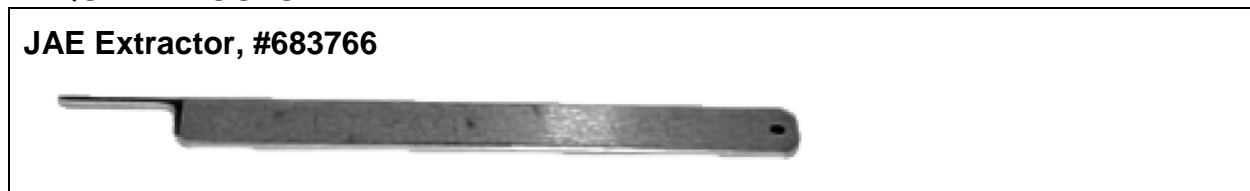

PROCEDURE

 DANGER
Park vehicle safely, apply parking brake, stop engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

- 1) Find module A42 located in the front junction box (Fig. 1)

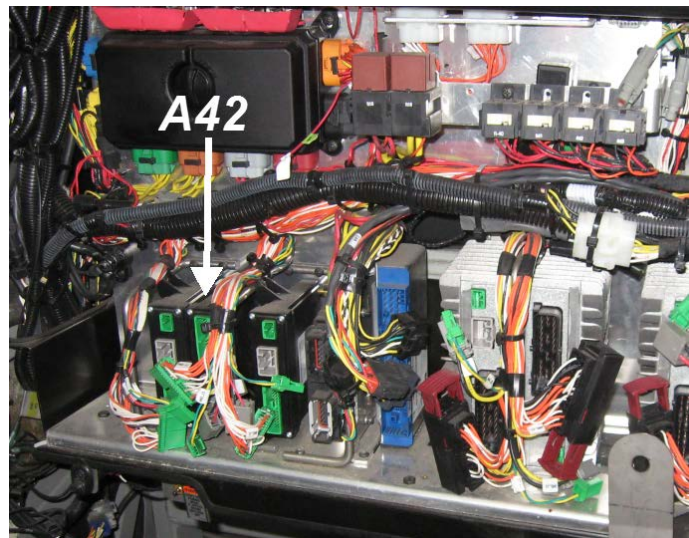


Figure 1

- 2) On module A42, find connector J1 (fig.2, 3) and disconnect.

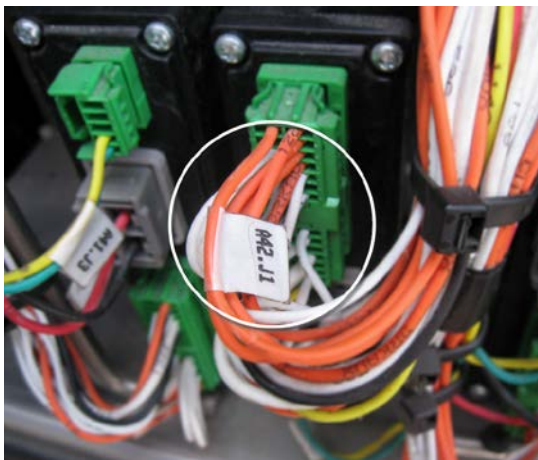


Figure 2

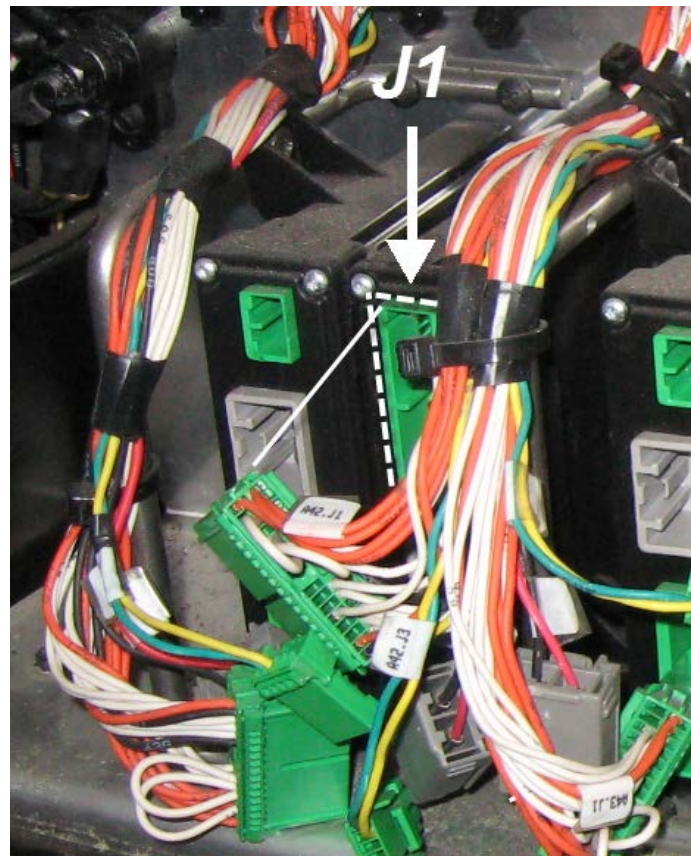


Figure 3

- 3) On connector J1 remove wire 260 in cavity #3. (fig. 4)

Use extractor tool 683766 and remove terminal.

Cut exposed wire and add shrink tube, to seal the wire end.

- 4) Reconnect J1
- 5) Attach 260 wire if loose.
- 6) Restore power to the vehicle and test to confirm window opening does not trigger message in the DID

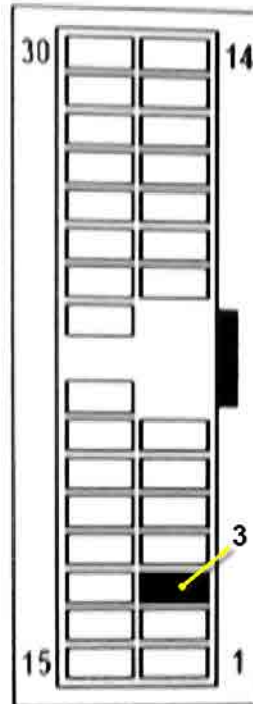


Figure 4

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately 30 minutes.

OTHER

VBC Bulletin	N/A
Fail Code	06.22
Defect Code	09
System Condition	B
Causal Part	064678

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.