



Technical Information Bulletin

i05816915

CT13 3361-3 DEFSP Temp Out of Range High Fault Code Diagnostics

SMCS Code: 7000

On Highway Truck

CT660 (S/N: TGA1-Up; TGD1-Up; TJD1-Up; TEJ1-Up; TRK1-Up; TKL1-Up; TEM1-Up; TEP1-Up; TGR1-Up; TGS1-Up; TJS1-Up; TGT1-Up; TGW1-Up; TSW1-Up; TEY1-Up; TSY1-Up; TEZ1-Up; TGZ1-Up)

Table of Contents

Introduction1
Problem2
Solution.....2

Introduction

The document below shows the repair procedure for the 3361-3 DEFSP Temp Out of Range High Fault Code.

Problem

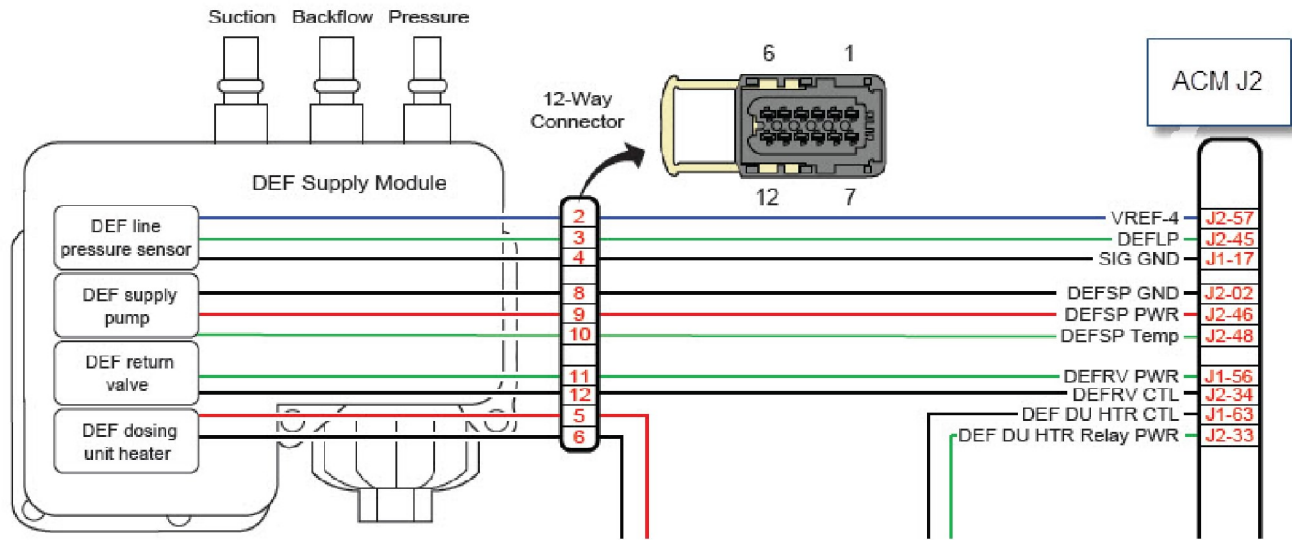


Illustration 1

g03682045

If fault 3361-3 is active, refer to the diagram above, load test and drag test ACM connector J2 pins 46 and 48, and DEF Supply Module 12 way connector pins 9 and 10. If the fault is inactive, return the unit to service. Do not replace the DEF Supply Module.

Solution

There is a calibration fix to resolve this code. Please update the calibration using NETS. Do the GET as "Change Parameters," Send, Receive, and Program.

Note: Verify that the aftertreatment fuel line has been updated to a solid line per REHS9170 prior to updating the calibration file. Failure to replace the line will cause false AFT fuel pressure codes.

Note: 1569-31 SCR Tamperproof Warning and Protection System Inducement Severe will also set with 3361-3.

