

TECHNICAL BULLETIN

LTB00814NAS1

29 SEP 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-02

Underhood Lower NVH Pads Freezing

AFFECTED VEHICLE RANGE:

Range Rover Sport (LW)

Model Year: 2014 Onwards
VIN: 000002 Onwards
Manufacturing Plant: Solihull

Range Rover (LG)

Model Year: 2013 Onwards
VIN: 000010 Onwards
Manufacturing Plant: Solihull

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The underhood lower Noise Vibration Harshness (NVH) pad(s) may show signs of ripping, tearing, and/or has a poor finish.

Cause: This may be caused by ice build up between the foam surfaces and the hood causing penetration into the foam.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:

LR079291	Lower NVH pad - Left	Quantity: 1
LR079292	Lower NVH pad - Right	Quantity: 1

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Lower NVH pads - Renew	76.16.37	0.1	D4	LR079291

 **NOTE: Normal Warranty procedures apply.**


SERVICE INSTRUCTION:

1 Open the hood.

 **NOTE: perform steps 2-5 to both sides of the vehicle.**


2  **NOTE: right-hand shown; left-hand similar.**

Remove and discard the underhood lower right-hand Noise Vibration Harshness (NVH) pad.

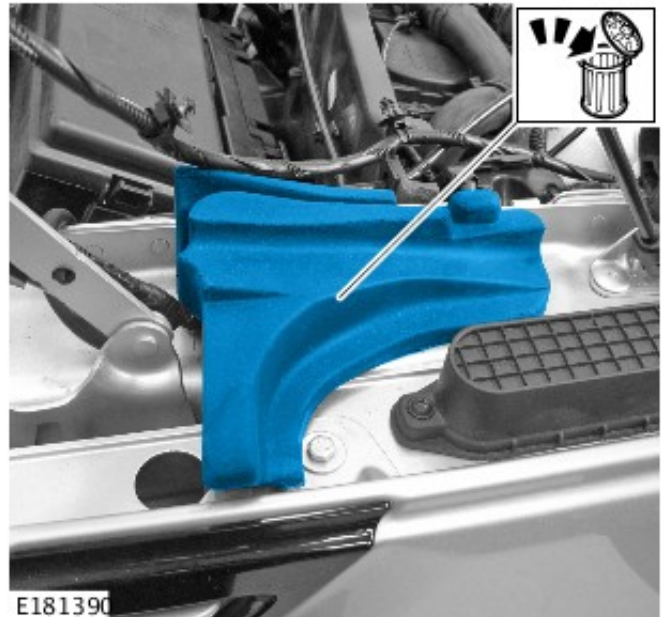


3  **NOTE: right-hand shown; left-hand similar.**

Use a suitable degreaser to clean the area shown.

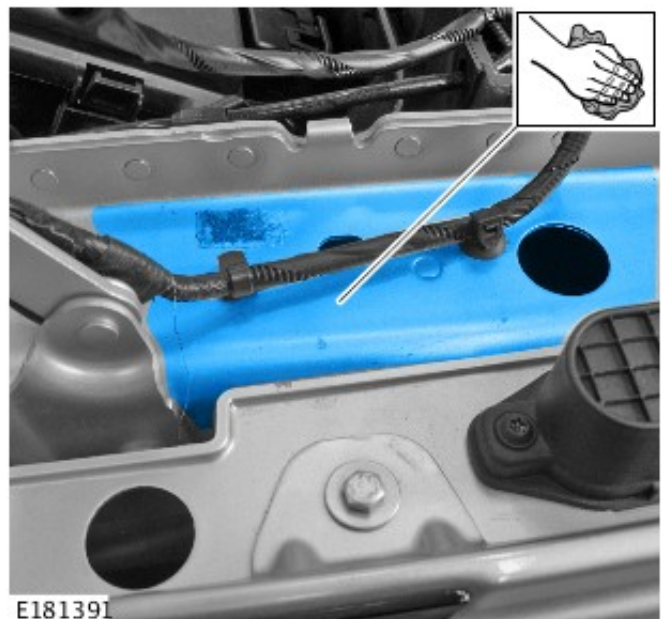

4 Remove and discard the tape backing from the new NVH pad.

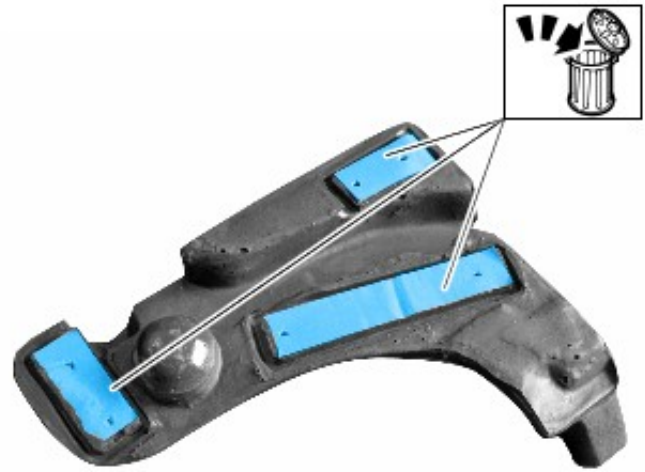

E181392

5  **NOTE: right-hand shown; left-hand similar.**

Install the new underhood lower NVH pad.



E181393

6 Close the hood.