

Date	Expiration	Release	Page
05.2015	05.2017	0	1(3)

Release 0: Initial release.

BRAKE HOSE INSPECTION

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin the brake hose may come in contact with the air spring support when vehicle is in low or high buoy position. Perform an inspection. Depending on the result, adjust the hoses to avoid any interference.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.	
Model	VIN
X3-45 Commuter Model Year : 2012, 2015	From 2PCG33495 <u>C</u> 73 <u>5053</u> up to 2PCG33495 <u>C</u> 73 <u>5232</u> incl. And the following individual vehicles: 2PCG33495 <u>E</u> C73 <u>5590</u> ; 2PCG33498 <u>E</u> C73 <u>5602</u>
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	

MATERIAL NEEDED

No parts are required for this bulletin:

PROCEDURE

 DANGER
Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

1. On each side of the vehicle, make sure that the brake hose to the brake booster does not come into contact when suspension is in low or high buoy.
2. If no contact is found, end the bulletin here.

Date	Expiration	Release	Page
05.2015	05.2017	0	2(3)

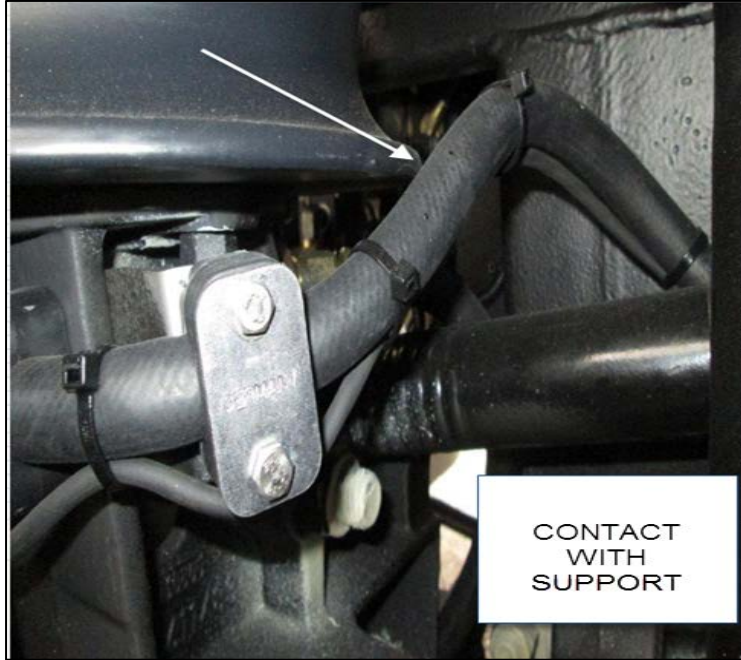


Figure 1

3. If there is interference, reposition the hose on each side of the vehicle as shown in fig. 2 and 3.

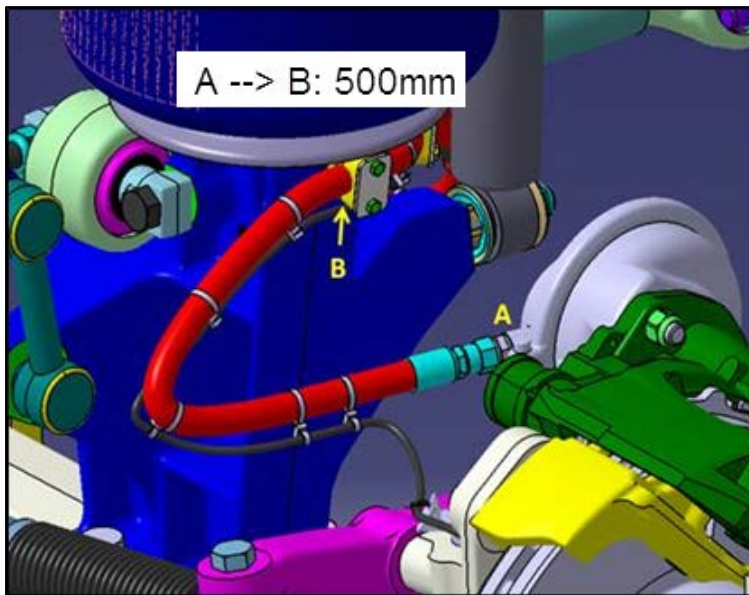


Figure 2

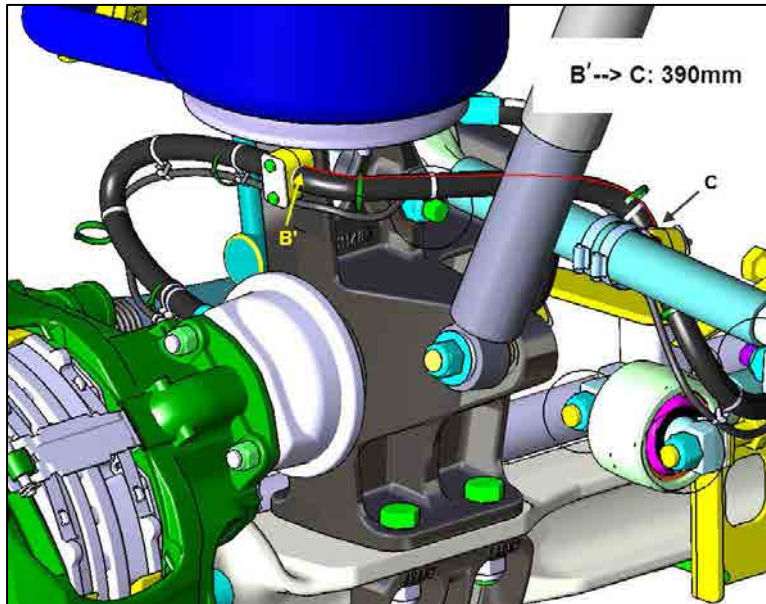


Figure 3

4. Measure and mark distances below on hose and adjust hoses as required to avoid interference.
 - From A to B: 500mm (19 5/8")
 - From B' to C: 390mm (15 3/8")

PARTS / WASTE DISPOSAL

Return replaced parts to Prevost with A.F.A. for full reimbursement.
 Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately half an hour (30 min) for inspection only or one hour (1h) for the complete procedure.

OTHER

VBC Bulletin	N/A
Fail Code	12.03
Defect Code	09
System Condition	B
Causal Part	641908

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.