

ATTENTION:

GENERAL MANAGER ☐
PARTS MANAGER ☐
CLAIMS PERSONNEL ☐
SERVICE MANAGER ☐

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

©2014 Subaru of America, Inc. All rights reserved.



SUBARU

QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2010-14MY Legacy and Outback Models
SUBJECT: Design Change to Retaining Clip for Front ABS Wheel Speed Sensor


NUMBER: 06-49-15
DATE: 05/29/15

INTRODUCTION

In response to isolated reports of cracked or broken ABS wheel speed sensor harness retaining clips caused by reaction with acids used in some wheel cleaners, the clip material has been changed to polypropylene (PPO).

PART INFORMATION

PART NAME:	PART NUMBER:	NOTE:
SEN SUB AY FT (Legacy)	27540AJ12A	GOLD Paint Mark
SEN SUB AY FT (Outback)	27540AJ13A	GREEN Paint Mark

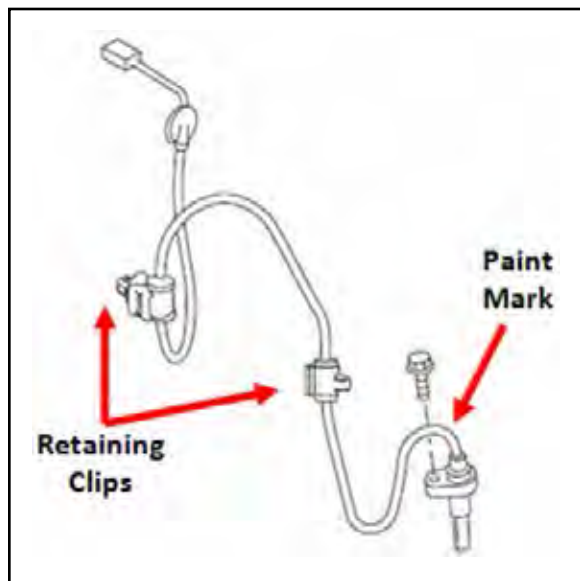

NOTE: The paint markings are located on the harness near the sensor mounting flange end.

Old parts may be recognized on the car by their Pink (Legacy) or Blue (Outback) paint marks.

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE / INFORMATION

IMPORTANT: In the event a cracked or broken sensor harness retaining clip is identified on one side of the vehicle, the opposite side of the vehicle **MUST** be inspected for possible similar damage.

The retaining clips are not serviceable separately. If a cracked or broken clip is identified, the sensor sub-assembly will need to be replaced.

Follow the service procedure in the applicable Service Manual for replacing the ABS sensor sub-assembly. The retaining bolt torque specification is 7.5Nm (5.5 ft. lbs.).

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period or with an active Added Security Classic or Gold Service Agreement, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
LEG / OBK FRONT ABS WHEEL SPEED SENSOR SUB-ASSEMBLY REPLACE (ONE)	A566-011	UQX-01	0.4
LEG / OBK FRONT ABS WHEEL SPEED SENSOR SUB-ASSEMBLY REPLACE (BOTH)	A566-014		0.7

REMINDER: SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.

Always refer to STIS for the latest service information before performing any repairs.