



SI B11 08 15
Engine

March 2016
Technical Service

This Service Information bulletin and attachment supersedes SI B11 08 15 **dated November 2015.**

SUBJECT

N63 and S63 Engine: Valve Seal Replacement

MODEL

F01 and F02 (7 Series Sedan)

Produced from 9/2008 to 6/2012

F04 (ActiveHybrid 7)

Produced from 4/2010 to 6/2012

F07 (Gran Turismo)

Produced from 9/2009 to 6/2012

F10 (5 Series Sedan)

Produced from 3/2010 to 7/2013

F12 (6 Series Convertible)

Produced from 3/2011 to 7/2012

F13 (6 Series Coupe)

Produced from 7/2011 to 7/2012

E70 (X5)

Produced from 3/2010 to 6/2013

E71 (X6)

Produced from 7/2008 to 6/2014

E72 (ActiveHybrid X6)

Produced from 9/2009 to 9/2011

NEW With the N63 Engine (excluding ALPINA)

NEW E70 (X5M)

NEW Produced from 3/2009 to 6/2013

NEW E71 (X6M)

NEW Produced from 3/2009 to 6/2014

NEW With the S63 Engine

SITUATION

Refer to the following applicable SIBs before replacing the valve seals.


- [SI B11 07 11](#) - Turbocharger Failure: Oil Supply and Return Line Blockage and Proper Repairs
- [SI B11 07 12](#) - N63 Engine: Oil Consumption and/or Rough Running Complaints
- [SI B11 01 13](#) - N63 Engine: Engine Oil Consumption, Engine Oil Top-ups and Refill Capacity
- [SI B11 03 13](#) - Engine Oil Consumption (all models)


If the valve seals are leaking, one of the following will help determine if the seals should be replaced.

- Smoke from the tailpipe when starting or aggressively accelerating and decelerating the engine
- Excessive engine oil consumption
- Spark plugs fouled with engine oil

PROCEDURE

If one of these conditions is verified, replace the intake and exhaust valve stem seals using special tool P/N 83 30 2 408 268.

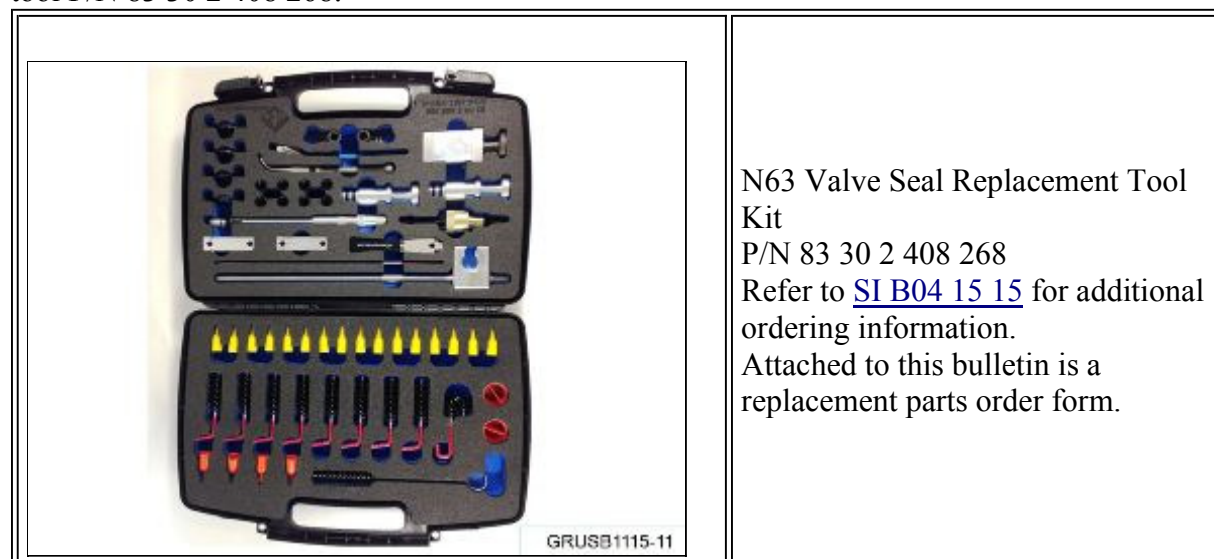

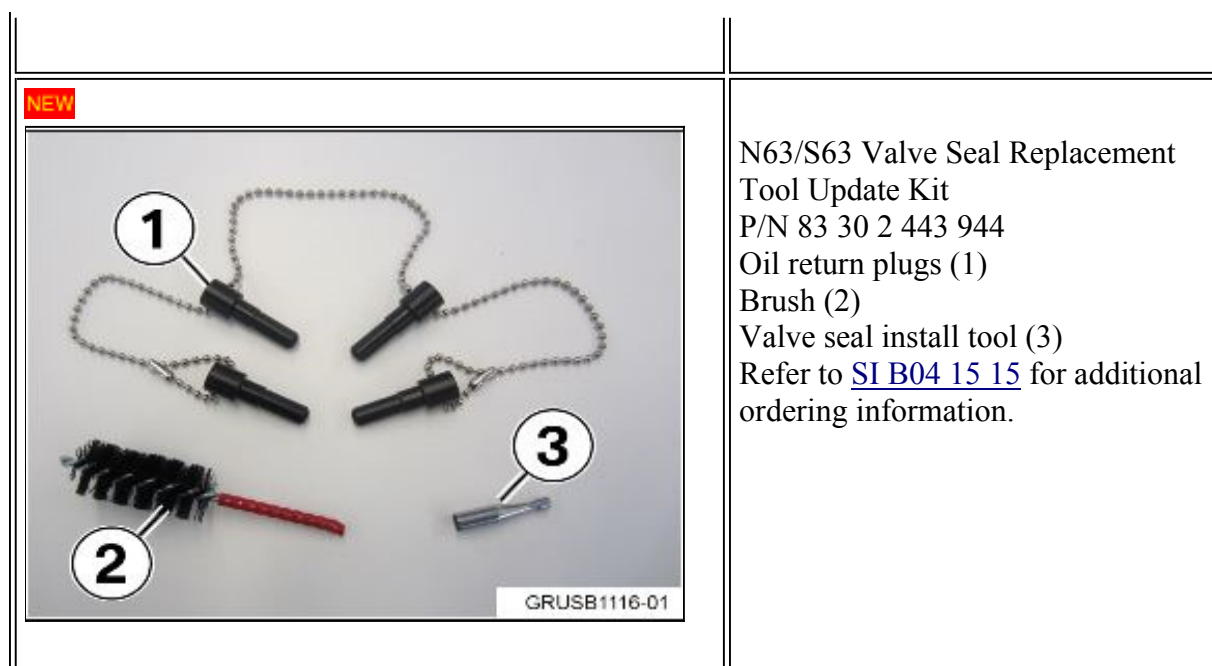

The attached valve seal replacement procedure supersedes the current version of the ISTA/D valve seal replacement repair instructions. **Do not remove the engine from the vehicle.**

Replace the engine oil and engine oil filter when the valve seal replacement is completed.

If the engine oil service task shows Recommended, Due or qualifies to be performed based on the “60-day Bundling” procedure (see [SI B01 06 13](#)), reset the engine oil service CBS data to 100%.

The video procedure for replacing the valve stem seals can be viewed via the TIS Website using the following path:

1. Select “Service Reference” from the top menu bar.
2. Select “Service Videos.”
3. Select “General Search.”
4. Select “[11] Engine” and “Submit.”

Select “V11 04 15 May 2015 – “N63 Valve Stem Seal Tool Procedure”

PARTS INFORMATION

The parts information below only applies to the intake and the exhaust valve seal replacement.

Refer to the ETK and the applicable repair instructions for one-time use fasteners and/or component information regarding additional or replacement screws, gaskets, and seals that need to be installed and claimed.

Part Number	Description	Quantity
11 34 0 039 494	Valve seal repair kit	2

11 12 7 566 281	Timing chain tensioner cover gasket	2
11 12 7 566 288	Cylinder head cover profile gasket (cylinders 1-4)	1
11 12 7 566 289	Cylinder head cover profile gasket (cylinders 5-8)	1
11 12 7 566 290	High-pressure pump profile gasket	2
11 36 7 564 346	VANOS central screws	4
11 42 7 583 220	Engine oil filter	1
13 53 7 584 315	Injector gasket ring seal	8
13 53 7 564 751	Injector decoupling element	8

Bulk Materials - Sublet

Part Number	Description	Quantity
NEW 83 21 2 365 946	5W30 BMW Engine Oil 1 liter	Up to 9.6 liters
		(E72, F04 8.5)
82 14 1 467 704	Antifreeze	See Sublet
		(1 Gallon)
83 29 0 429 576	Hydraulic fluid CHF 11 S (F01, F02, F04, F07)	See Sublet
		(up to 1)

1 Gallon Antifreeze = 2 Gallons at a 50/50 mixture solution.

NEW WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

N63 Engine:

Defect Code:	11 34 06 48 00	

Labor Operation:	Labor Allowance:	Description:
11 31 019	Refer to KSD2	Removing and installing or replacing all camshafts
And:		
11 34 570	Refer to KSD2	** Replacing the valves seals using the attached procedure and BMW Special Tool 83 30 2 408 268
And:		
00 00 610	Refer to KSD	Change engine oil and filter (If not due, see below*) in conjunction with this repair

Or, for the:

S63 Engine:

Defect Code:	11 34 06 48 00	
Labor Operation:	Labor Allowance:	Description:
11 31 019	Refer to KSD2	Removing and installing or replacing all camshafts
And:		
11 99 000	85 FRU	Work time for replacing the valves seals using the attached procedure and BMW Special Tool 83 30 2 408 268
And:		
00 00 610	Refer to KSD	Change engine oil and filter (If not due, see below*) in conjunction with this repair

N63 Engine:

** The labor operation was changed from 11 99 000 to 11 34 570 and the corresponding number of FRU's was changed from 54 units to 85 units.

All Engines:

If you are using a Main labor code for another repair, use the Plus code labor operation 11 31 519 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

S63 Engine:

Work time labor operation code 11 99 000 is not considered a Main labor operation. Also, since the “work time” FRU allowance to be claimed is specified, a separate punch time is not required.

*If the vehicle has a “active” maintenance program and the “Engine oil” Service task shows “Recommended or Due” in the Service status field or it “qualifies” to be performed based on the “60-day Bundling” procedure (See [SI B01 06 13](#)), then:

- Perform the “Engine oil” Service task, and
- “Reset” the CBS data, then

Submit and claim the engine oil and filter “part numbers” under the BMW Maintenance Program.

Note: The above procedure replaces performing and claiming labor operation 11 34 560, together with the corresponding “pre-work procedure” labor operations identified in KSD2 as applicable.

And:

Sublet – Materials

Sublet Code 4	See sublet reimbursement calculation below	Reimbursement for used quantities of required operating fluids, including engine oil only when it is not claimed under the BMW Maintenance Program (applicable BMW part numbers). Please do not use these part numbers for claim submission.
---------------	--	--

Sublet calculation:

Reimbursement for used quantities of required operating fluids (applicable BMW part numbers) at dealer net plus handling.

Enter the material cost in sublet and itemize the amount in the claim comment section.

Overlapping Labor – Associated and Other Repairs

NEW If invoicing the KSD2 flat rate labor operation codes for additional repair work results in overlapping labor being claimed, invoice work time labor operation 00 50 000 instead for the

additional time needed (FRUs minus the overlap).

NEW On the repair order and in the claim comment section, please identify the labor operations that labor operation code 00 50 000 replaces and itemize the claimed FRU amount.

Work time labor operation code 00 50 000 is not considered a Main labor operation.

Associated Repairs: When work time labor operation 00 50 000 is used as an extension of the

Other Repairs: When work time labor operation 00 50 000 is used for work that will be claimed under different defect codes, separate punch time(s) are required.

ATTACHMENTS

View PDF attachment [**B110815 N63.S63 Valve Seal Replacement Procedure TU.**](#)

View PDF attachment [**B110815 N63 Valve Seal Tool Order Form.**](#)

[Copyright ©2016 BMW of North America, Inc.]