

TECHNICAL BULLETIN  
JTB00505NAS2  
19 SEP 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

**SECTION: 501-17**

Roof Opening Panel Air Deflector Spring(s) Out Of Position

**AFFECTED VEHICLE RANGE:**

**F-PACE (X761)**

**Model Year:** 2017  
**VIN:** 049491-062601 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Solihull

**XE (X760)**

**Model Year:** 2017  
**VIN:** 900587-956683 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Solihull

**XF (X260)**

**Model Year:** 2016-2017  
**VIN:** Y00461-Y35904 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Castle Bromwich

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The roof opening panel may not close correctly.



**NOTE:** The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.

**Cause:** This may be caused by the roof opening panel air deflector spring(s) coming out of its location guide and not allowing the deflector to operate correctly.

**Action:** Should a customer express this concern, follow the appropriate Service Instruction (A [XE / XF] or B [F-PACE]) below.

**PARTS:**

T2H26120	Rubber Seal	2
----------	-------------	---

**TOOLS:**


Refer to Workshop Manual for any required special tools.

**WARRANTY:**



**NOTE:** The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Panoramic roof - Edge finisher - Install	76.82.62	0.1	02	T4N7733

 **NOTE:** Normal Warranty procedures apply.

### **SERVICE INSTRUCTION 'A' - XE (X760) and XF (X260) ONLY**


 **NOTE:** The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.

1. Open the roof opening panel to its fully open position.

2.  **NOTE:** Left-side shown; right-side similar.

 **NOTE:** Parts shown removed for clarity.

Locate the area shown.

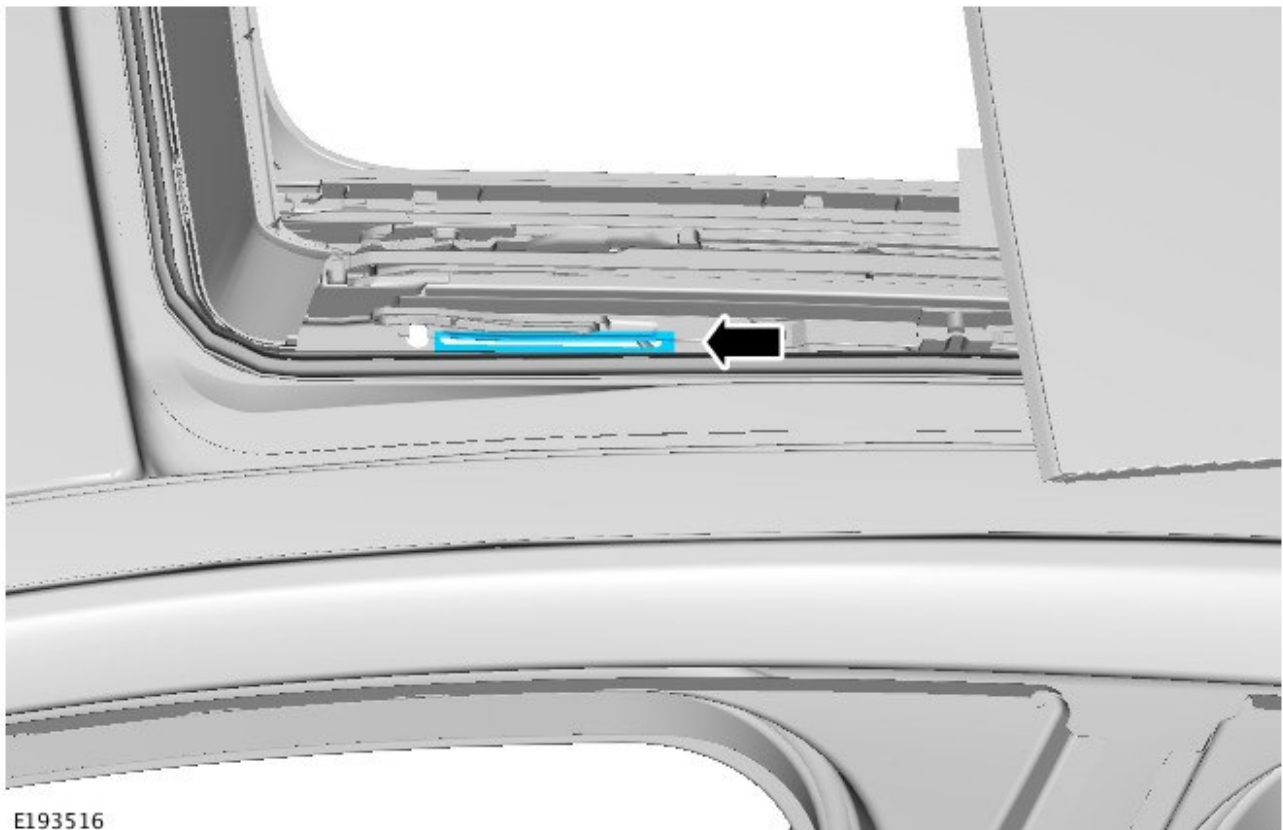

E193516

3.  **NOTE:** Right-side shown; left-side similar.


 **NOTE:** Seal length - 80 mm.

Install the rubber seal



4.  **NOTE: Right-side shown; left-side similar.**

Visually check that the rubber seal is installed correctly as shown.

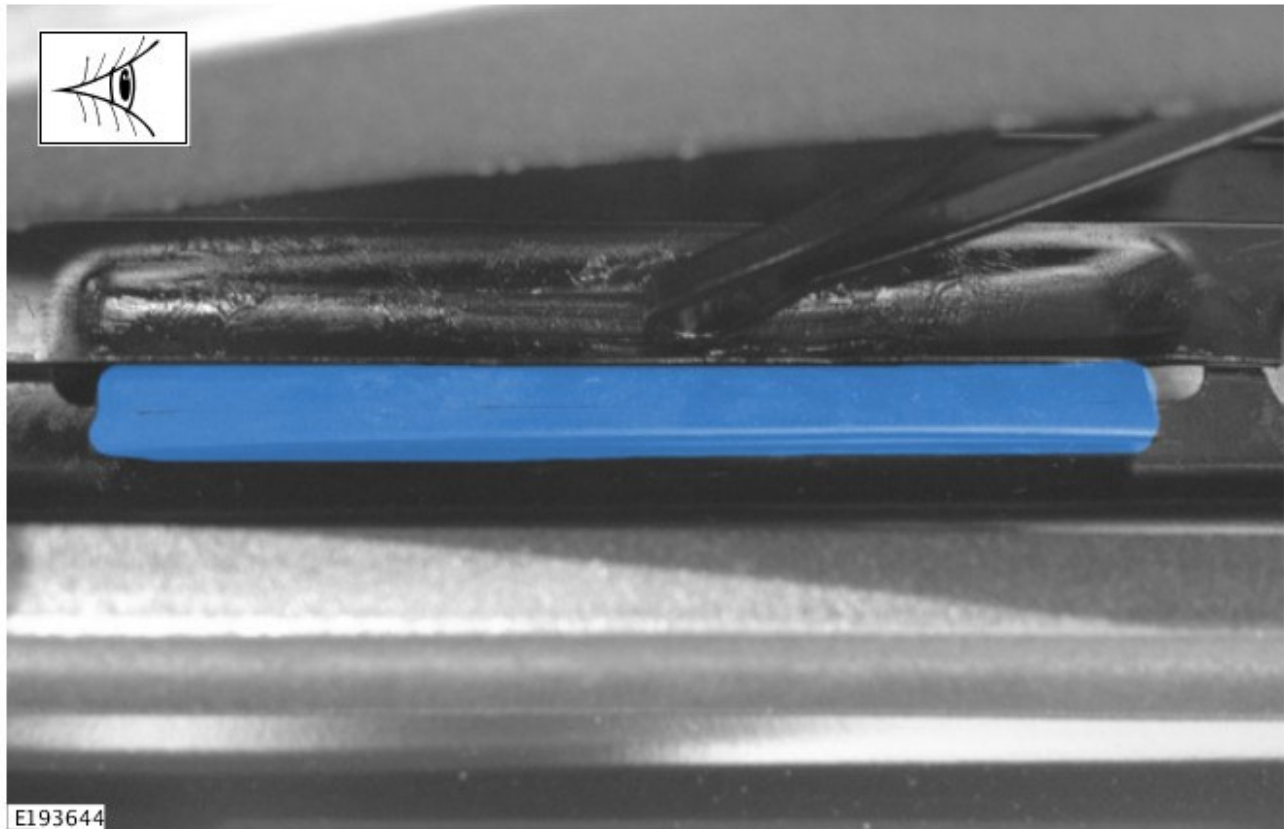

5. Repeat Steps 2-4 for the other side.

6. Close the roof opening panel.

### **SERVICE INSTRUCTION 'B' - F-PACE (X761) ONLY**


 **NOTE: The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.**

1. Open the roof opening panel to its fully open position.

2.  **NOTE: Left-side shown; right-side similar.**

 **NOTE: Parts shown removed for clarity.**

Locate the area shown.

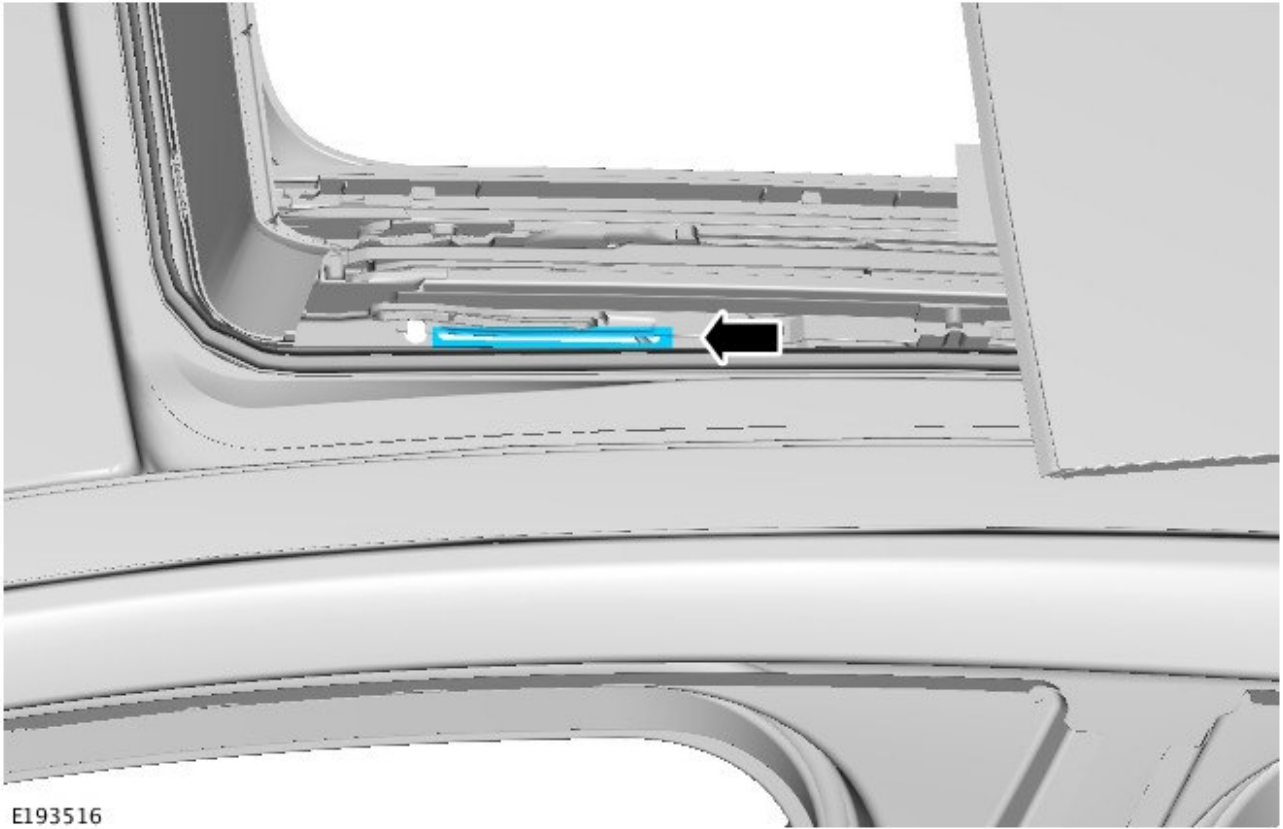

3. Cut and discard 20 mm from the rubber seal.



E193537

4.  **NOTE: Right-side shown; left-side similar.**

 **NOTE: Seal length - 60 mm.**


Install the rubber seal



5.  **NOTE: Right-side shown; left-side similar.**

Visually check that the rubber seal is installed correctly as shown.



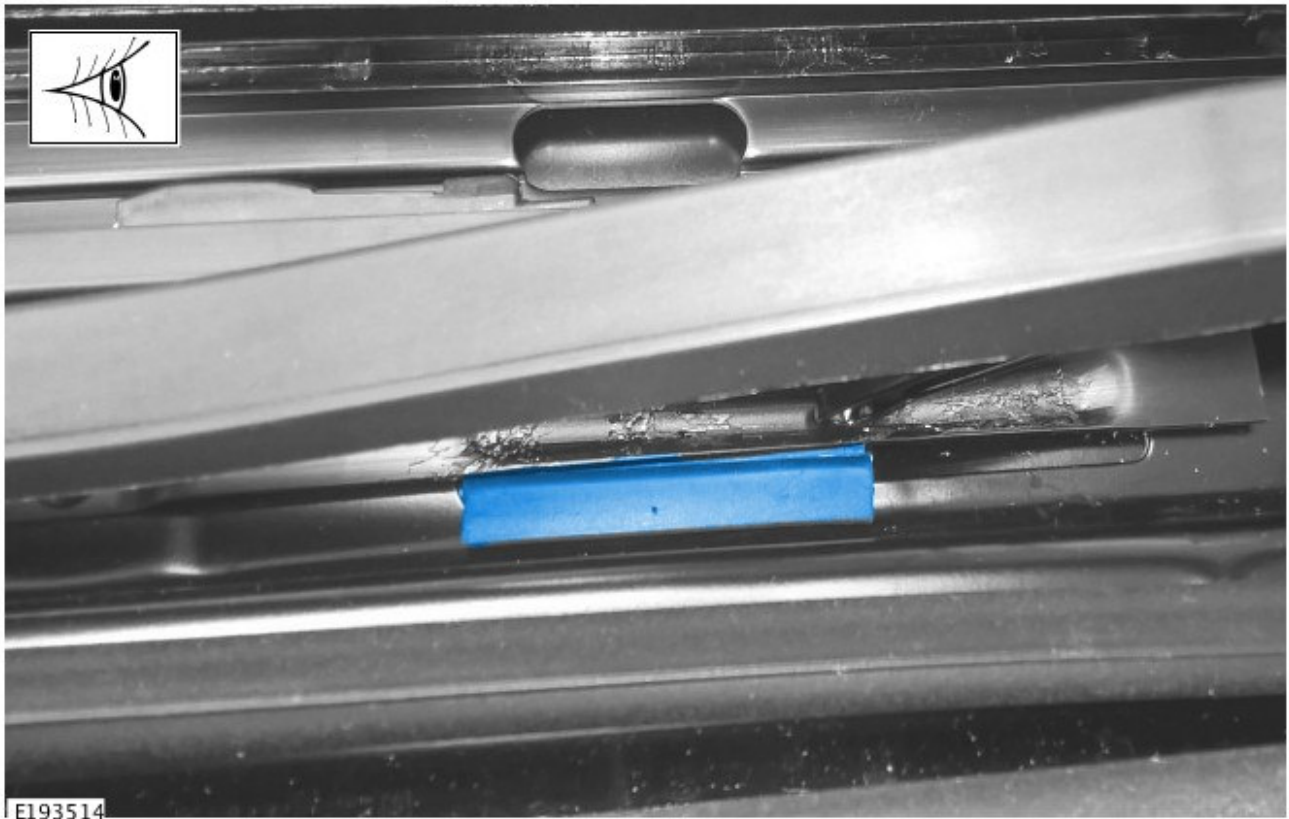

**6.** Repeat Steps 2-5 for the other side.

**7.** Close the roof opening panel.



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**SECTION: 501-17**

**Roof Opening Panel Air Deflector Spring(s) Out Of Position**

**AFFECTED VEHICLE RANGE:**

**F-PACE (X761)**

**Model Year:** 2017  
**VIN:** 900587-062601 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Solihull

**XE (X760)**

**Model Year:** 2017  
**VIN:** 049419-956683 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Solihull

**XF (X260)**

**Model Year:** 2016-2017  
**VIN:** Y00461-Y35904 Vehicles With: Roof Opening Panel  
**Assembly Plant:** Castle Bromwich

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The roof opening panel may not close correctly.



**NOTE: The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.**

**Cause:** This may be caused by the roof opening panel air deflector spring(s) coming out of its location guide and not allowing the deflector to operate correctly.

**Action:** Should a customer express this concern, follow the appropriate Service Instruction (A [XE / XF] or B [F-PACE]) below.

**PARTS:**

T2H26120	Rubber Seal	2
----------	-------------	---

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:**



**NOTE: The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.**



**NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**



**NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
-------------	-----	--------------	----------------	-------------



 **NOTE: Normal Warranty procedures apply.**

## **SERVICE INSTRUCTION 'A' - XE (X760) and XF (X260) ONLY**


 **NOTE: The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.**

1. Open the roof opening panel to its fully open position.

2.  **NOTE: Left-side shown; right-side similar.**

 **NOTE: Parts shown removed for clarity.**

Locate the area shown.

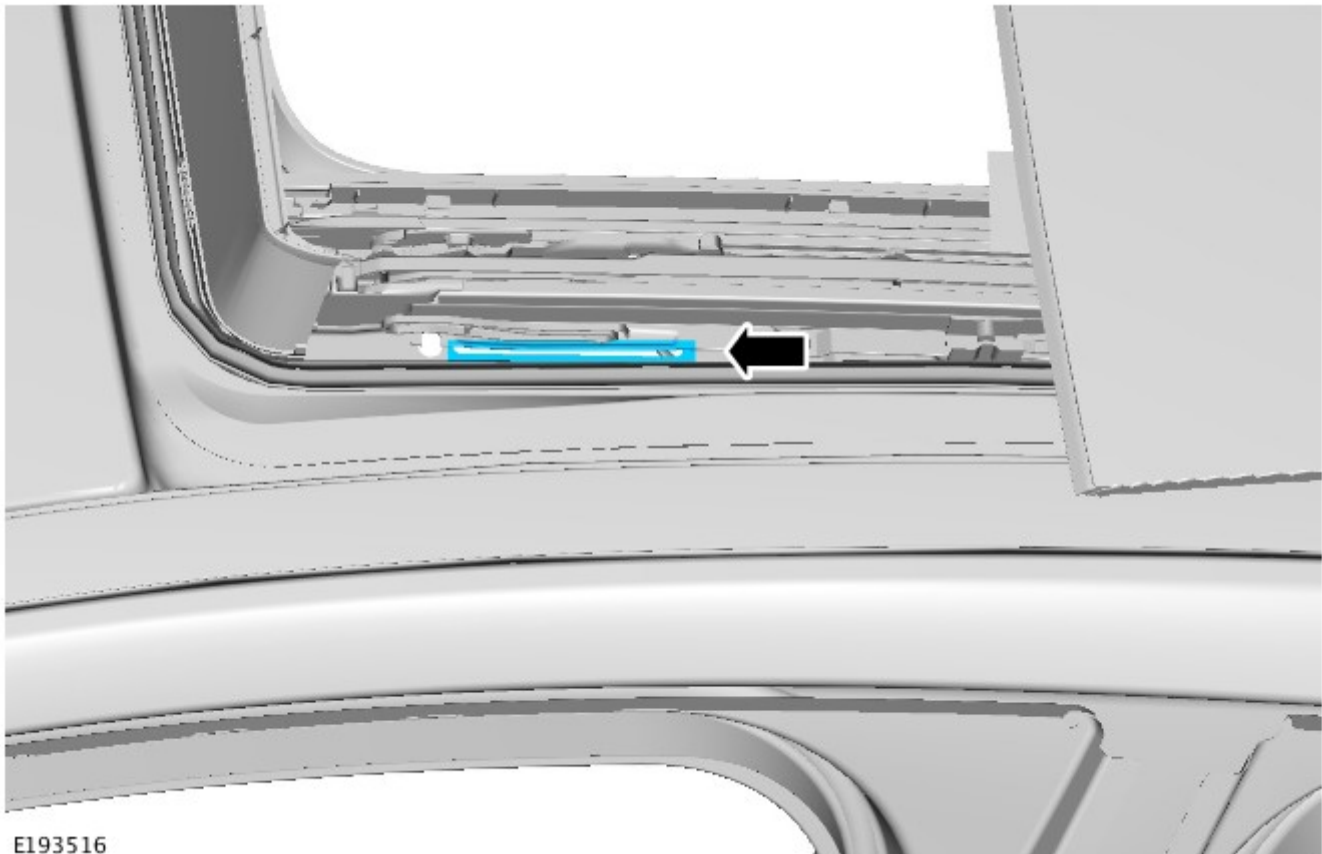

E193516

3.  **NOTE: Right-side shown; left-side similar.**

 **NOTE: Seal length - 80 mm.**


Install the rubber seal



E193513

4.  **NOTE: Right-side shown; left-side similar.**

Visually check that the rubber seal is installed correctly as shown.

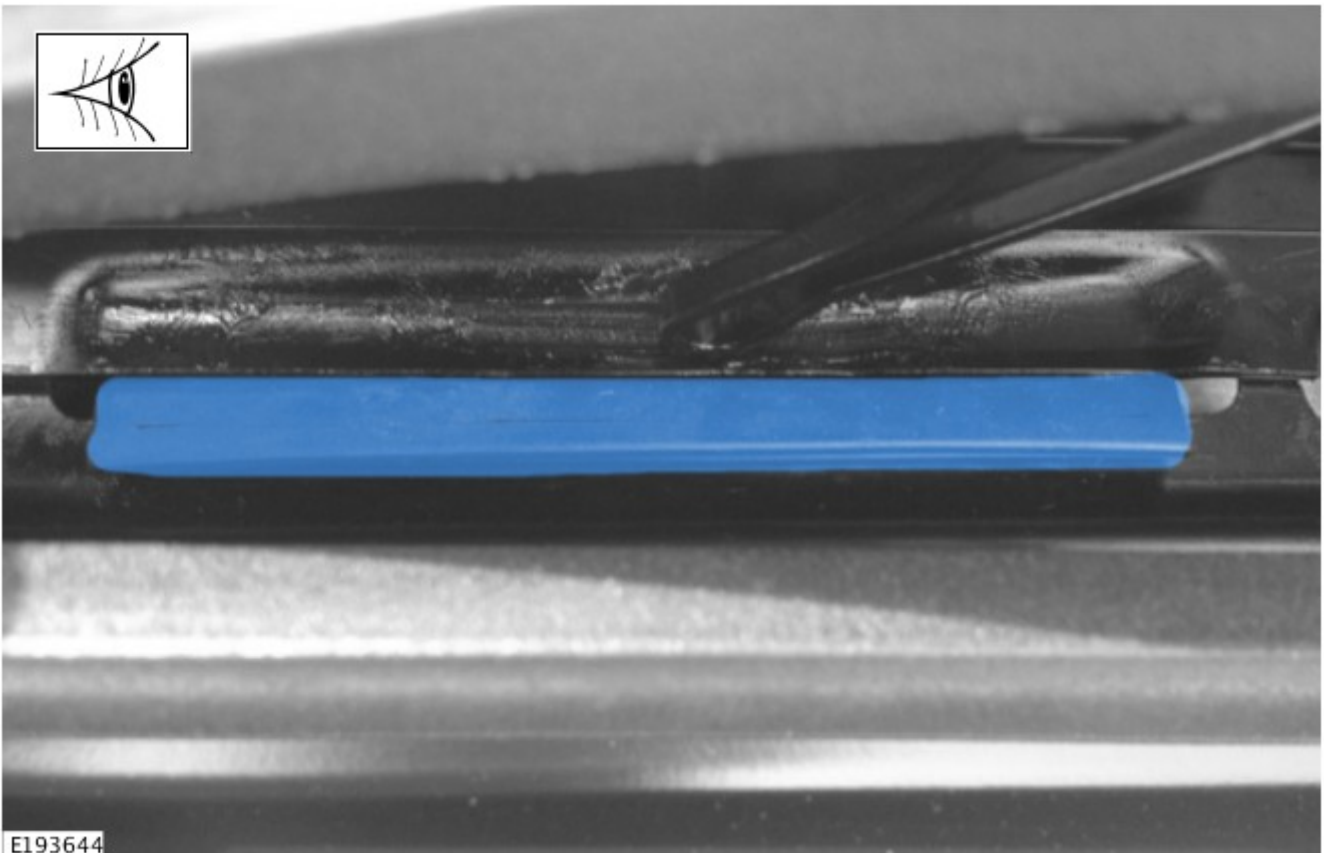

E193644

5. Repeat Steps 2-4 for the other side.

6. Close the roof opening panel.

### **SERVICE INSTRUCTION 'B' - F-PACE (X761) ONLY**


 **NOTE: The Roof Opening Panel may also be referred to as Panoramic Roof Opening Panel.**

1. Open the roof opening panel to its fully open position.

2.  **NOTE: Left-side shown; right-side similar.**

 **NOTE: Parts shown removed for clarity.**

Locate the area shown.

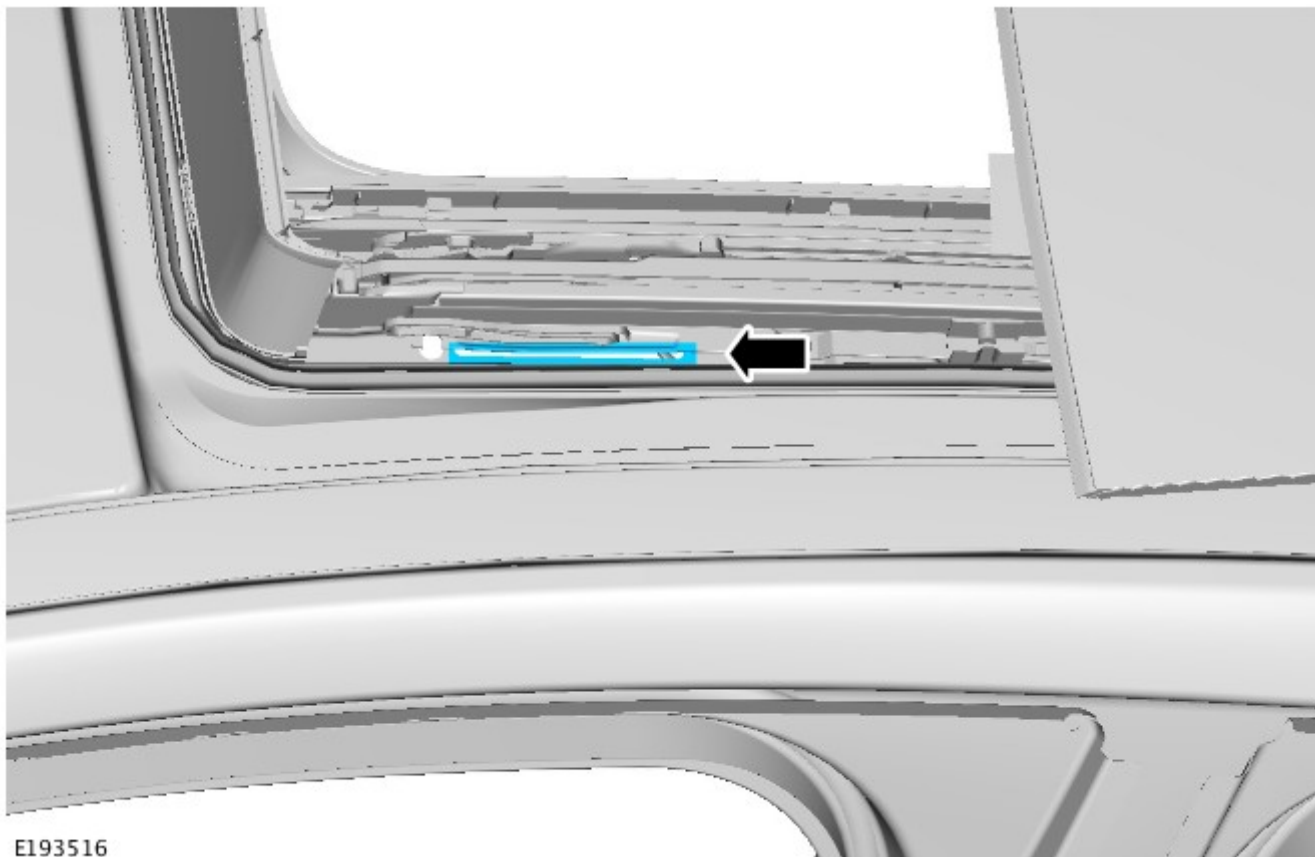

E193516

3. Cut and discard 20 mm from the rubber seal.



E193537

4.  **NOTE: Right-side shown; left-side similar.**


 **NOTE: Seal length - 60 mm.**

Install the rubber seal



5.  **NOTE: Right-side shown; left-side similar.**

Visually check that the rubber seal is installed correctly as shown.

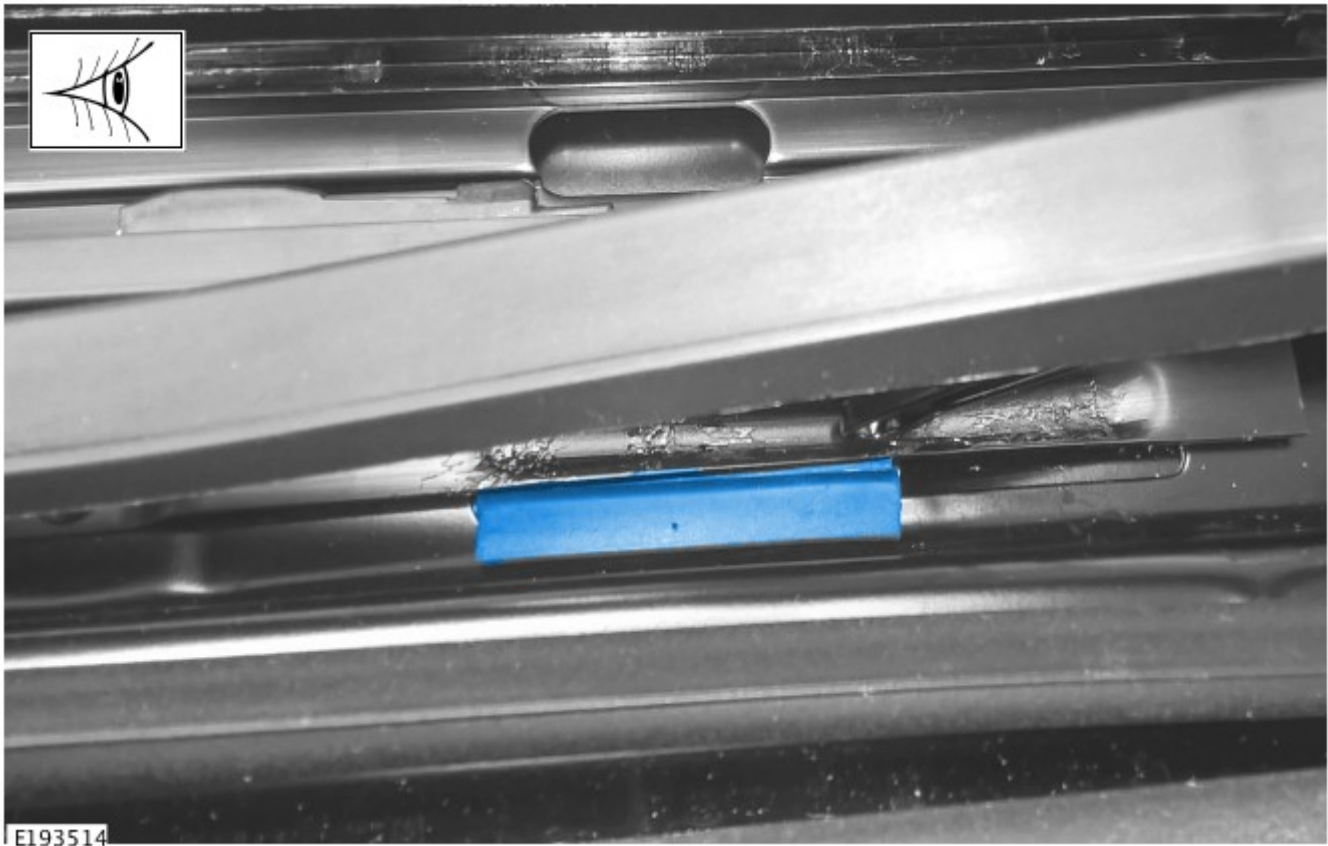

**6.** Repeat Steps 2-5 for the other side.

**7.** Close the roof opening panel.